



EXPERT II A Series User Manual



<http://www.GCCworld.com>

NOTICE

GCC reserves the right to modify the information contained in this user manual at any time without prior notice; un-authorized modification, copying distribution or display is prohibited. All comments, queries or suggestions concerning this manual please consult with your local dealer.

Important Information


Thank you for purchasing the **Expert II A Cutting Plotter**.

Before you use the cutting plotter, please make sure that you have read the safety precautions and instructions below.




SAFETY PRECAUTIONS!

- For safety concern, please always hold the cutter firmly **from the bottom** while moving it. Do not move the cutter by clasping the depression area on both sides.

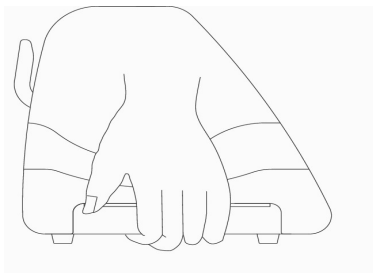

O (correct)

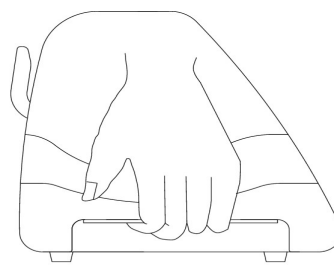

X (Incorrect)

- Do not shake or drop the blade holder, a blade tip can fly out.
- During an operation, do not touch any of the moving parts of this machine (such as the carriage). Also be careful to make sure that clothing and hair do not get caught.
- Always connect the power cable to a grounded outlet.
- Always use the accessory power cable which is provided. Do not wire the power cable so that it becomes bent or caught between objects.
- Do not connect the power cable to branching outlet to which other machines are also connected, or use an extension cable. There is danger of overheating and of operation of the machine.
- Keep the tools away from children where they can reach.
- Always put the pinch rollers within the white marks.

Table of Contents

Important Information

1. General Information

1.1	Package Items	1-1
1.2	Product Features	1-1
1.3	The Appearance	1-2

2. Installation

2.1	Precaution	2-1
2.2	Stand Installation	2-3
2.3	USB Cable Tie and Saddle	2-8
2.3	Blade Installation	2-8
2.4	Media Loading	2-12
2.4.1	Loading the Sheet Media	2-12
2.4.2	Loading the Roll Media	2-14
2.4.3	How to Change the Poll Size Without Turning off the Machine?	2-14
2.5	Cable Connections	2-15
2.5.1	USB Interface	2-15
2.5.1.1	Connecting your GCC cutter	2-15
2.5.1.2	Installing the driver	2-15
2.5.1.3	Driver Un-installation	2-19
2.5.2	RS-232 Interface	2-22
2.5.3	Data Transmitting	2-22
2.5.4	Printer Sever Shared Setting	2-23
2.6	Software Installation	2-25
2.6.1	GreatCut Installation	2-25
2.6.2	Sure Cuts A Lot Installation	2-30
2.6.2.1	Auto Installation	2-30
2.6.2.2	Manually Activate Software	2-34
2.6.2.3	Re-install Sure Cuts A Lot Software	2-36

3. Operation

3.1	The Control Panel	3-1
3.2	VLCD	3-3
3.3	File Uploader	3-7
3.4	Data Transmission	3-8
3.5	AR-24 Print Driver setting	3-8
3.5.1	Option Page	3-8
3.6	Reference Parameter setting for different materials	3-11

4. Basic Maintenance

4.1	Cleaning the cutting Plotter	4-1
4.2	Cleaning the Grid Drum	4-1
4.3	Cleaning the Pinch Rollers	4-2

5. Automatic-Aligning System

5.1	Introduction	5-1
5.2	AAS Contour Cutting System	5-2
	5.2.1 Notice for Registration Marks	5-2
	5.2.3 AAS II on Expert II A	5-3
5.3	Printer Test	5-4
5.4	Registration Mark Offset Range	5-5
5.5	Contour Cutting	5-6
5.6	Tips for AAS	5-8

6. Trouble Shooting

6.1	What if Expert II A cannot Operate?	6-1
6.2	Light Indicators	6-1
6.3	Cutting Quality Problems	6-4

Appendix

A-1	Expert II A Specification	A-1
A-2	Blade Specification	A-2
A-3	CorelDRAW Output Instruction	A-3
A-4	CorelDRAW Plug-In Instruction	A-4
A-5	Illustrator Plug-In Instruction	A-5
A-6	GreatCut Plug-In Instruction	A-6
A-7	SignPal Instruction	A-7
A-8	Sure Cuts A Lot	A-8

Chapter 1 General Information

1.1 Introduction


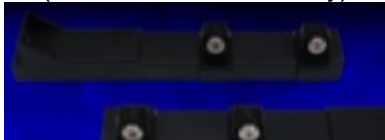
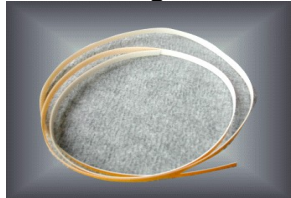




Expert II A series cutting plotters have been designed to produce computer-generated images or perform contour cutting on sheets or rolls of vinyl media. In addition to performing quality cutting on sheet or rolls of media, Expert II A series cutting plotters can also be used as a pen plotter.

This manual covers the following models of Expert II A series cutting plotters:

.Ex II-24	for media width: 50mm(1.97") ~ 719mm(28.3")
.Ex II-24LX	for media width: 50mm(1.97") ~ 719mm(28.3"), with AAS function
.Ex II-52	for media width: 50mm(1.97") ~ 1470mm(57.9")
.Ex II-52LX	for media width: 50mm(1.97") ~ 1470mm(57.9"), with AAS function

1.2 Package Items

The package of Expert II A contents the items listed below, please check carefully. If you find any item missing, please consult your local dealer for further assistance.

Item	Quantity	
Cutting Plotter	1 Set	
Accessories	1 Set	
AC Power Cord 	Desktop Support Brackets (EX II-24/EX II-24LX only) 	Cutting Pad 
USB Cable (1.8m) 	Cushion in tool carriage 	Tweezers 
Paper Slicer 		

1.3 Product Features

The followings are the main features of the Expert II A cutting plotters:

- Dual-port connectivity – USB & Serial interface.
- Up to **350** gram cutting force.
- Up to **705** (EXII-24(LX) / **635** mm (EXII-52 (LX)) per second cutting speed (at 45 degree direction.)
- Guaranty **3** meter (10') tracking.
- Enhanced Automatic-Aligning System (AAS II) for auto contour cutting (only for LX models.)

1.4 The Appearance (EX II)

1.4.1 The Front View


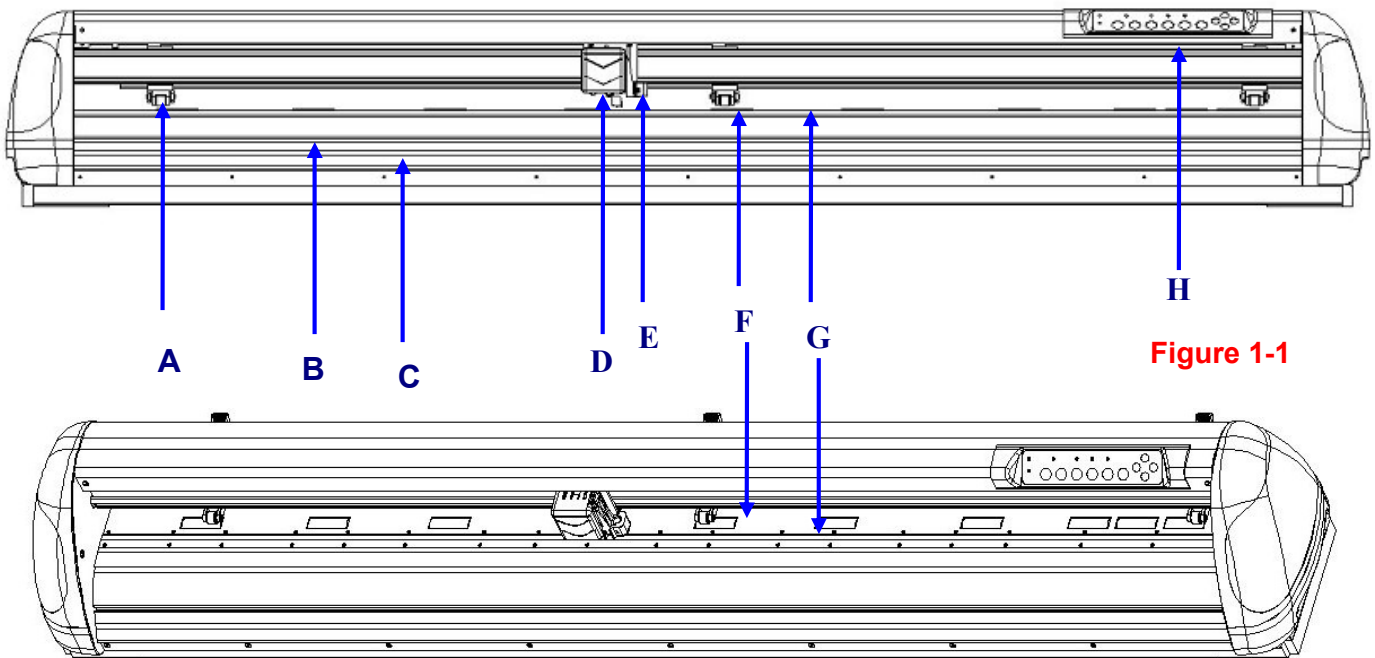


Figure 1-1

Object	Description
A Primary Pinch Roller	To help hold the media during cutting.
B Slicing Groove	To help slice off media.
C Alignment Ruler	To align media with clear guideline marks
D Tool Carriage	Performs the cutting or plotting with the installed blade or pen.
E Blade Holder	To hold the blade.
F Platen	The surface for holding and supporting media in operation.
G Cutting Pad	To protect blade and plate in operation.
H Control Panel	To consist of 10 control keys and 6 LED lights.
J Grid Drum	To move media back and forth in operation

Figure 1-2

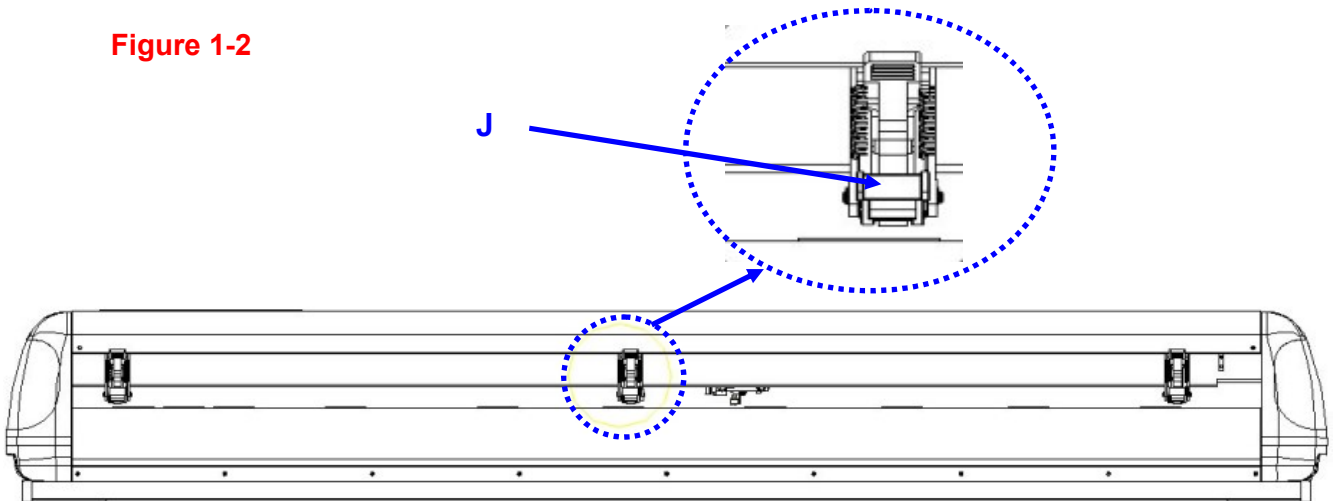

1.4.2 The Side Views

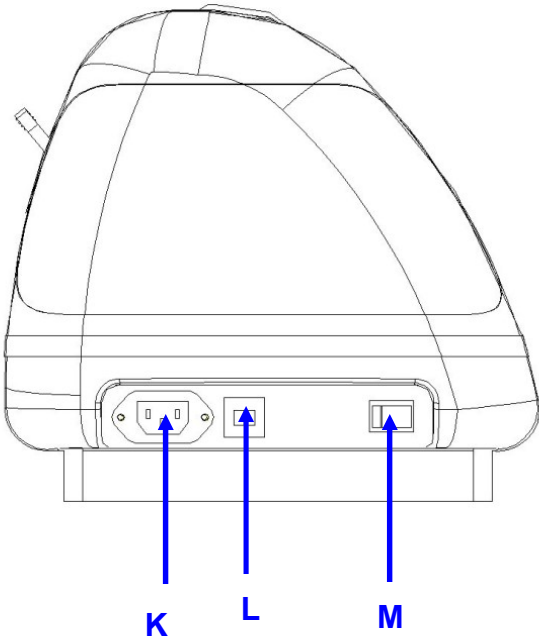


Figure 1-3

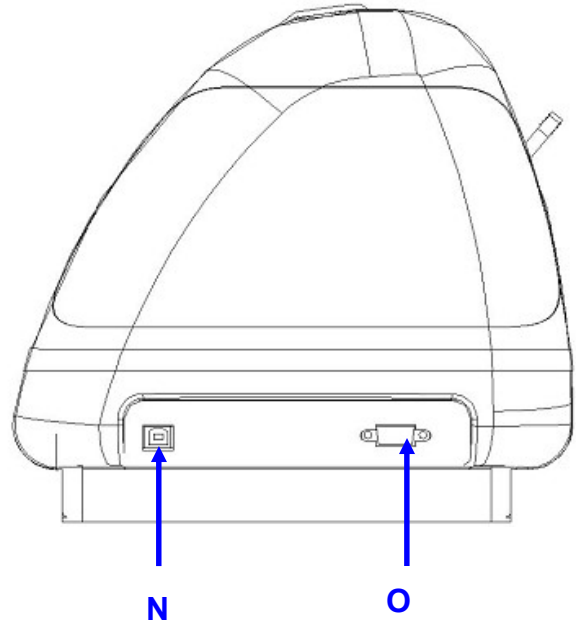


Figure 1-4

Object	Description
K AC Power Connector	To insert the AC power cord.
L Fuse	3 Amp.
M Power Switch	To turn on or off the machine.
N USB Connector	To connect the machine and a computer through a USB cable.
O Serial Interface Connector	To connect the machine and a computer through a RS-232 cable.

Chapter 2 Installation

2.1 Precaution

Please read below information carefully before you start installation.

Notice 1

- Make sure the power switch is off before installing the cutting plotter.
- Carefully handle the cutter to prevent any injuries.

Notice 2 Choosing a proper place before setting up the cutting plotter

Before installing your cutting plotter, select a suitable location, which meets the following conditions.

- The machine can be approached easily from any direction.
- Keep enough space for the machine, accessories and supplies.
- Keep the working area stable, avoiding severe vibration.
- Keep the temperature between 15 and 30°C (60-86oF) in the workshop.
- Keep the relative humidity between 25% and 75% in the workshop.
- Protecting the machine from dust and strong air current.
- Preventing the machine from direct sunlight or extremely bright lighting.
- The machine should be installed in a proper place where only well-trained professionals are allowed to operate the machine.
- This product should be installed only in a restricted access location (Professional printing rooms, service closets, etc.)

Notice 3 Connecting the Power Supply

Check the plug of the power cord to see if it mates with the wall outlet. If not, please contact your dealer.

- Insert the plug (male) into a grounded power outlet.
Note: The equipment power supply cord shall be connected to a socket-outlet with earthing connection.
- Insert the other end (female) of power cord into the AC connector of cutting plotter.

Notice 4 Tightening or Loosing Screws with Screwdriver

Whether manual or electric screwdriver, be careful not to use excess torque force when tightening or loosing screws. When tightening or loosing iron and stainless steel screws, please refer to the following screw torque standard table, other materials screws are not included.

Screw diameter	Torque value (kgf-cm)
	Torque standard for high hardness materials
M3	6
M4	16
M5	30
M6	50

2.2 Stand Installation

(Stand is an optional item for 24 inch models.)

2.2.1 Stand Installation

Please follow the procedures below for assembling the stand.

Step 1 Please examine the supplied items in the accessory box of the stand carton before you install:

Stand is an optional item for Expert II A, Item List :

- 1 Left side vertical stand
- 1 Right side vertical stand
- 1 Support for left side
- 1 Support for right side
- 1 Stand Beam
- 2 Bottom Stands with wheels
- 2 Sliding brackets for paper take up
- 1 Hex Wrench (M5)Φ4
- 28 Socket flat head screws(M6*12L)
- 1 Installation Guide

Step 2

Position the Left side vertical stand perpendicularly to part ❶ and put the screws into the holes and tighten them to form a left side T-stand (Figure 2-1). Repeat the same steps with the Right side vertical stand.

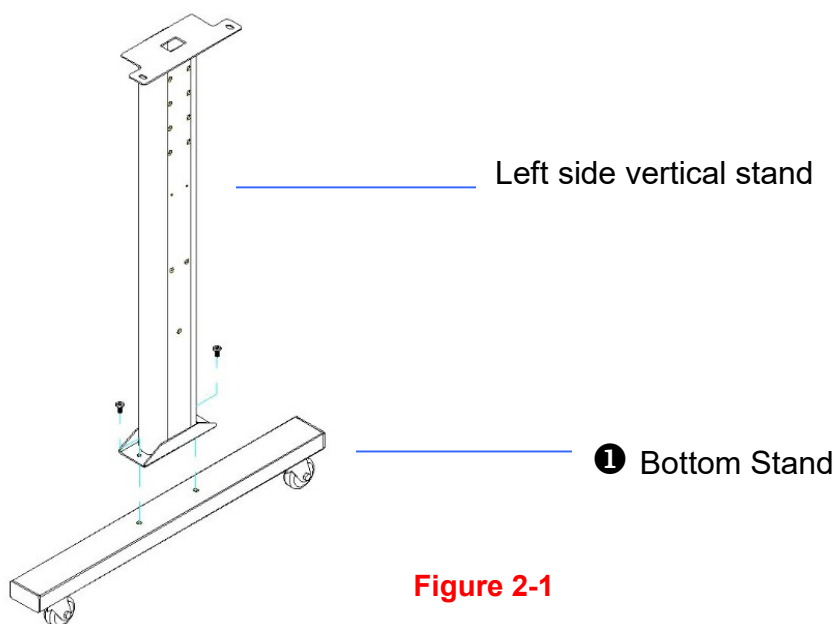
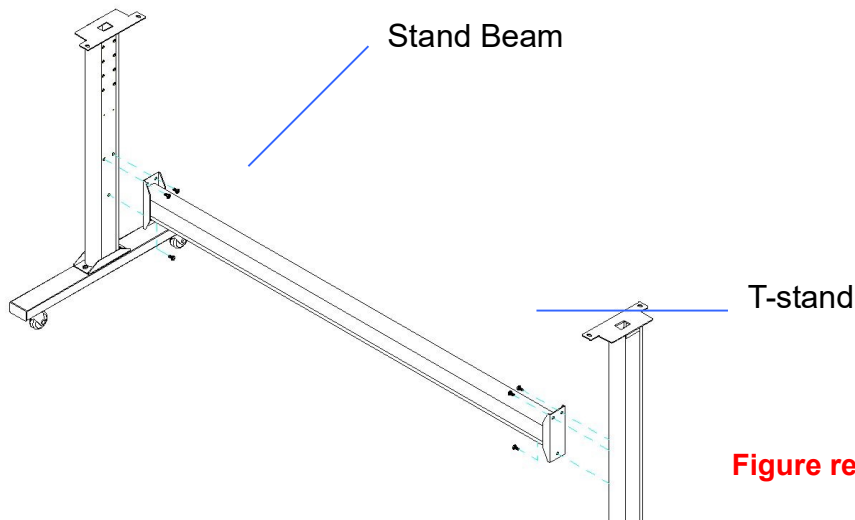



Figure 2-1

Step 3

Place the stand beam upright on the T-stand and put the screws into the holes but do not tighten them at this step. There is hexagon socket head screws fasten on the T-stand on both side taken as locating pins.

**Figure re 2-2****Step 4**

Remove the cutting plotter from the carton. Position the stand under the plotter, on the bottom of the plotter, there is one hole on each side in the position corresponding to the locating pins, so the locating pins can be located into the holes. Then insert the screws into the holes on the stand to lock the plotter and tighten them up as shown in Figure 2-3.

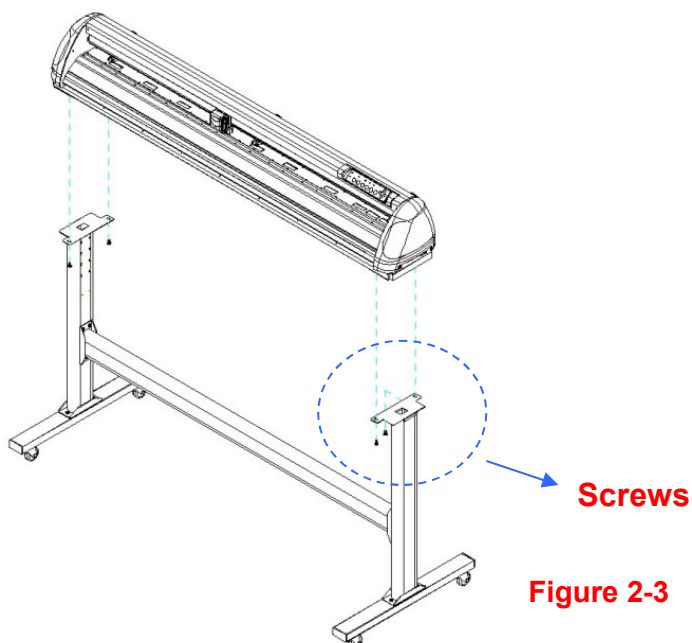**Figure 2-3**

Step 5

Insert the roll holder support with the screws into the holes of the stand, and then tighten them up as shown in Figure 2-4. You could decide roll holder support's position by inserting into different holes.

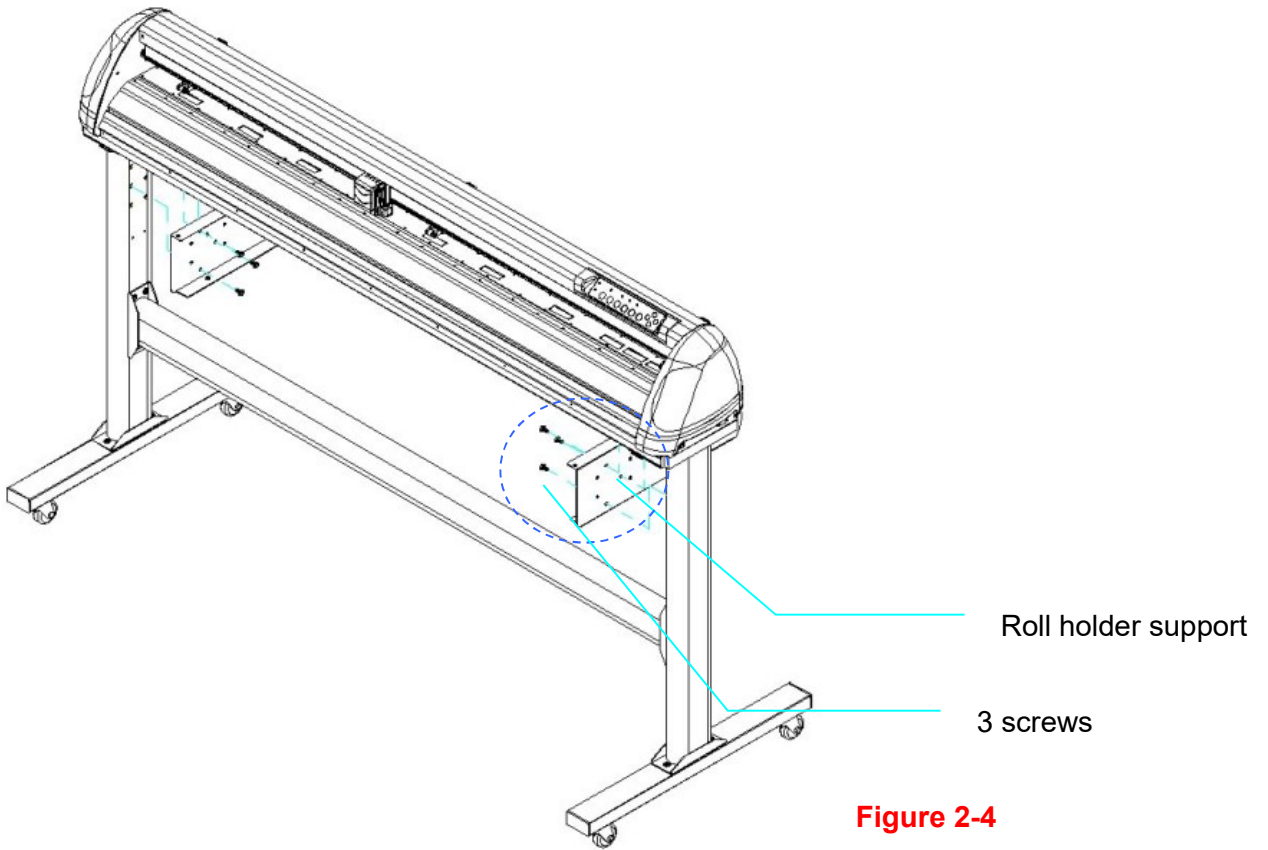


Figure 2-4

Step 6

Place two roll holders onto the roll holder support and ensure the white protrusion is wedged in the groove. (Figure 2-5)

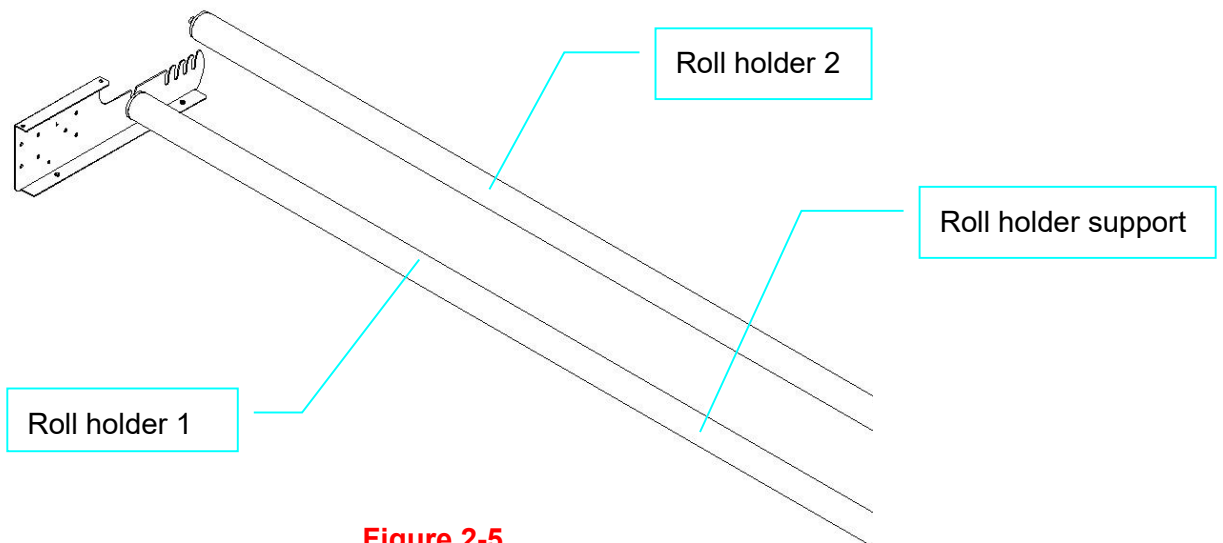


Figure 2-5

Step 7

Turn the screw counter-clockwisely for around three times after unpacking roll holder 2


**Step 8**

Insert the end of the roll holder without the damper into the left roll holder support and then insert the end of the roll holder with the damper into the right roll holder support. Ensure the white protrusion is wedged in the groove.



Step 9

Tighten the screw on the damper until it is securely attached to the right roll holder support.

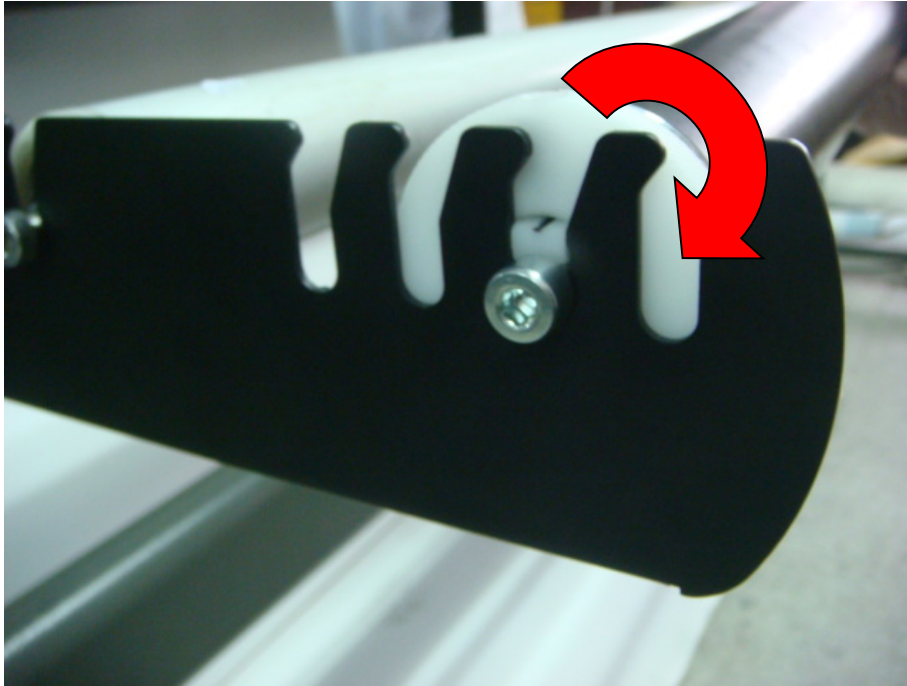

Step 10

Lastly, the complete picture will be shown like below. (Figure 2-6)


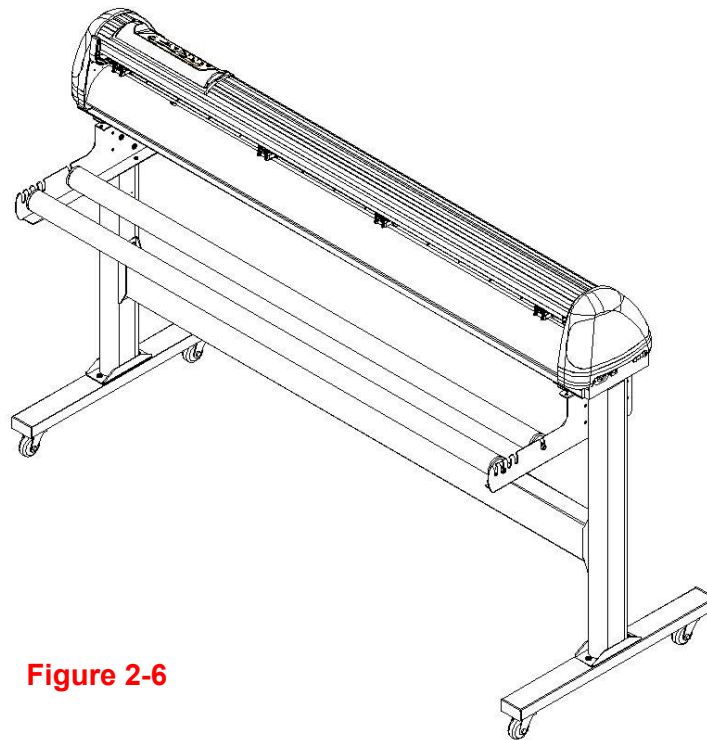


Figure 2-6


2.3 USB Cable Tie and Saddle

The USB cable tie and saddle assembly for the stands with Flexible Media Support System only.


Step 1 Insert the cable tie into the upper hole of cable saddle from bottom to top.

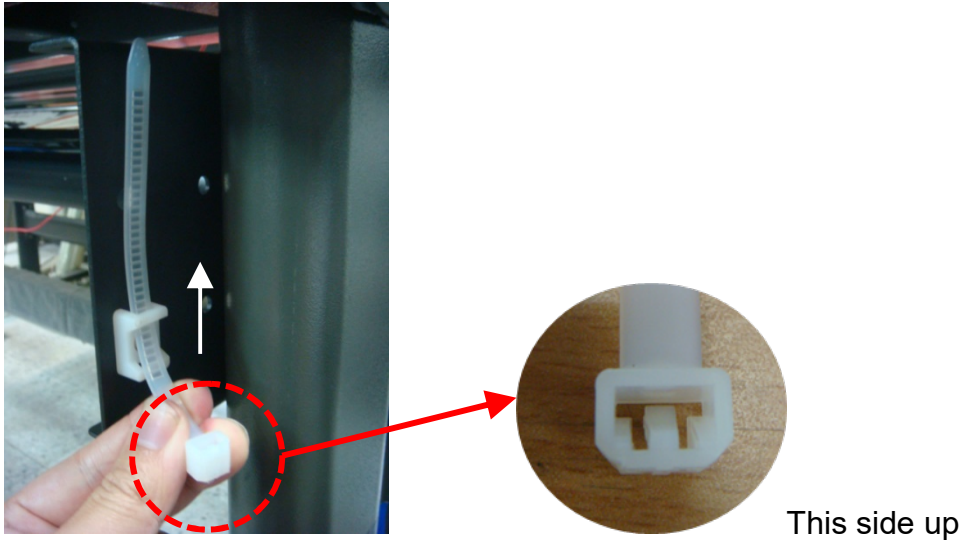


Step 2 Place the USB cable into the cable tie and tighten the cable tie.

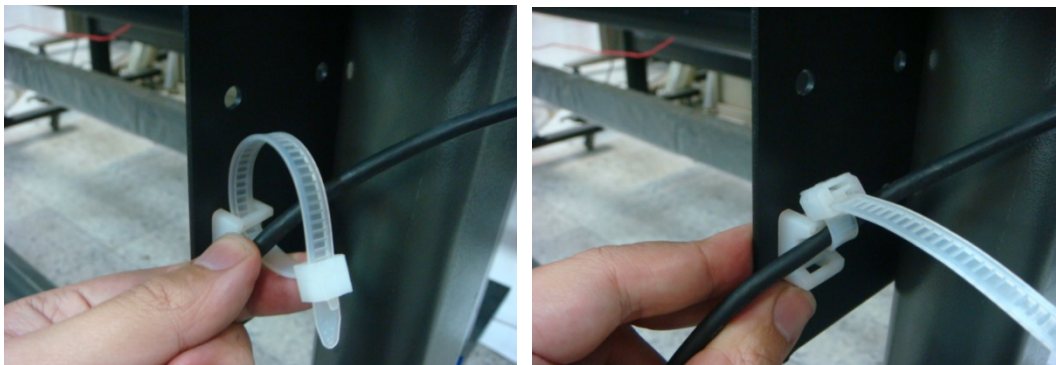


Step 3 Insert the cable tie end into the lower hole of cable saddle to finish the job.

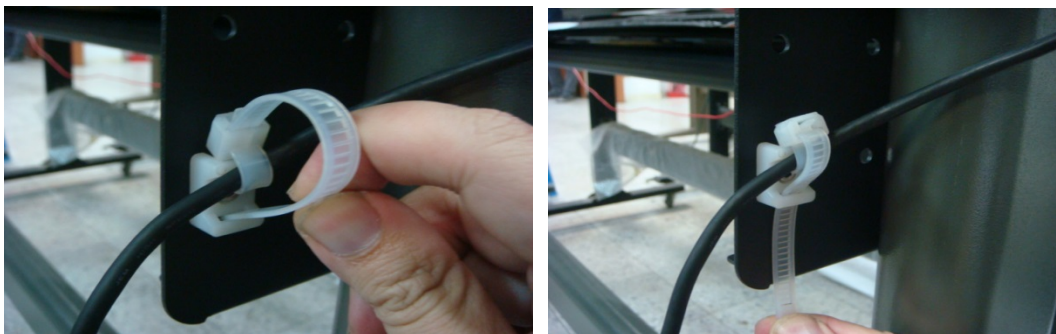


Untied way: pull out the cable tie → pull up the pin → release the cable tie.

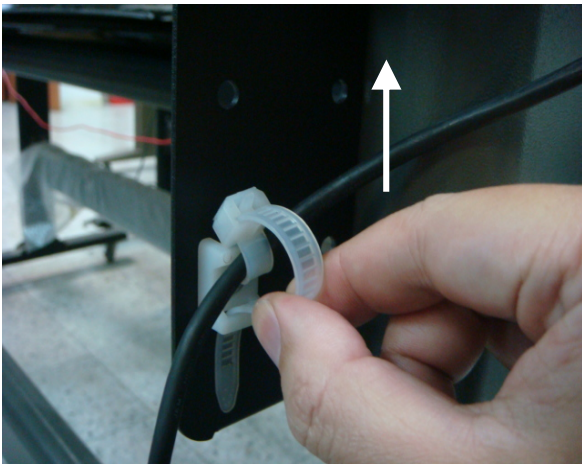

Pull out the cable tie

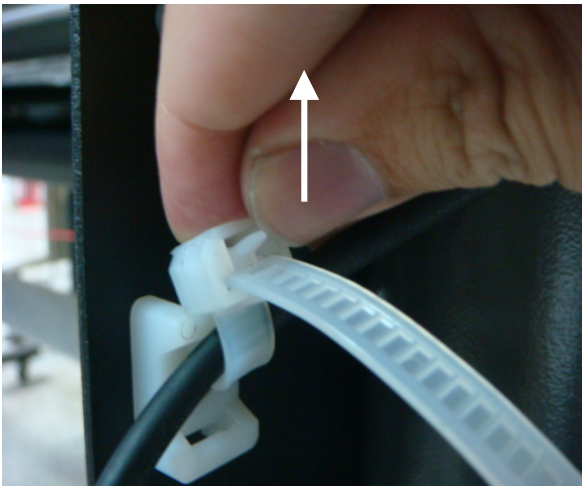

Pull up the pin

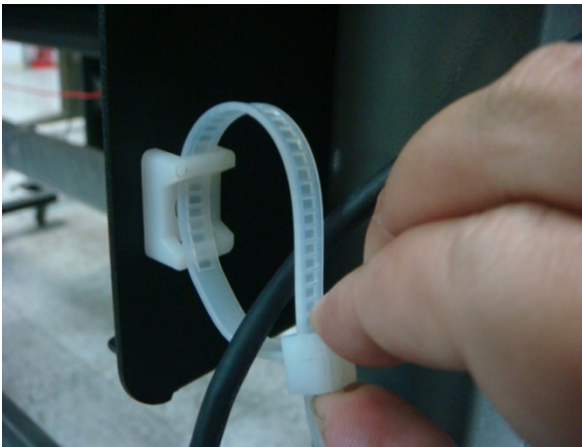

Release the cable tie

2.4 Blade Installation

Figure 2-7 is the illustration of the blade holder. Insert a blade into the bottom of the blade holder and remove the blade by pushing the pin. Make sure that your fingers are away from the blade tip.



Figure 2-7

Step 1

Install blade (Figure 2-8).



Figure 2-8

Step 2

Push the blade to the bottom of the blade holder (Figure 2-9).



Figure 2-9

Step 3

Adjust the blade tip to suitable length by screwing "Blade tip adjustment screw" clockwise or count-clockwise. (Figure 2-10).



Figure 2-10

Tips:

"The proper length" means the blade's length is adjusted 0.1mm more than film's thickness. That is, if the thickness of film is 0.5mm, then blade's length is properly adjusted 0.6mm and it can completely cut through the film layer yet avoid penetrating the backing.

Step 4

Insert the blade holder into tool carriage. Please note the outward ring of the holder must put into the grooves of carriage firmly (see Figure 2-11), fasten the case (Figure 2-12).



Figure 2-11



Figure 2-12

Step 5

Use the reversing steps to remove the blade holder.

Step 6

Eject the blade: Push “Blade eject pin” to eject blade when the blade needs to be replaced.

Caution!!

The blade will lose its sharpness after a period of usage, the cutting quality might be affected. By increasing the cutting force, it might do the trick. However, once the blade is worn out and no longer provides a reliable cutting, you should replace a new one. The blade is consumable and must be replaced as often as necessary to maintain the cutting quality. The quality of the blade deeply affects cutting quality. So be sure to use a high quality blade to ensure good cutting results.

Tips - When to replace a new blade:

- ✓ If the blade is broken, you have to replace a new one.
- ✓ If cutting quality is not as good as usual, you may need to replace a new one.
- ✓ If the material cannot be cut through by higher cutting force, you may need to replace a new one.

2.5 Media Loading

2.5.1 Loading the Sheet Media

To load the media properly, please follow the procedures below:

Step 1

Lift the 2 levers at the back side of the cutter to lift the pinch rollers (Figure 2-13).

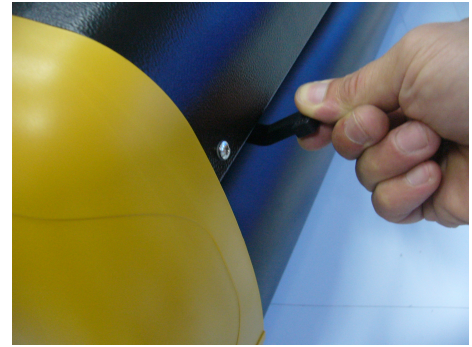


Figure 2-13

Step 2

Load your media on the platen and slide it under the pinch rollers from either the front side or the backside. The **alignment rulers** on the platen extension will help you to adjust the media precisely (Figure 2-14).



Figure 2-14

Step 3

Then move the pinch rollers manually to the proper position. Be sure the pinch rollers must be positioned above the grid drum. The **stickers** on the main beam show the position of the grid drums (Figure 2-15).

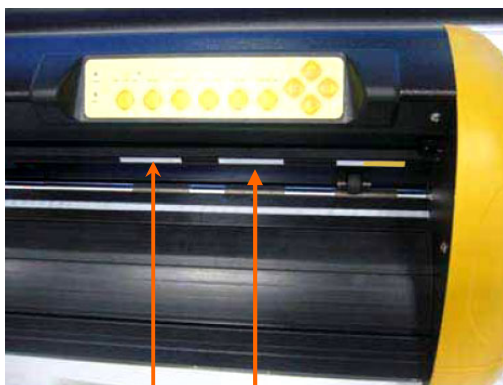


Figure 2-15

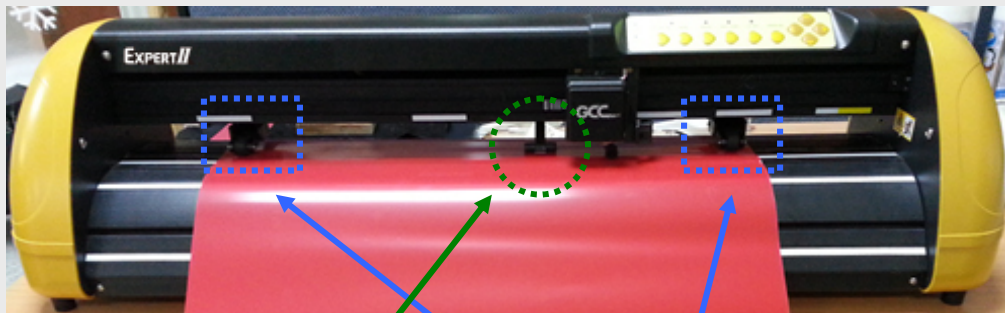
Stickers



Figure 2-16


CAUTION!!!

- ✓ Make sure the Primary and secondary pinch rollers are set to right positions.
- ✓ Position the Primary Pinch Rollers at the right and left sides of media.
- ✓ Position the Secondary Pinch Roller at the center of media.

(O)**Correct****Figure 2-17****(X)****Incorrect**

Secondary Pinch Roller

Primary Pinch Roller

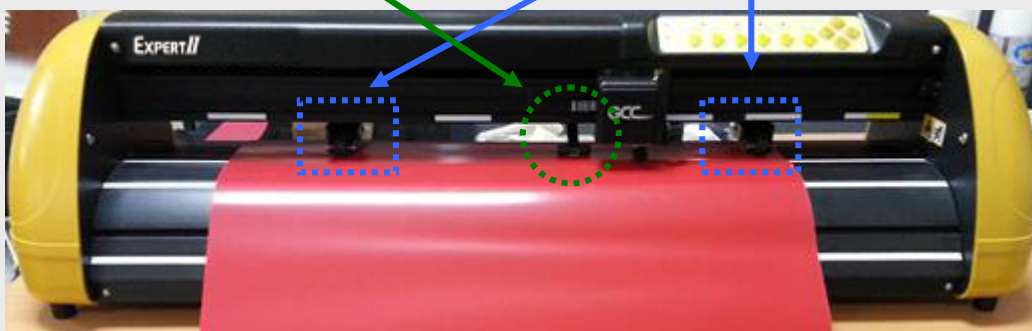**Figure 2-18****Step 4**

Push the lever backward to lower down the pinch rollers (Figure 2-16).

Step 5

After turn on the power, the tool carriage will measure the size of the media automatically. And the plotting cutter begins to work.

Note:

- ✓ Always adjust the position with the pinch rollers raised.
- ✓ Please reposition the pinch roller by holding the center of the pinch roller and moving it from the rear end of the machine. (Figure 2-19)
- ✓ DO NOT move the pinch roller by holding its front rubber roller (Figure 2-20).

**Figure 2-19****Correct****Figure 2-20****Incorrect**

2.5.2 Loading the Roll Media

You can use the stand. Please refer to Chapter 2.2 for hardware setup, and Chapter 2.5.1 for media loading.

2.5.3 How to change the poll size without turning off the machine?

Have the machine on-line, press origin set once and the red error light will start blinking, then pressed again and the machine will start moving to get the new size. Then open the VLCD and under the poll size you will find the new measurements.

2.5 Cable Connection

The cutting plotter communicates with a computer through a **USB (Universal Serial Bus)** or a **Serial port (RS-232C)**. This chapter shows you how to connect the cutting plotter to a host computer and how to set up the computer and cutting plotter interconnection.


NOTICE: When USB connection is enabled, serial port will be disabled automatically.

2.5.1 USB Interface

Expert II A series build-in USB interface are based on the Universal Serial Bus Specifications Revision 2.0 (Full Speed).

2.5.1.1 Connecting your GCC cutter

1. Turn on the machine.
2. Connect the USB connector to the machine and then USB driver will installed automatically. It will take a few minutes to find the device. Please **DO NOT** disconnect the USB cable until the installation has completed.
3. You can double click the USB icon on the taskbar to make sure the USB device is detected.

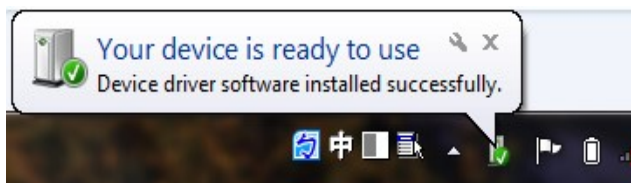


2.5.1.2 Installing the driver

Use the USB One-click Installation for quick driver installation. Follow the simple steps below for driver setup.

Caution!!

- ✓ **If you are using Windows 7 and above as your operating system, make sure you log in using the “Administrator” account.**

Step 1 Visit GCC website and go to “SUPPORT” page to download the user manual, driver and software (<https://www.gccworldnew.com/download.php>).

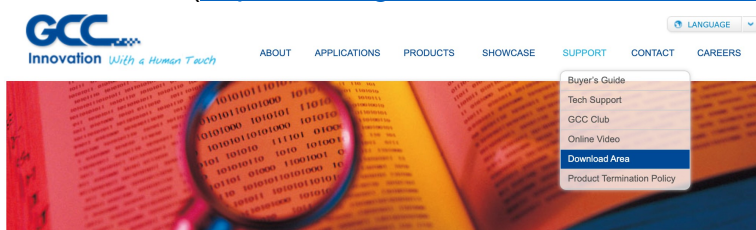

Step 2 You may use search function or directly click the product category to choose the model you want.

Download Area ▼

Download Area

enter keywords to search SEARCH

Or browse by machine model

 <p>Vinyl Cutter</p>	 <p>Laser Engraver</p>	 <p>Laser Cutter</p>
 <p>Laser Marker</p>	 <p>UV Inkjet Printer</p>	 <p>Digital Finishing Equipment</p>



Vinyl Cutter


Vinyl Cutter ▼

 <p>i-Craft™ 2.0</p>	 <p>AR-24</p>	 <p>Expert II</p>	 <p>Puma IV</p>
---	--	---	--

Download the driver according to the type of connection.

Software ▶		
Product Brochure ▶		
Driver ▼		
Title	Size	Download
Cutter COM Driver_V2.21-03	11.2MB	Download
Cutter ETH Driver_V2.21-03	11.2MB	Download
Cutter USB Driver_V2.21-03	11.2MB	Download
User Manual ▲		


Step 3 Unzip the file and double click the driver.exe to start installing the Driver and AAS plug-in.

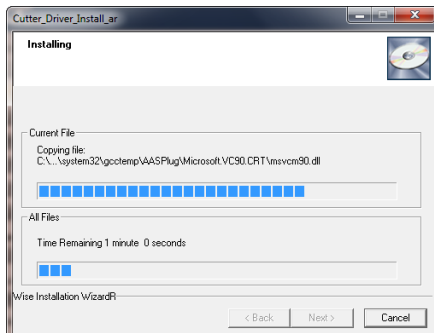


Step 4 If you were Windows 7 and above users, please click on the **red words** to instruct you how to disable Windows Update to allow success driver installation. And then click OK to next step.




Step 5 Please make sure the cutting plotter is powered on and connected to the USB device, and then click OK to next step.

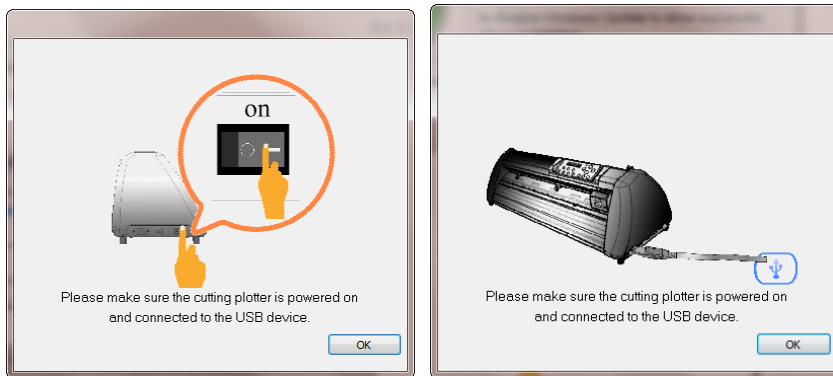


Step 6 Confirm to close all running application programs before you start installing the driver, and then click OK.

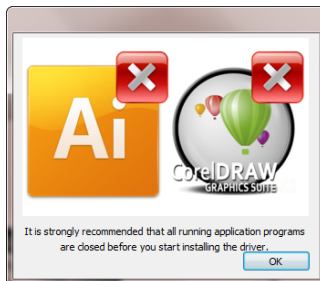


Step 7 The installation will take a few minutes to complete and you will see a message below and click on “OK” upon completion. Enjoy your GCC cutter!

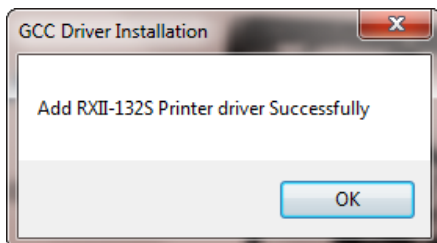

Step 8 If you want to install AASII VBA on CoreIDRAW and Adobe Illusatrator, exit CoreIDRAW and Adobe Illusatrator program, and then click on “Install.”

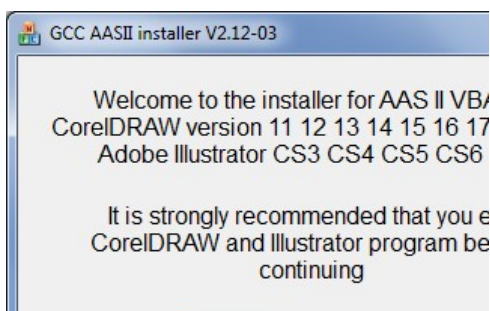


Step 9 Check Install Message to confirm CoreIDRAW and AI version and then click OK.

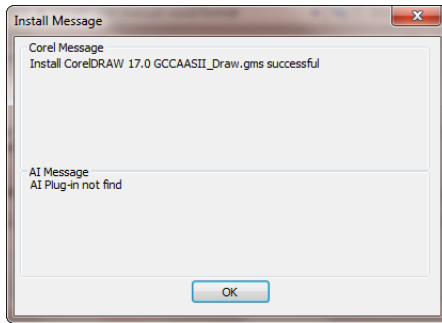


Note:


(1) If the driver is being installed for a second time, the user will be prompted as to whether a second copy of the driver installation is required.

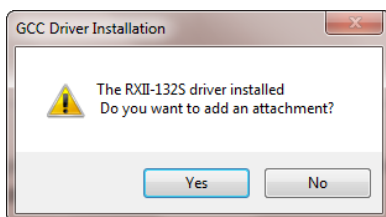

(2) If the user selects yes, a second copy of the driver will be installed.

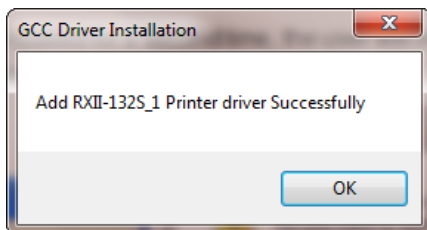



(3) For users who have upgraded Adobe Illustrator or CoreIDRAW, please go to the **AAS Installer** page in the **Printer Properties** window and click "**Install**" to access the latest version of GCC AAS Plug-in.

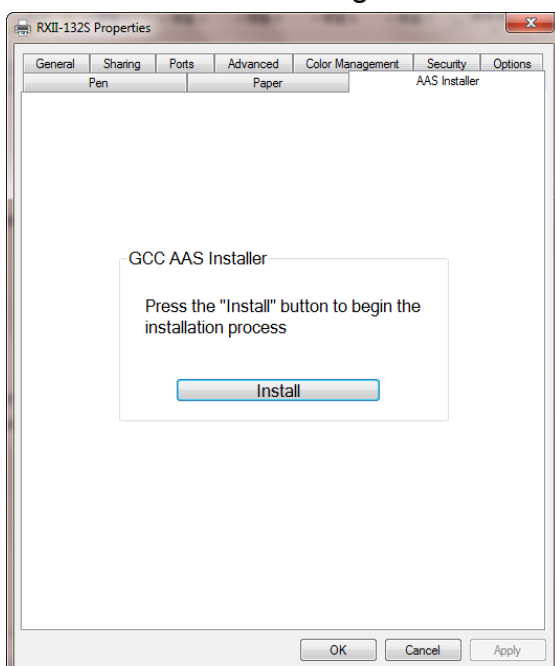


2.5.1.3 Driver Un-installation

You have to remove previous version driver installed on your PC system completely before you can install the latest version successfully. Please refer to below steps.


Step 1 Go to Control Panel\Hardware and Sound\Devices and Printers window. Right click the printer and select “**Remove device.**”

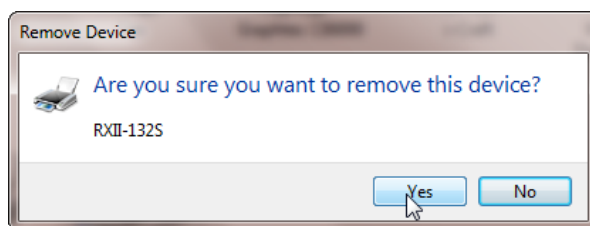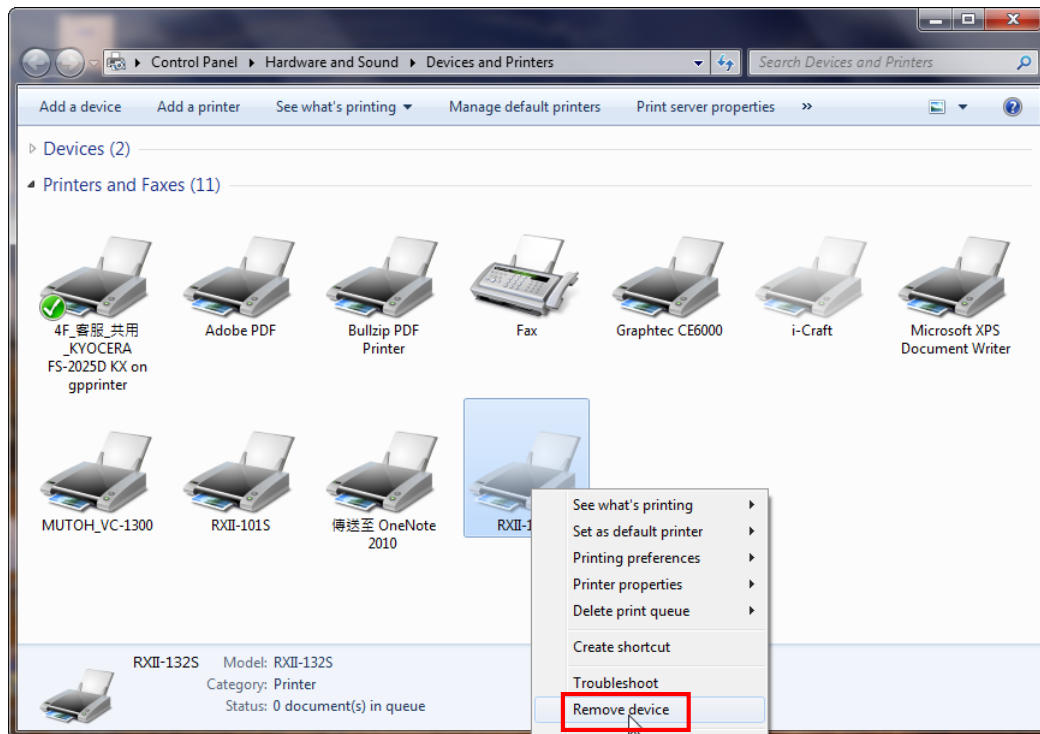


- Step 2** After removing the unit, click on any printer on the page and select **“Print server properties.”** (For Win 7 and above)
Or right click on blank space and then select **“Print server properties.”** (For Windows XP)

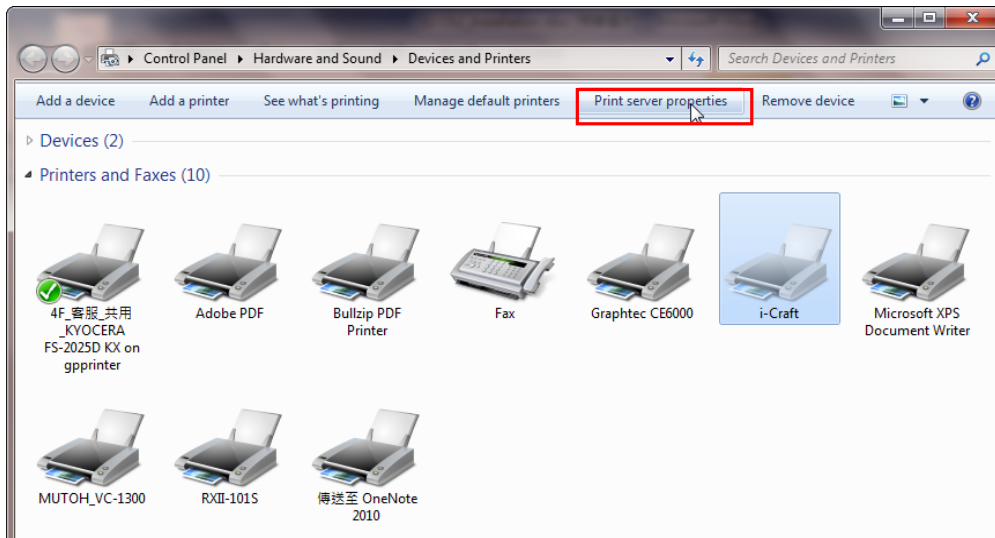


- Step 3** Select **“Driver”** page

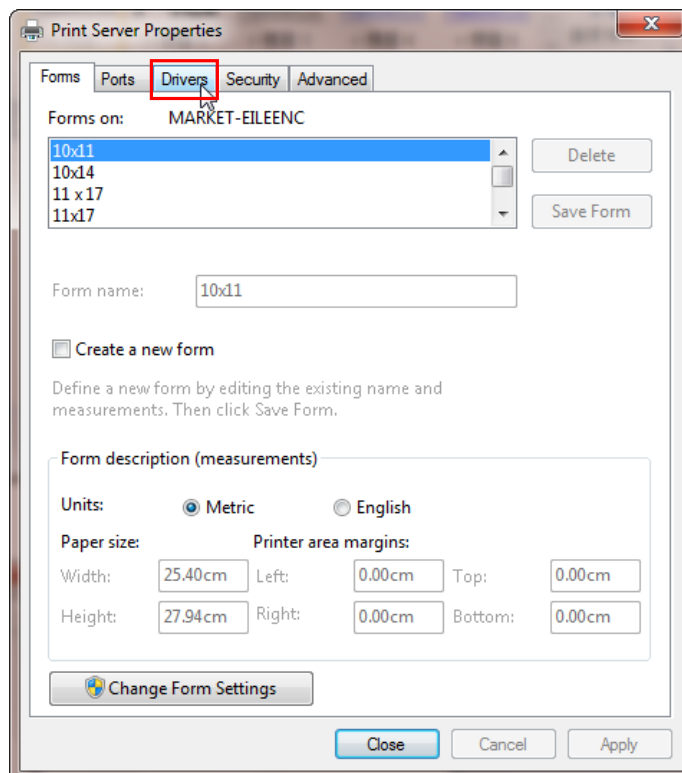


Step 4 Select the model and click on “Remove”.

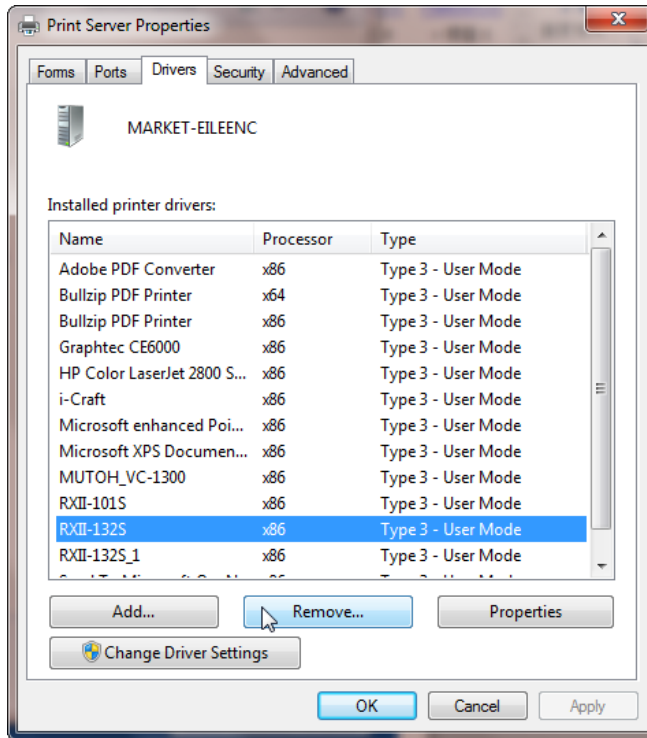


Step 5 Select “Remove driver and driver package” and click OK.

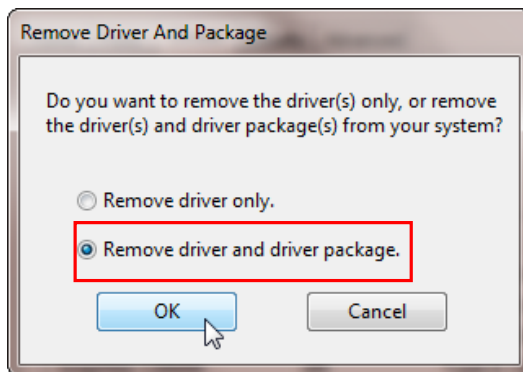

Step 6 Click Yes and then click “Delete” and “OK,” and the driver installed on PC is completely removed.

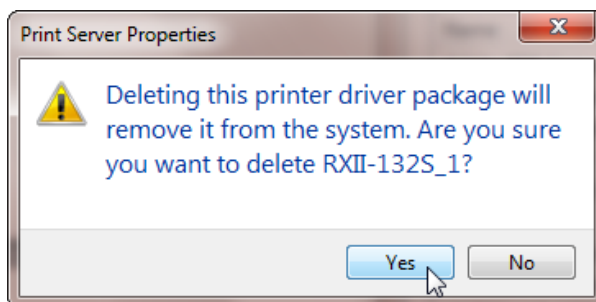

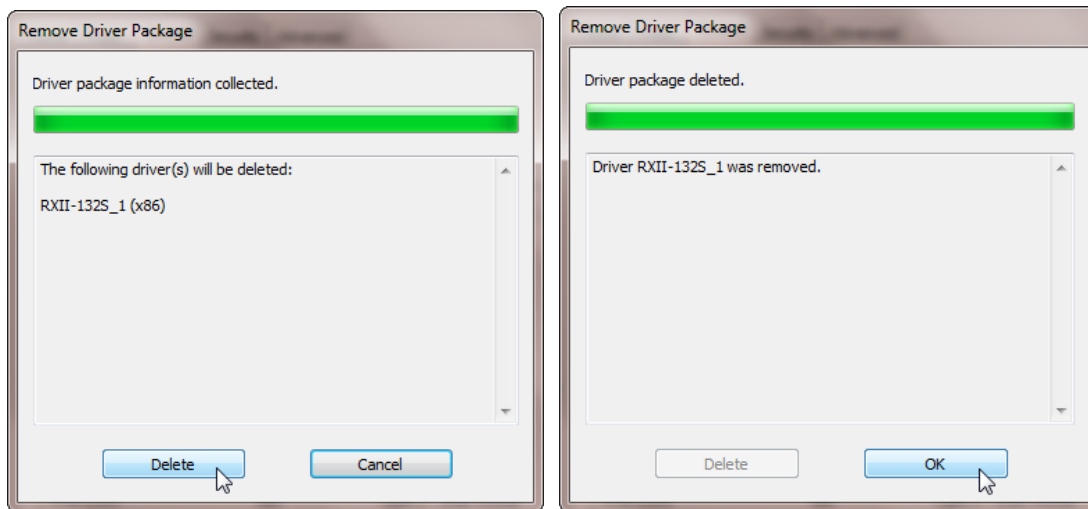

2.5.2 RS-232 Interface

■ Connecting to the RS-232 (Serial) Port

1. For IBM PC, PS/2 users or compatibles, connect the RS-232C cable to the serial connector of the assigned serial port (COM1 or COM2) of your host computer.
2. Set up the communication parameters (Baud Rate and Data Bits/Parity) to match the setting of software package, refer to chapter 3 – “Misc” key description.

Caution!! Please turn off the plotter before plugging the RS-232C


2.5.3 Data Transmitting

There are two options to transmit the data from the computer to the cutting plotter:


- Option 1:** With proper interface settings, the data can be transmitted from your application software package to the cutting plotters directly.
- Option 2:** Most cutting software packages are able to emulate **HP-GL** or **HP-GL/2** commands. As long as the file is **HP-GL** or **HP-GL/2** format, the cutting plotter can output the data precisely.

2.5.4 Printer Server Shared Setting


In “A-PC”, set the printer driver as a shared printer, then use B-PC to connect A-PC’s printer driver via Intranet.

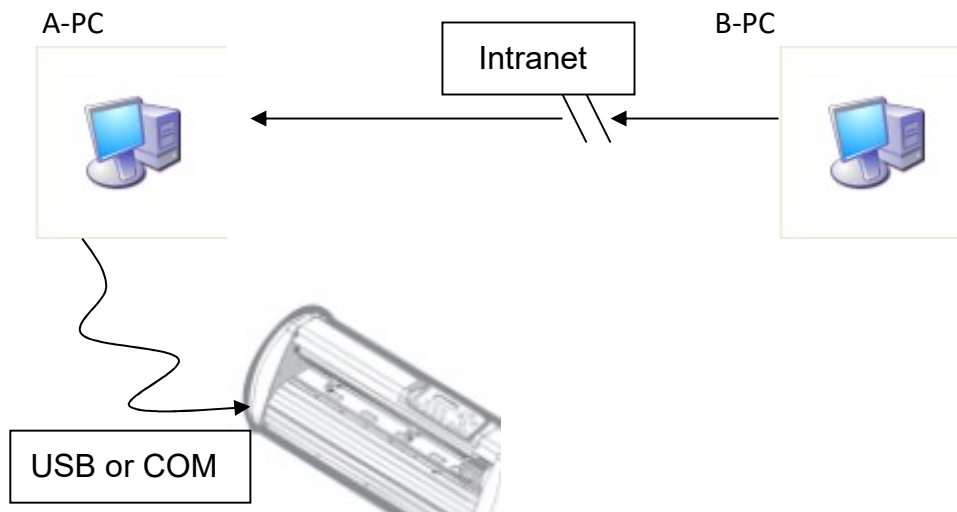


Step 1 Set A-PC’s printer driver as a shared printer (Right-click on printer icon, choose “Printer properties”. Click “Sharing” tab then check “Share this printer.”)


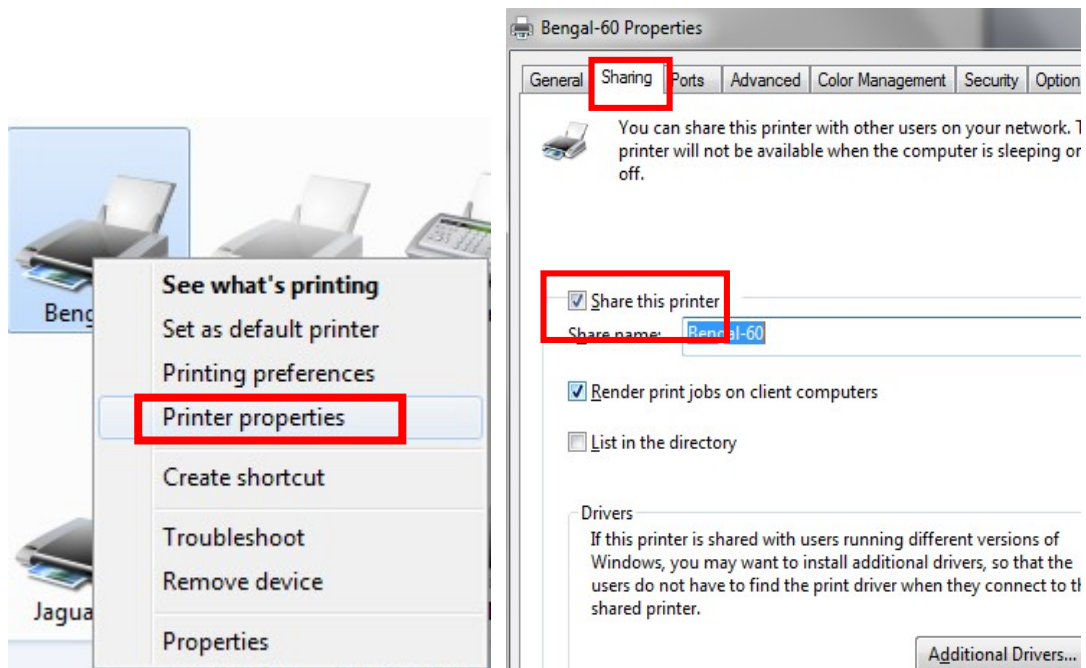


Step 2 Click “Advanced” tab, then choose “Print directly to the printer” option.

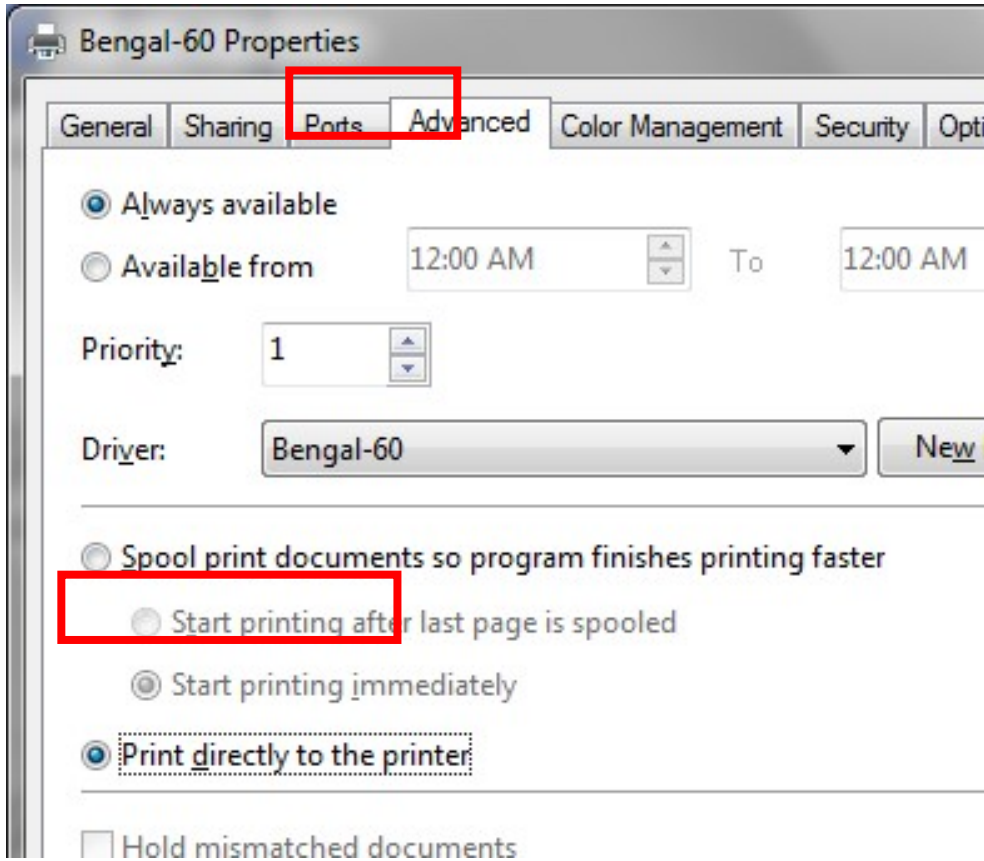

Step 3 Send a job from A-PC to the machine to check if A-PC is connected to the machine.

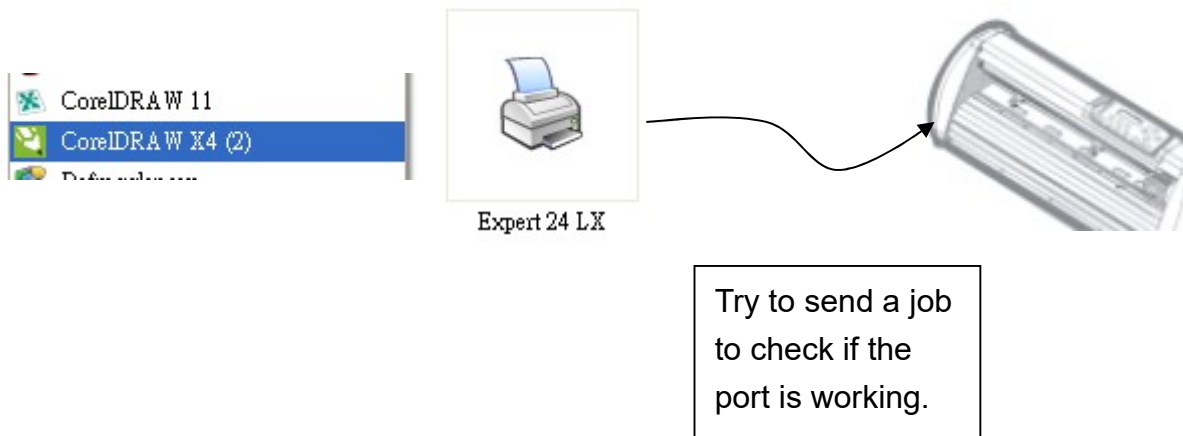

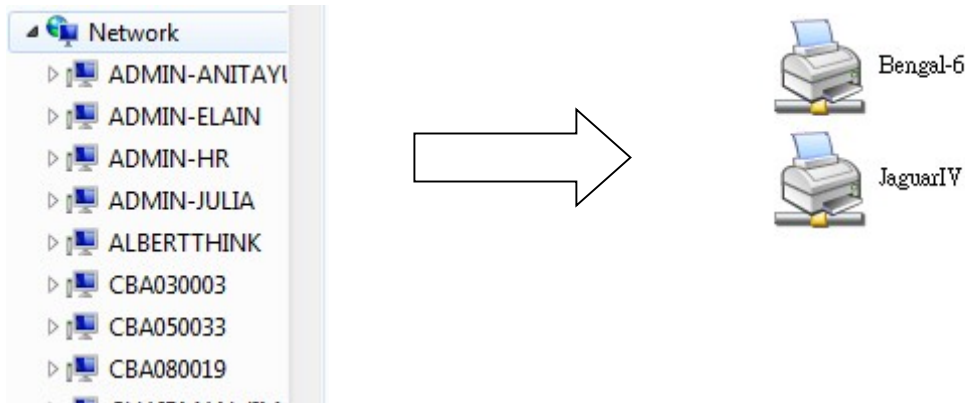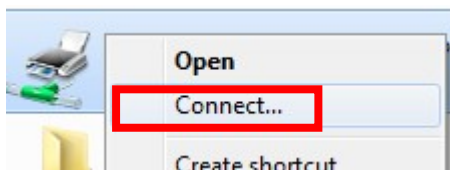Step 4 Activate A-PC's Printer Driver from B-PC's Network.**Step 5** Right-click on the printer icon, and select "Connect" to A-PC's printer.

2.6 Software Installation

2.6.1 GreatCut Installation

Step 1 Visit GreatCut online registration page <http://gccvoucher.eurosystems.lu/>, enter your voucher code provided when purchasing GreatCut and click "Go on!"

Please visit GCC website to download software.
<https://www.gccworld.com/download.php>

GreatCut

- Register your product with voucher code online within 3 months after receiving your cutting plotter to avoid voucher code expiring.
<http://gccvoucher.eurosystems.lu/>
- Get your activation code from email to activate GreatCut after completing registration online.
- If you lost your voucher code after registration, you can retrieve your original voucher code from GCC Club: <http://club.gccworld.com>

GreatCut Voucher Code

Sure Cuts A Lot

- After completing installation of SCAL, enter license code into SCAL to complete activation.

Sure Cuts A Lot Voucher Code

www.GCCworld.com

Great Computer Corp. Software Voucher Code

Please enter your voucher code *completely* and *accurately* as it stands on the voucher.

Voucher Code

In case of problems or questions you can reach our technical support over tech.support@gcc.com.tw.

[Homepage Great Computer Corp.]

GCC Great Cut
STONECUT

Step 2 Click “Request” to go to registration page.

Great Computer Corp. Software Voucher Code

You are holding in your hands a software voucher for a full license of GreatCut 3.
In order to receive the **free of charge** license code and download GreatCut 3, please use the following button:

License code for new **full license**

[[Homepage Great Computer Corp.](#)]

Step 3 Fill in the required information and click “Request license code.”

Software Download GreatCut 3

Great Cut
Software Registration

Last name, first name: Eileen , Chen ! Required fields
Would you please use Latin resp. West-European characters!

Company: GCC

Street: 4F-1, No. 236, Fude 2nd Rd., Xizhi Dist. !

PO box: !

City: New Taipei City !

State/Prov.: (only US and Canada) !

Zip (postcode): 22151 !

Country: Taiwan !

Phone: 886266166692 !

Fax: !

eMail address: eileen.chen@gcc.com.tw !
Important: Pay attention to enter your eMail address correctly, because license code is sent to this address!

Step 4 The registration is completed; you should receive two emails, one is registration confirmation with activation link and another is your license data with **.ecf** file.

Registration Successful

Thank you, that you decided for GreatCut 3.

An email with further information for GreatCut 3 was sent to the given email address (eileen.chen@gcc.com.tw). Please be patient, as it may last up to 30 minutes until you can receive this email.

If you don't receive an email, please fill out the form on gccvoucher.eurosystems.lu again with a working email address.

[[Home Great Computer Corp.](#)]

Step 5 Check your email to see if you receive the activation link and click the link that will direct you the link for GreatCut download.

寄件者: tech.support@gcc.com.tw
收件者: eileen.chen@gcc.com.tw
副本:
主旨: GreatCut 3 - Activation Link

Dear Customer,

thank you, that you decided for GreatCut 3.
Please click the following activation link or enter it in your web browser:


<http://gccvoucher.eurosystems.lu/activate.dml?id=128461259209629vuLFO0aiKeRkh0gg>

After clicking the link, you immediately will get download links and license data for GreatCut 3.


If you have questions, you can reach our support over tech.support@gcc.com.tw.

Best regards
Great Computer Corp.

Step 6 Visit GCC website and go to “SUPPORT” page to download the software (<https://www.gccworldnew.com/download.php>).

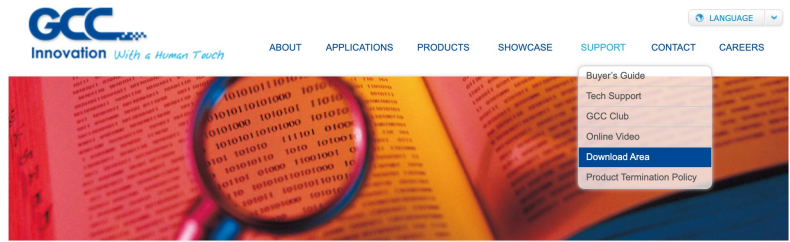

Or browse by machine model



Vinyl Cutter



Laser Engraver



Laser Cutter



Vinyl Cutter Vinyl Cutter ▾



i-Craft™ 2.0



AR-24



Expert II




Puma IV




Software ▾		
Title	Size	Download
GreatCut 4 for Windows (V.17.0.20.21868)	294MB	Download
Sure Cuts A Lot 5 for Windows 64 bit (v5_044GCC)	73.6MB	Download
Sure Cuts A Lot 5 for Windows 32 bit (v5_044GCC)	55.7MB	Download
Sure Cuts A Lot 5 for MAC (v5_044GCC)	36.2MB	Download

Step 7 Double click the .exe file and select a destination folder.

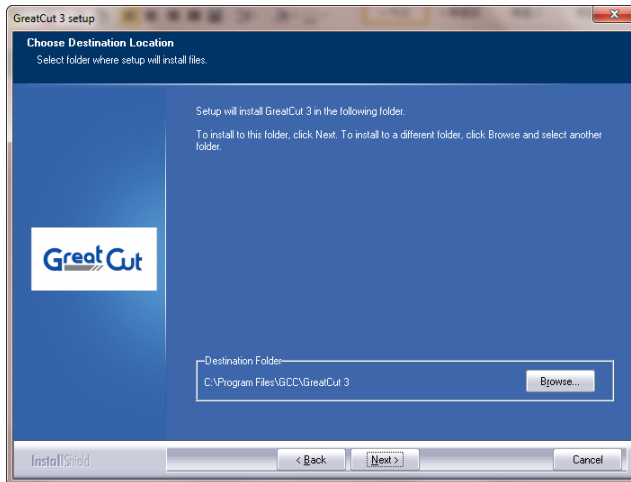


Step 8 Select Typical and click Next.




Note: You may select custom setup to install additional drivers.

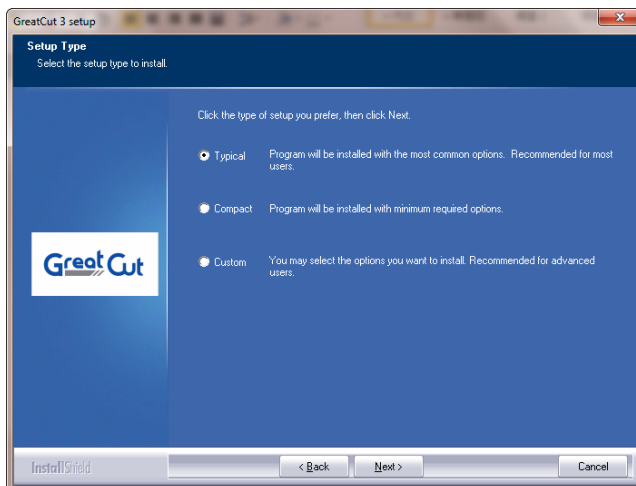

Step 9 Select the folder and click Next.

Default program folder in the start menu is GCC\GreatCut 3.

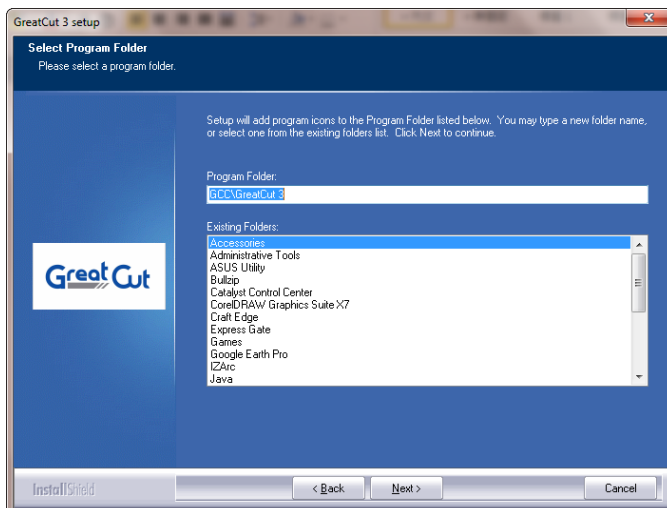

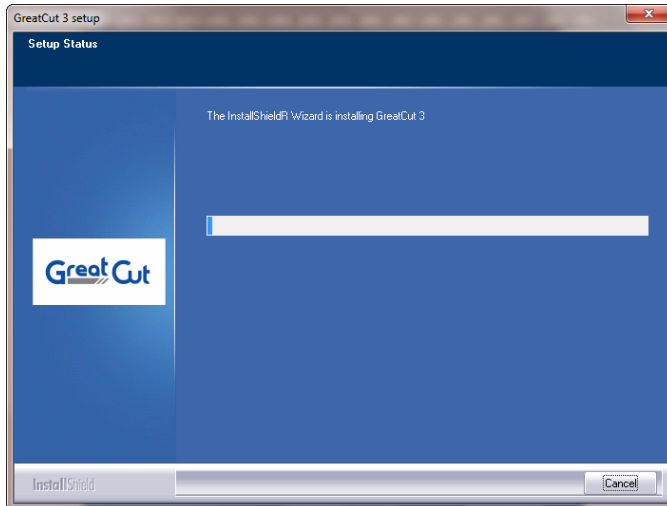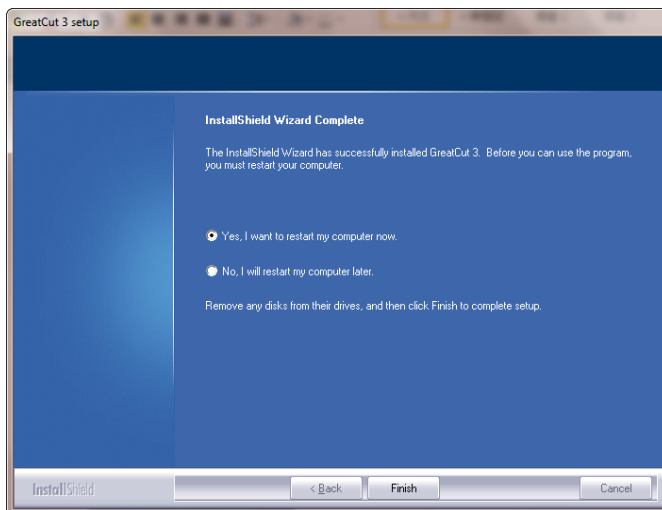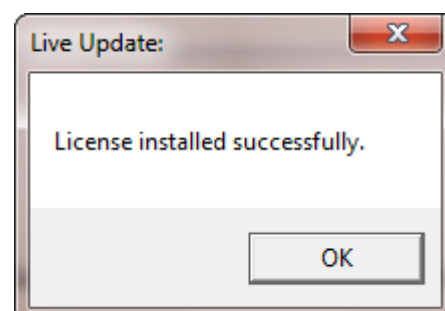Step 10 GreatCut is installing.**Step 11** Click Finish to complete installation.**Step 12** Before you launch GreatCut, open the **.ecf** attached to the license data email to install your license data to GreatCut so that you don't need to fill in your information again.

Step 13 If the license do not install successfully, you will need to fill in your license data manually. You can find the details of your license data from the email.

寄件者: RCS-ONLINE <directdownload@eurosystems.lu> 寄件日期: 2015/2/25 (3)

收件者: eileen.chen@gcc.com.tw

副本:

主旨: GreatCut 3 - Receipt and License code

GC16P-1867.ecf (273 B)

The following license code will be activated by copying or saving the attached file to the computer and starting it via double click. Thus the activation is done fully automatic and GreatCut 3 is ready to use.

For a possibly necessary manual input, here the license data (green) again in plain text:

Company / Name:	GCC
eMail:	eileen.chen@gcc.com.tw
Code:	GC16P
Number of Licenses:	1
Serial No.:	GC16P-1867

Step 14 GreatCut is ready to use now.



2.6.2 Sure Cuts A Lot Installation (Optional Item)

2.6.2.1 Auto Installation


Step 1 Visit GCC website and go to “SUPPORT” page to download the software (<https://www.gccworldnew.com/download.php>). The software is compatible with Windows 7 and above and Macintosh OSX 10.6 and above.

The screenshot shows the GCC website navigation process. It starts with the main website header, followed by a dropdown menu where 'Download Area' is selected. This leads to a 'Browse by machine model' section with categories for Vinyl Cutter, Laser Engraver, and Laser Cutter. The 'Vinyl Cutter' category is selected, showing a list of models: i-Craft™ 2.0, AR-24, Expert II, and Puma IV. Finally, the 'Software' dropdown is expanded to show a table of available software downloads.


Title	Size	Download
GreatCut 4 for Windows (V.17.0.20.21868)	29.4MB	Download
Sure Cuts A Lot 5 for Windows 64 bit (v5_044GCC)	73.6MB	Download
Sure Cuts A Lot 5 for Windows 32 bit (v5_044GCC)	55.7MB	Download
Sure Cuts A Lot 5 for MAC (v5_044GCC)	38.2MB	Download

Step 2 Download “Sure Cuts A Lot” to start the installation.


Step 3 Press Next to continue.

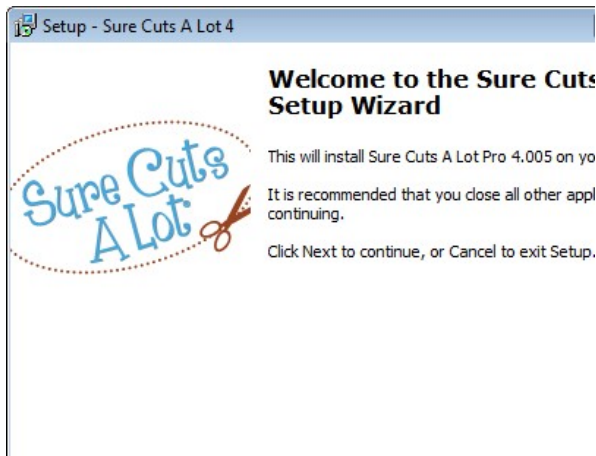


Step 4 Select “I accept the agreement” and press “Next.”

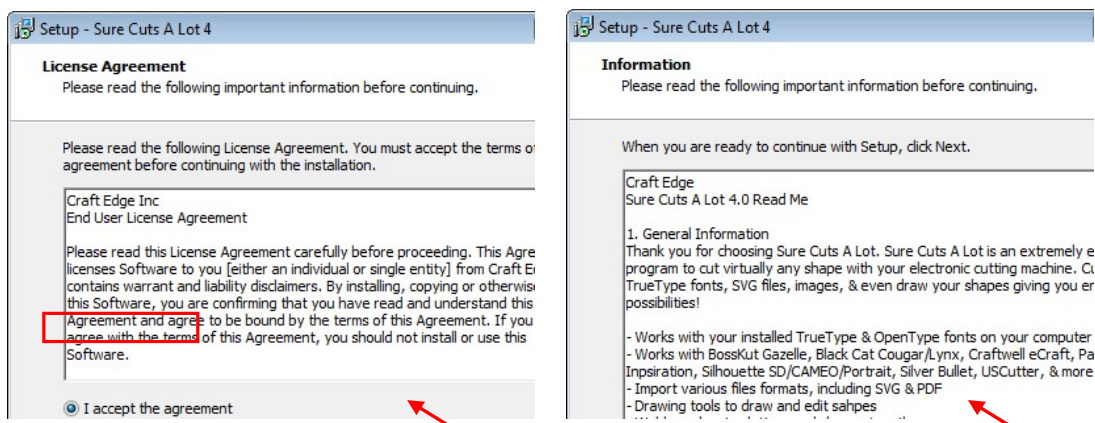


Step 5 Use the default folder (suggested) or select a folder you want to install the Sure Cuts A Lot and press “Next.”

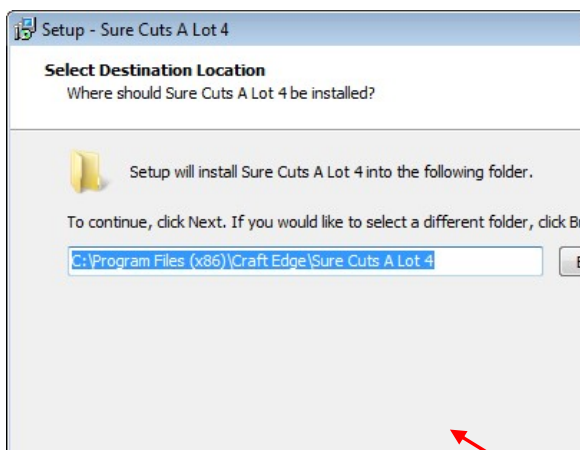




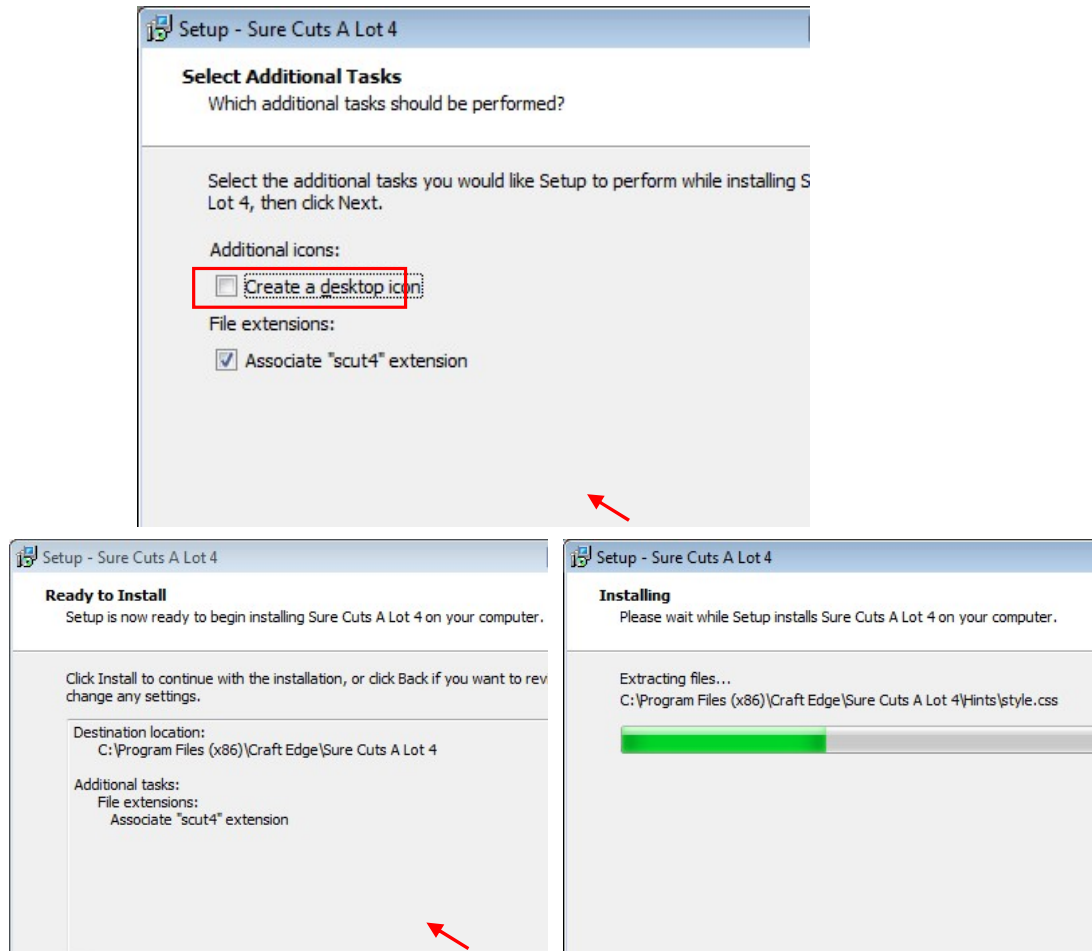

Step 6 Tick “Create a desktop icon” if you want to create a shortcut on your desktop, and tick “Associated scut4 extension” to associate the scut4 extension file with Sure Cuts A Lot software. Then press “Next” to start the installation.

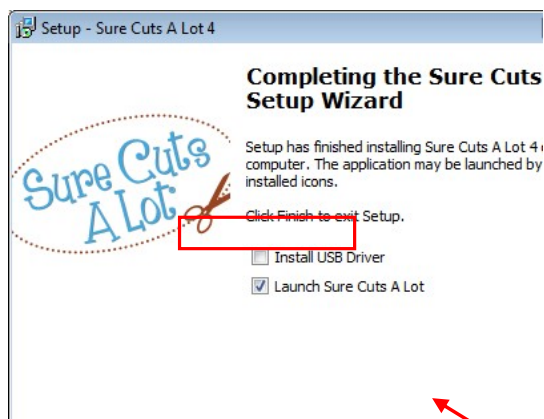

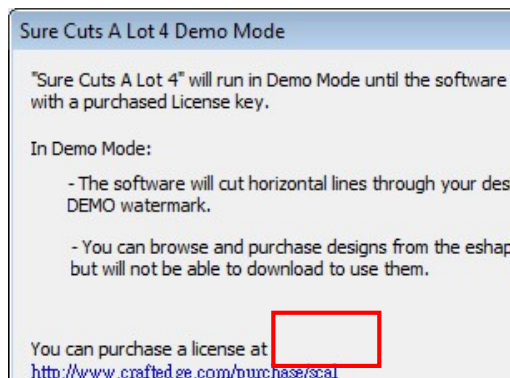Step 7 Don't tick “Install USB Driver” and tick “Launch Sure Cuts A Lot,” and then press “Finish” to complete installation.



Step 8 Run Sure Cuts A Lot.**Step 9** Press “Activate...” to activate Sure Cuts A Lot. Please make sure it is connected to the internet.**Step 10** Put your name in the Name column and enter the 25-letter software key to the Serial column and press “OK” to complete the activation.

Please visit GCC website to download software.
<https://www.gccworld.com/download.php>

GreatCut


- Register your product with voucher code online within 3 months after receiving your cutting plotter to avoid voucher code expiring.
<http://gccvoucher.eurosystems.lu/>
- Get your activation code from email to activate GreatCut after completing registration online.
- If you lost your voucher code after registration, you can retrieve your original voucher code from GCC Club: <http://club.gccworld.com>

GreatCut Voucher Code

Sure Cuts A Lot

- After completing installation of SCAL, enter license code into SCAL to complete activation.

Sure Cuts A Lot Voucher Code

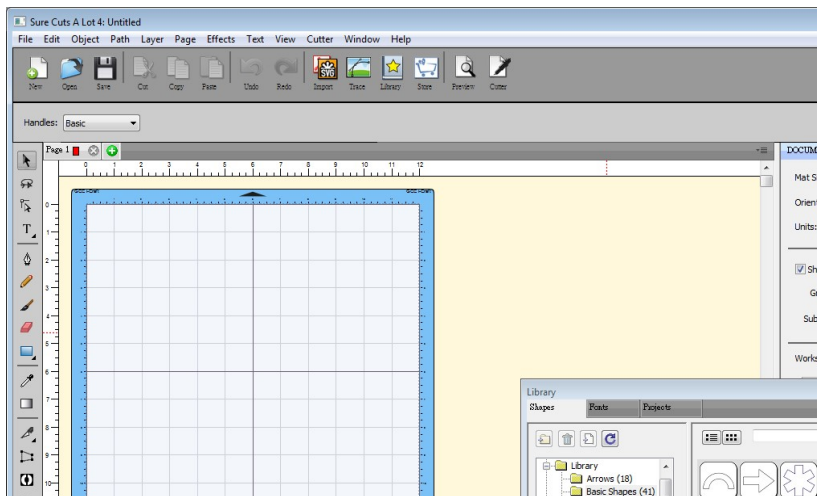
Step 11 Sure Cuts A Lot is ready to use.**Note**

- ✓ If you use a trial version to output graphics, meaning you do not enter the software key to activate the Sure Cuts A Lot mentioned above, there will be two extra lines cut through the design, therefore, make sure the Sure Cuts A Lot software is activated before implementing cutting jobs.

2.6.2.2 Manually Activate Software

If the computer connected to cutter doesn't have internet connection to accomplish above software activation process, you can use "Activate manually" function alternatively to enter the "Activation Code" to start the usage of Sure Cuts A Lot. Meanwhile, you need to find another computer that has internet access to obtain the "Activation Code" in advance following below instructions.

Step 1 Check the "Activate manually" checkbox and you should see the Site Code and Activation Code fields appear. The Site Code field will be pre-filled in and cannot be changed.

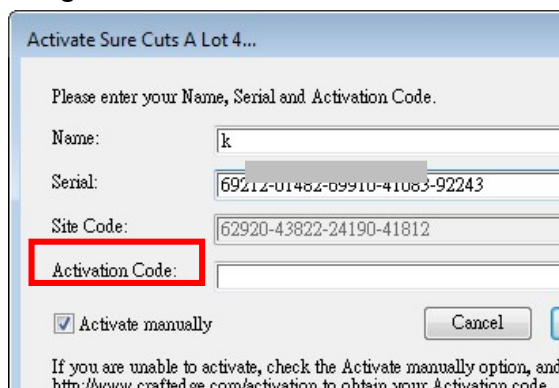

Step 2 Visit <http://www.craftededge.com/activation/surecutsalot> via an internet connected computer. Enter your name, serial (software key shows on the voucher code card) and site code.



Please visit GCC website to download software.
<https://www.gccworld.com/download.php>

GreatCut

- 1 Register your product with voucher code online within 3 months after receiving your cutting plotter to avoid voucher code expiring.
<http://gccvoucher.eurosystems.lu/>
- 2 Get your activation code from email to activate GreatCut after completing registration online.
- 3 If you lost your voucher code after registration, you can retrieve your original voucher code from GCC Club: <http://club.gccworld.com>

GreatCut Voucher Code

Sure Cuts A Lot

- 1 After completing installation of SCAL, enter license code into SCAL to complete activation.

Sure Cuts A Lot Voucher Code

www.GCCworld.com

Step 3 Click on the "Generate Activation Code" button, and your activation code will be shown in the Activation Code field.

Activate "Sure Cuts A Lot"

Important: You only need to do the following if you are having trouble activating from within "Sure Cuts A Lot" or do not have an Internet connection on the computer you are trying to activate on.

You must activate in order to use the full version of the software. Generally, you will just need to choose Activate.. from the Help menu in Sure Cuts A Lot and enter your name and serial number. The software will try to activate automatically and you can disregard this web page. **Do not** use this web page if you have not installed the software yet or have not purchased.

If you view the About box in Sure Cuts A Lot and it shows your name and serial number, the software is activated ok.

If you have problems activating automatically, you must use this web page and generate an Activation Code. The Name and Serial information is obtained from your purchase confirmation e-mail. The Site Code is obtained by running the program and choosing "Activate.." and checking the "Activate Manually" option.

Name:
Please enter your full name

Serial:
Must enter with the dashes (example: 12345-12345-12345-12345-12345)

Site Code:

After entering in your Name, Serial, and the Site Code, click the Generate Activation Code button to create your Activation Code. Copy and paste the value back into the "Activation" dialog box in the application to activate your copy.



If you experience problems generating your Activation Code, please see our [FAQ](#).

Step 4 Copy and paste the activation code back into the activation dialog box of Sure Cuts A Lot program and hit ok.

2.6.2.3 Re-install Sure Cuts A Lot Software

If you change a new computer, you may need to deactivate your Sure Cuts A Lot software and re-install it on your new device.

Go to “Deactivate...” under Help and press Yes to confirm, then follow the installation procedure and use **the same code** to activate it on another computer.

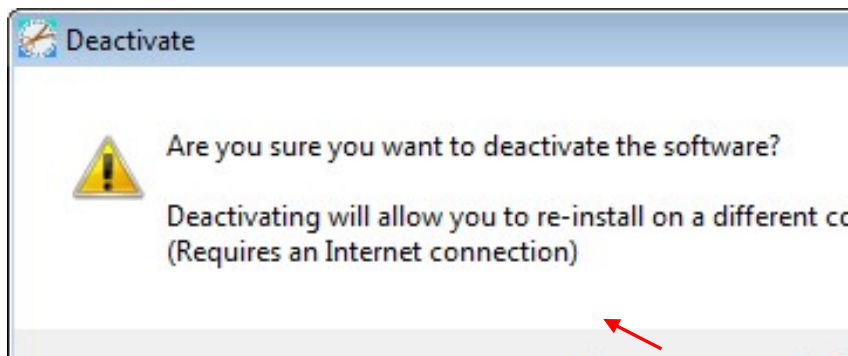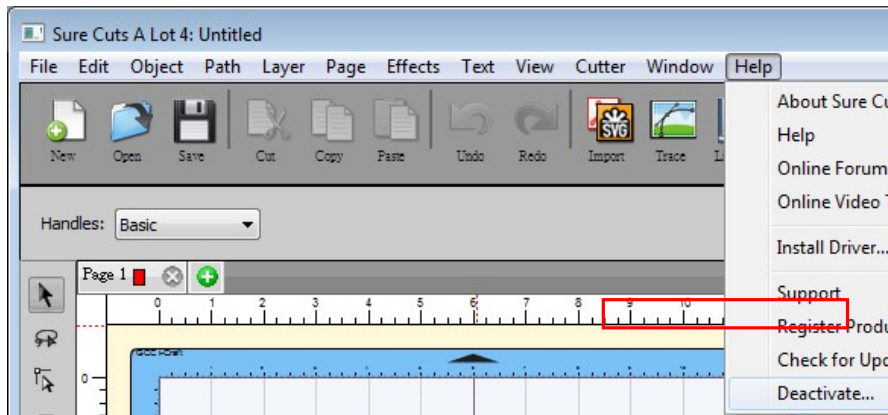

Chapter 3 Operation

3.1 The Control Panel

3.1.1 The Outline of control panel

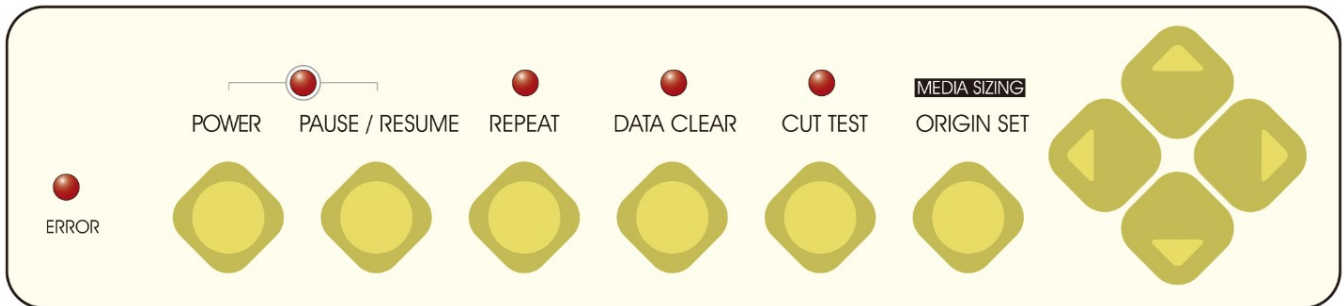


Figure 3-1

Key	Function
ERROR LED	Indicate the error status
POWER	Turn the machine on to work
PAUSE/RESUME	Temporarily halt cutting process or resumes a paused job.
REPEAT	Repeat last job.
DATA CLEAR	Clear up buffer memory.
CUT TEST	Perform cutting tests on different media.
ORIGIN SET (SIZING)	Reset origin at a new position.
4 Arrow Keys	Move carriage position

3.1.2 Reset Origin

Note:

- ✓ The function key to set origin and resize is the same one, press once to activate origin reset while press twice to activate resizing function

Step 1 Move the carriage to a new position.

Step 2 Press the ORIGIN SET button to reset origin.

3.1.3 Cut Test

Note:

- ✓ It's recommended to keep performing this function until the cutting quality meets your demand before executing the cutting job.

Step 1 After sizing, move the carriage to a preferred position.

Step 2 Press CUT TEST button to perform.

3.1.4 Repeat

Note:

- ✓ Make sure the carriage is at the position you want to cut when performing repeat function.

Press the REPEAT button to perform re-plot function starting at the position where the carriage locates. Otherwise, move the carriage to a preferred position, and after re-setting the position as the new origin, user can use the repeat function to repeat a job.

3.1.5 Repeat AAS Job

This feature allows users to repeat AAS jobs automatically without having to operate on the computer side.

When the first AAS job finishes, press "Repeat" on the control panel to activate this function.

Note:

- ✓ Please be noted that this feature is mainly applied to the Single paper mode; ensure a new piece of material is loaded and the origin repositioned to the first registration mark before "Repeat" is pressed.

3.2 VLCD

“VLCD” is a computer program to help modify parameters of cutting functions.

3.2.1 Installation

Step 1 Download the VLCD.exe file from download area on GCC website onto your local drive to finish installation (Download Area → Vinyl Cutter → Expert II A → Software, <https://www.gccworld.com/download.php?act=view&id=21>).

Step 2 Launch VLCD by double-click on the icon.

Note:

- ✓ Make sure the machine is power-on to enable this program.
- ✓ The media is loaded on the machine.

Step 3 Choose the right port connected to your computer (Figure 3-2).

If you are using the USB cable, choose the **model name** from the pull down menu. If you are using a Serial cable, choose either **COM1** or **COM2**. Make sure no other devices are occupying the port that you are going to use.

Step 4 Press the **Connect** button to connect your computer and the cutter. If the connection succeeds, the model info, firmware version, and adjustable parameter columns will be showing.

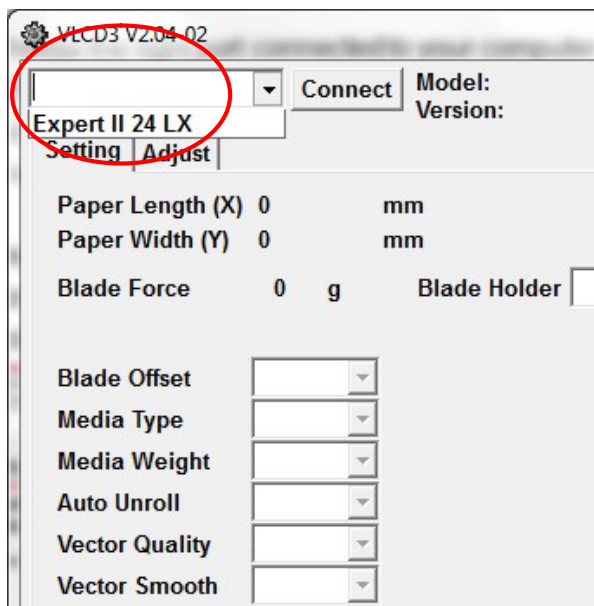


Figure 3-2

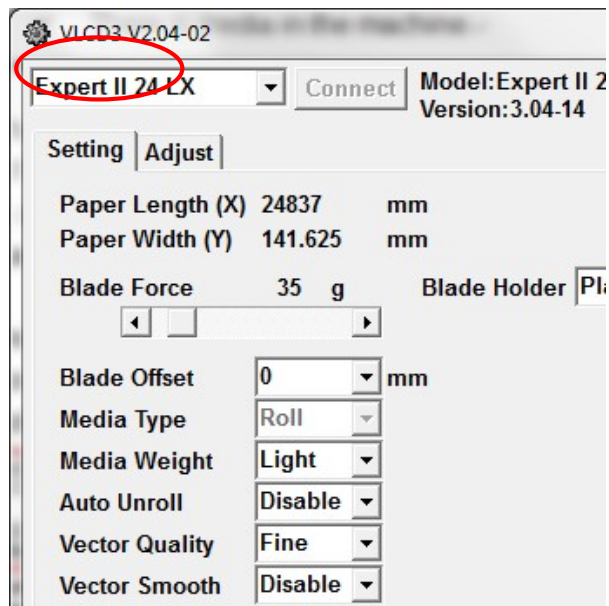


Figure 3-3

3.2.2 Functions of VLCD

Below are the functions adjustable in VLCD for Expert II A.

- Poll Size
- Blade Force
- Blade Holder
- Media Weight
- Blade Offset
- AAS Offset
- Auto Unroll
- Update

■ **Poll Size**

To reveal the X/Y values.

In the case, the maximum plotting length is 25000mm, and the distance between the farthest two pinch rollers is 158.975 mm (Figure 3-4).

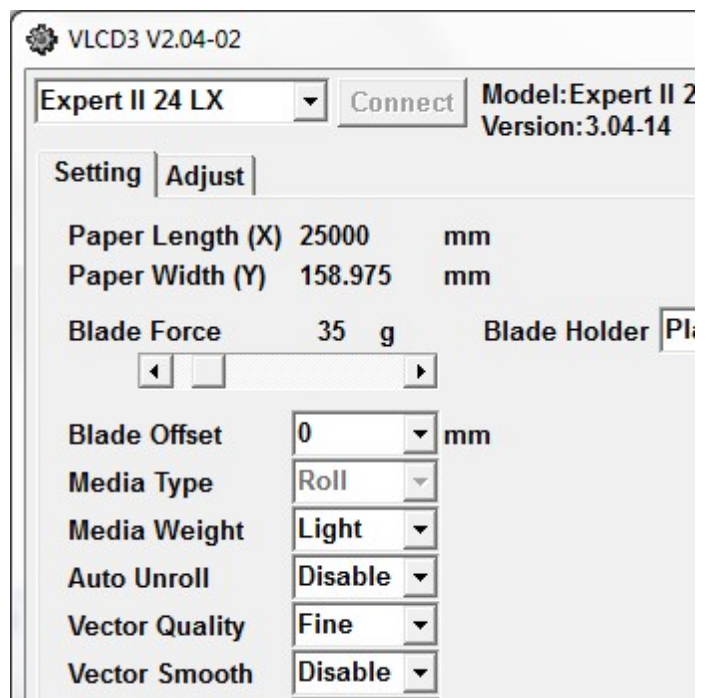


Figure 3-4

■ **Blade Force**

To adjust the blade force between 0 and 350 (Default = 35).

Note: when plotting with a pen, adjust the Force to the lowest setting to avoid faint lines as

well as to extend the life of a pen.

- **Blade Holder**

To choose the blade holder- Plastic (Default) or Metal.

- **Media Weight**

To choose different weights of media in two options: Heavy, and Light (Default).


- **Blade Offset**

To adjust the blade offset to ensure cutting quality in 8 options: 0.000, 0.175, 0.250 (Default), 0.275, 0.300, 0.500, 0.750, and 1.000.

- **AAS Offset**

To set or modify AAS offset value.

You can refer to “5.3 Printer Test” for more details.

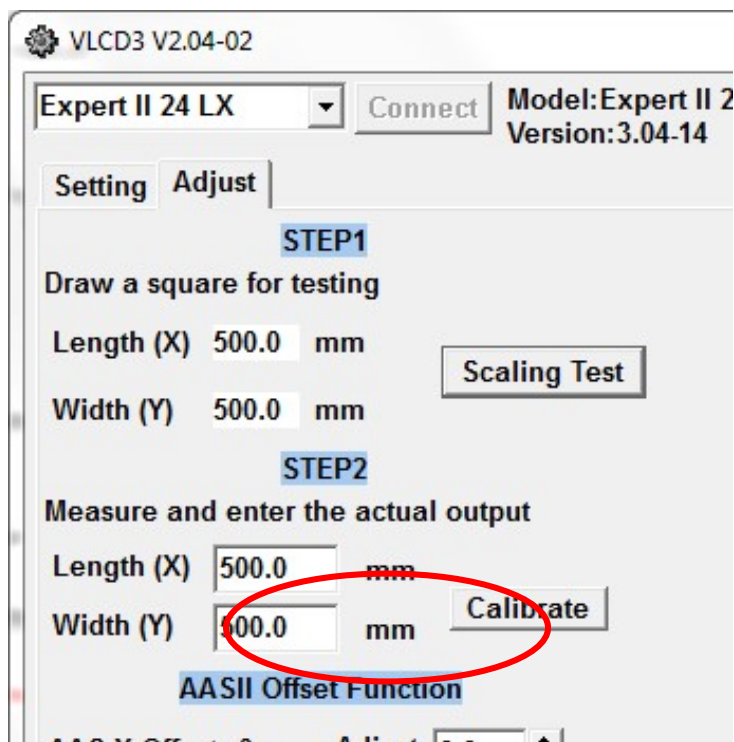

- **Auto Unroll**

To switch options for sheet media and roll media (Auto Unroll On: Default).


- **Update**

To apply the changed setting onto the cutter by presses the **Update** button.


3.2.3 Restore factory default settings

VLCD allows you to turn all parameters to factory-default settings.


Step 1 Enter the USB-port switching mode by pressing “PAUSE”(2) after “POWER”(1) and then press “ORIGIN SET” (3).

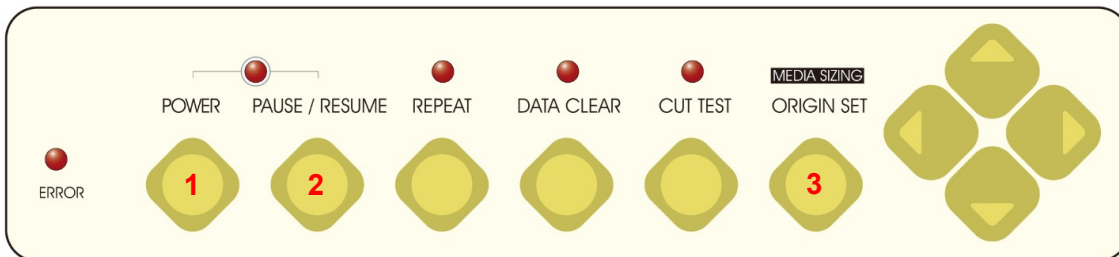


Step 2 Press the left key (4) and then up (5)

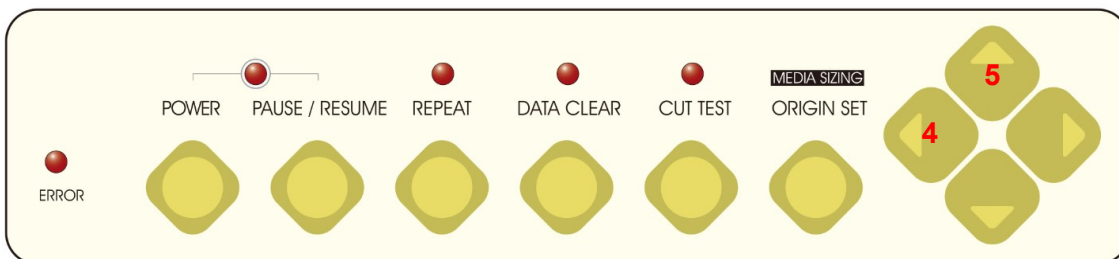

Step 3 You have now entered the Data clear and restoring default settings mode; press “Data clear” (6) and then “Origin Set” (7) to confirm.

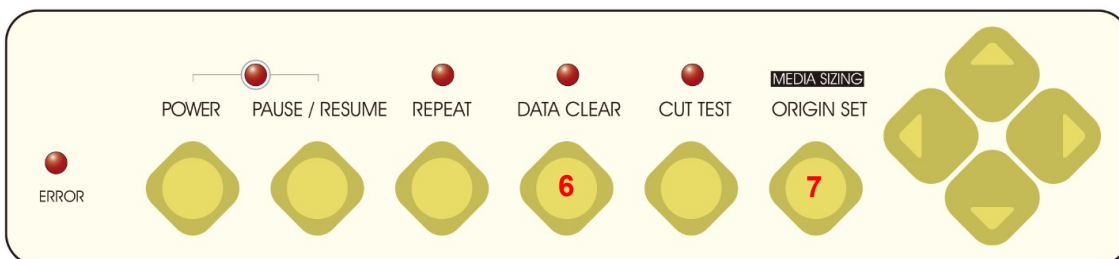

Step 4 The default settings restoring process has been completed. All buttons will be ineffective before the cutter is rebooted.

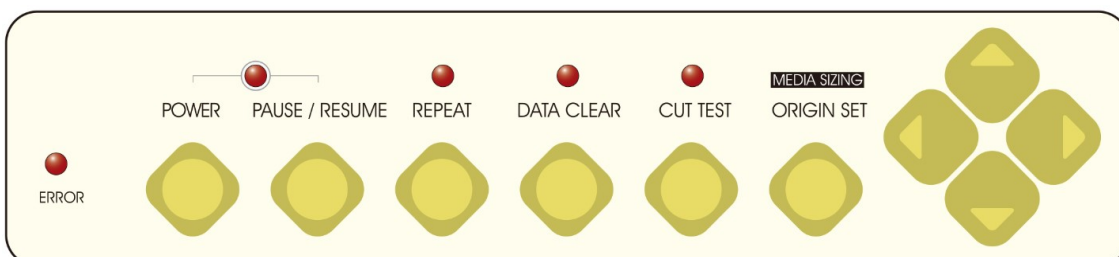

Step 5 Restart your cutting plotter now.

3.3 File Uploader

3.3.1 Installation

- ✓ “File Uploader” is a tool to help loading files for direct output.
- ✓ The program **ONLY** supports HPGL format-files generated via GCC Cutter driver.
- ✓ Download the **GCC File Uploader.exe** file from GCC website onto your local drive to finish installation (Download Area → Vinyl Cutter → Expert II A → Software, <https://www.gccworld.com/download.php?act=view&id=21>).
- ✓ Launch GCC File Uploader by double-click on the icon (Figure 3-5).

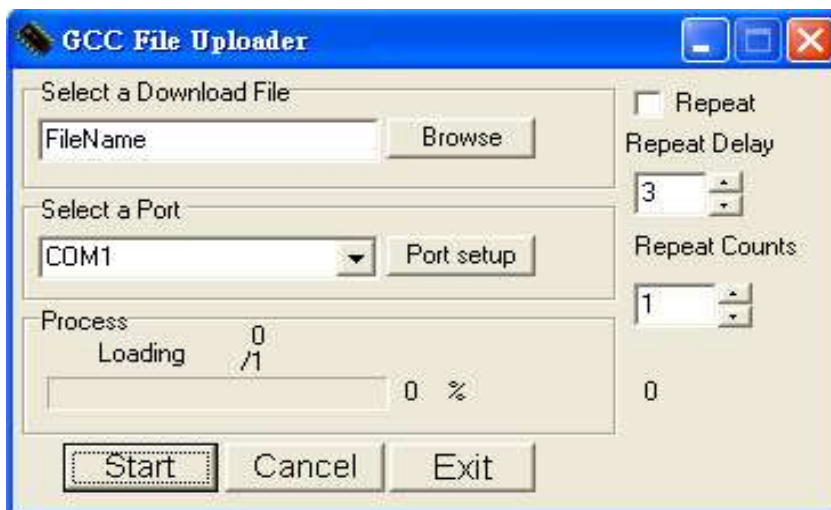


Figure 3-5

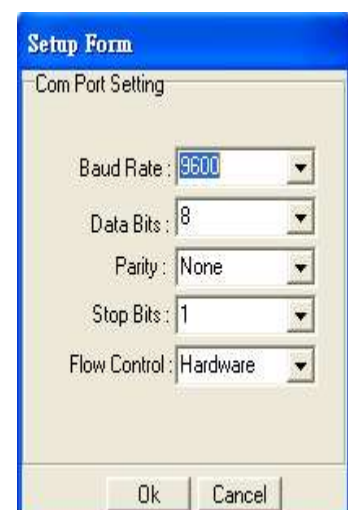


Figure 3-6

3.3.2 Functions of File Uploader

- **Port setup**
 - ✓ This function will be activated while choosing COM port for data transmission.
 - ✓ Press the Port setup button to pop up the setup window for parameter change (Figure 3-6).
- **Repeat**
 - ✓ Activate this function by click on the Repeat's checkbox.
 - ✓ Repeat Delay – the pause time between jobs; Unit: second.
 - ✓ Repeat Counts – the number of repeat jobs.

3.4 Data Transmission

There are two options to transmit the data from the computer to the cutting plotter:

Option 1: With proper interface settings, the data can be transmitted from your application software package to the cutting plotters directly.

Option 2: Most cutting software packages are able to emulate **HPGL** or **HPGL/2** commands, therefore. As long as the file is **HPGL** or **HPGL/2** format, the cutting plotter can output the data precisely.

3.5 Expert II A Print Driver Setting

3.5.1 Expert II A Print Driver setting>Option Page

File Function:

The file function section allows users to set the parameters of Speed, Force, Offset and Quality for later use. This section is useful when performing repeated jobs on a variety of objects, allowing you to save your frequently used cutter parameters and load them in the future.

- Custom Media: This section lists the files for the parameter settings that you have recently created and worked. You can save more than 50 files to simplify your cutting job.
- Default: This section contains the reference settings that are applicable with the verified materials to achieve the best cutting results. Please note that the setting value might need to be adjusted according to different suppliers of materials.
- SAVE: This function will save current print driver parameter settings to a file under the specified location on your computer. (Saved parameter setting files will be tagged with the Expert II A series extension)
- LOAD: This function allows you to load previously saved print driver parameters.
- ORIGINAL: This function will load the print driver's original factory parameter settings.
- SAVE TO DEFAULT: This function allows you to save your current print driver parameters as the default startup settings.
- DELETE: This function will delete the file you select from the Custom Media section, whereas the settings in Default section cannot be deleted. Please note the delete function only removes the list shown in Custom Media section, it does not remove the file from your hard

drive, if you wish to completely remove the file from your hard disk, you will have to manually delete the file from your operating system.

Die Cut

The Die Cut function must be activated with the Kiss Cut function to avoid the falling of cut-through materials and material jam beneath the carriage. Die Cut helps you to cut through the backing of the material while Kiss Cut cuts through only the top layer but not the backing. This will leave only tiny bits of the backing attached to the top layer, creating complete individual patterns with backing sheets (see figure 3-7 and 3-8).



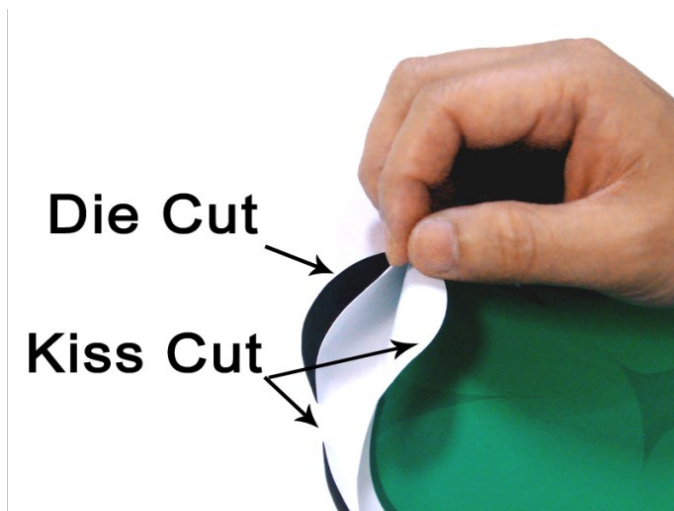


Figure 3-8


To activate the Die Cut function, go to “Option”, tick “Die Cut”, and enter the amount you wish for the “Length” and “Force” of both Die Cut and Kiss Cut, then click “OK” (see figure 3-9).

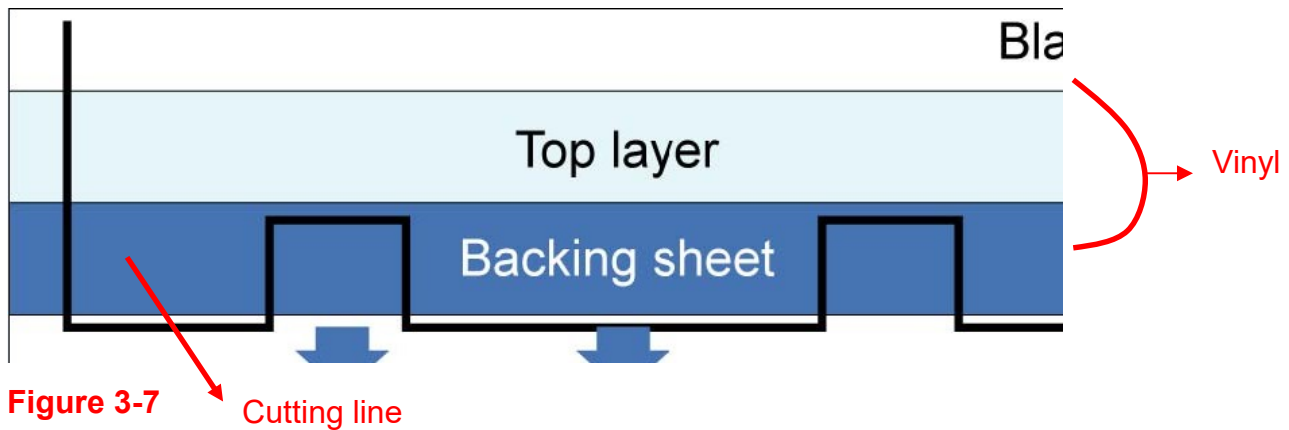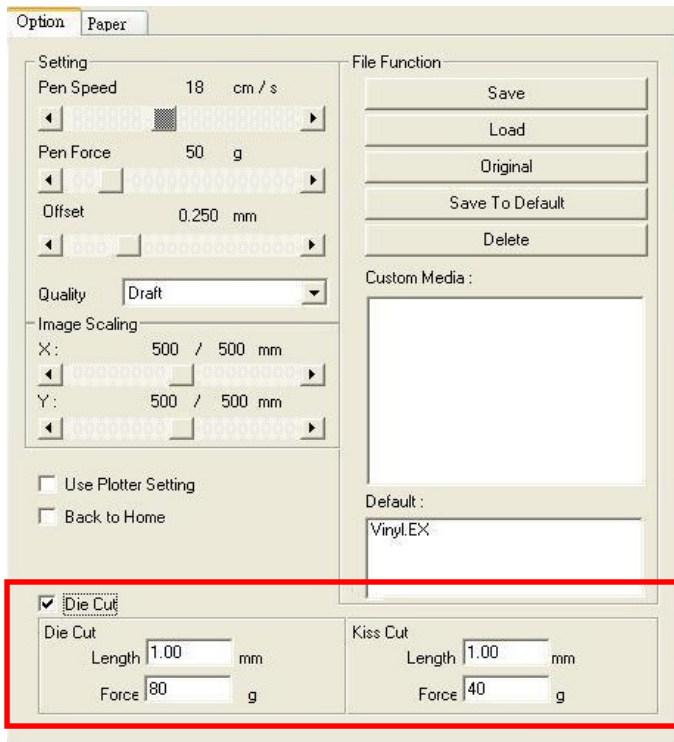

***Note:**
The length setting for the cutting line of Die Cut is in the range of 0-2000mm whereas that of Kiss Cut is 0-100mm.

Figure 3.9

When the job is completed and you untick the Die Cut function, you will be able to adjust the pen speed, pen force, and offset in the section on the top following normal operating procedures (see figure 3-10).

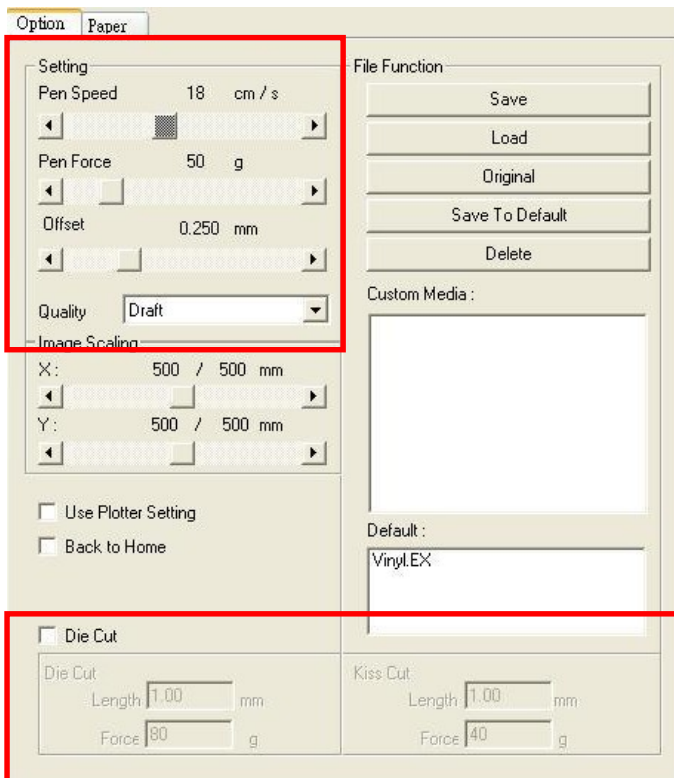

Note:

1. The extension of the blade has to be set to cut through both the top layer and the backing in the very beginning. You then adjust the tool force for the best cutting performance.
2. Once the Die Cut function is activated, it will perform on all the line segments on the object.

Figure 3-10

3.6 Reference Parameter Setting for Different Materials

The following reference parameter is used on GCC verified materials shown in the table.

Material	Personalized/ Wall stickers	Vehicle stickers	Window decoration	Window tint
Blade	red	red	red	red / yellow
Blade tip length (mm)	0.28	0.27	0.25	0.09
Force (g)	105	85	95	70
Speed (cm/sec)	72	60	65	72
Offset (mm)	0.25	0.25	0.25	0.25
Recommend model	RX, Jaguar, Puma, EX, AR	RX, Jaguar, Puma, EX, AR	RX, Jaguar, Puma, EX, AR	RX, Jaguar, Puma, EX, AR
Material	Stencil	Reflective film	Flock	Cardboard
Blade	red / green	green	green	green
Blade tip length (mm)	0.3	0.5	0.3	0.3
Force (g)	180	380	135	165
Speed (cm/sec)	15	3	30	30
Offset (mm)	0.25 / 0.5	0.5	0.5	0.5
Recommend model	RX, Jaguar, Puma, EX, AR	RX, Jaguar, Puma, EX	RX, Jaguar, Puma, EX, AR	RX, Jaguar, Puma, EX, AR
Material	Magnets	Protective tint	Rhinestone	Sandblast mask
Blade	green	green	green	blue
Blade tip length (mm)	0.8	0.3	0.8	0.27
Force (g)	580	320	190	85
Speed (cm/sec)	3	3	15	60
Offset (mm)	0.5	0.5	0.5	0.25
Recommend model	RX, Jaguar	RX, Jaguar, Puma, EX	RX, Jaguar, Puma	RX, Jaguar, Puma, EX, AR
Material	Small text (vinyl)			
Blade	black			
Blade tip length (mm)	0.27			
Force (g)	thick: 150 thin: 90			
Speed (cm/sec)	9			
Offset (mm)	0.175			
Recommend model	RX, Jaguar, Puma			

Chapter 4 Basic Maintenance

This chapter explains the basic maintenance (i.e. cleaning the cutting plotter) required for the cutting plotter. Except II for the steps mentioned below, all the other maintenances must be performed by a qualified service technician.

4.1 Cleaning the cutting plotter

In order to keep the cutting plotter under good conditions and have the best performance, you need to clean the machine properly and regularly.

[Precaution in Cleaning](#)



- ✧ **Unplug the cutting plotter before cleaning.**
- ✧ **Never use solvents, abrasive cleaners or strong detergents for cleaning. They may damage the surface of the cutting plotter and the moving parts.**

[Recommended Methods](#)

- ❖ Gently wipe the cutting plotter surface with a lint-free cloth. If necessary, clean it with a water-rinsed or an alcohol-rinsed cloth. Wipe the cutting plotter to remove any residues on the cutting plotter. Finally absorb water with a soft, lint-free cloth.
- ❖ Wipe all the dust and dirt from the tool carriage rail.
- ❖ Use a vacuum cleaner to clean any accumulated dirt and media residue beneath the pinch roller housing.
- ❖ Clean the platen, paper sensors and the pinch rollers with a water-rinsed cloth or alcohol-rinsed cloth. Finally absorb water with a soft, lint-free cloth.
- ❖ Use the same method mentioned above to clean dust and dirt from the stand.

4.2 Cleaning the Grid Drum

- ❖ Turn off the cutting plotter, and move the tool carriage away from the area needed to be cleaned.
- ❖ Raise the pinch rollers and move them away from the grid drum for cleaning.
- ❖ Use a bristle (a toothbrush is also acceptable) to remove dust from the drum surface. It needs to rotate the drum manually to clean the drum completely (Figure 4-1).

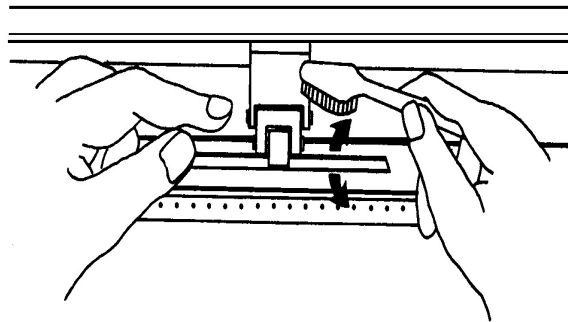


Figure 4-1

4.3 Cleaning the Pinch Rollers

If the pinch rollers need a thorough cleaning, use a lint-free cloth or cotton swab to wipe away the accumulated dust from the rubber portion of the pinch rollers. To prevent the pinch rollers from rotating while cleaning, use your fingers to hold the pinch rollers in place.

Use a lint-free cloth or cotton swab rinsed with alcohol to remove the embedded or persistent dust.

Chapter 5 Automatic-Aligning System

AAS II (Automatic-Aligning System II) is only available for Expert II A LX models. For Expert II A 24 or 52 users, you can skip this chapter.


Please note that this chapter is only an instruction to AASII; for step-by-step instructions, please refer to the following chapters: 07_A-4 CorelDraw Plug-In, 07_A-5 Illustrator Plug-In, 07_A-6 GreatCut Plug-In.

5.1 Introduction


The Expert II A cutting plotters feature a standard Automatic-Aligning System (AAS II) to guarantee precise contour cutting quality by detecting the registration marks printed around the graphic.

Notice

- Avoid any kind of light source horizontally illuminating the AAS module.

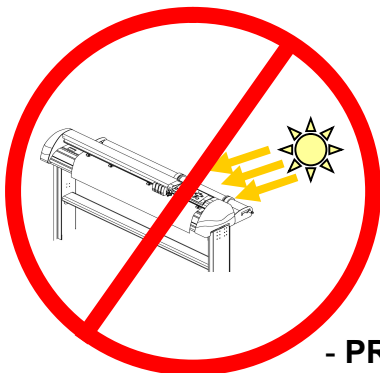

- PROHIBITED

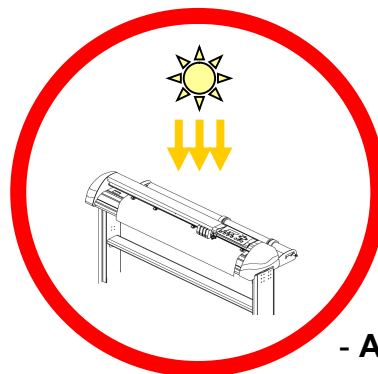

- ACCEPTABLE

- DO NOT take off the cover of AAS module while in operation.



- PROHIBITED

5.2 AAS Contour Cutting System

The AAS system has one calibration procedures to ensure maximum accuracy of AAS operation. To operate the AAS you need to learn about the method of media feeding firstly. (Refer to 2.4 Media Loading.)

5.2.1 Notice for Registration Marks

The first registration mark is designed to be different in order to identify the origin for AAS auto-detection. The following precaution must be aware for registration marks to be read automatically.

- Type of media
- Registration mark pattern
- Reading range required for detection the registration marks
- Position for registration marks and medium

The registration marks have to be:

- Created by cutting software like GreatCut or GCC CoreIDRAW plug-in
- In black color (printing quality of registration marks is essential; incorrect, misaligned colors, blurry or smeared printout might leading to inaccurate cutting result)
- Length: The length of marks
 - Range: 5mm~50mm
 - Optimized Setting: 25mm
- Thickness: The line thickness of marks
 - Range: 1mm~2mm
 - Optimized Setting: 1mm
- Margin: The distance between marks and images
 - Range: 0mm~50mm
 - Optimized Setting: 5mm

The cutter can not detect the marks while:

- Cutter carriage is not located near the outside area of first mark before detecting (See the picture in page 5-7 for auto-detecting area of first mark.)
- Medium thickness is more than 0.8mm
- Transparent medium is used
- Non-monochrome drawing. The marks can't be read if is printed on colored medium
- Dirty or creased medium surface

5.2.2 AAS II on Expert II A

There are three types of AAS II mark patterns: 4-Point Positioning, Segmental Positioning, and Multiple Copies. Note that before print out your designs by inkjet printers, the registration marks have to be created on your graphic designs by cutting software like SignPal, GreatCut or GCC CorelDraw plug-in. ***Hand-made marks or drawings won't be reorganized by GCC cutting plotters.*** For more details about registration mark setting in cutting software, please refer to 'Appendix A-4 : CorelDraw Plug-In Instruction', 'Appendix A-5 : Illustrator Plug-In', **Appendix A-6** GreatCut Plug-In.

1. 4-Point Positioning

This is the basic mark pattern that AAS II will auto detect four registration marks and contour cut images inside those marks.

- Command: Esc.D1;(XDist);(YDist):
- Layout: 4 registration marks at the 4 corners around the design



2. Segmental Positioning

In addition to 4 original points, the intermediate registration marks are added on both X axis and Y axis to help contour cut accurately, especially for cutting large images.


- **Command:** Esc.D2;(XDist);(YDist);(XStep);(YStep):
- **Layout:**
In-between distance on X: 200~600mm, default 300mm
In-between distance on Y: 200~600mm, default 300mm



3. Multiple Copies

The function is used to duplicate images to let you cut quantities of images at a time. The AAS II sensor will automatically scan registration marks for each individual image to ensure the contour cutting precision.


- **Command:** Esc.D3;(XCopies);(YCopies);(Space):
- **Layout:**

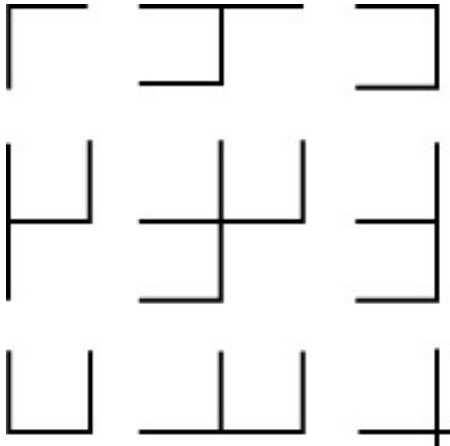

5.3 Printer Test

Before performing AAS contour cutting, it's recommended to print out a test file to make sure the AAS II cutting accuracy. Please visit GCC website and go to Download Area to download the test files.


<https://www.gccworld.com/download.php?act=view&id=20>

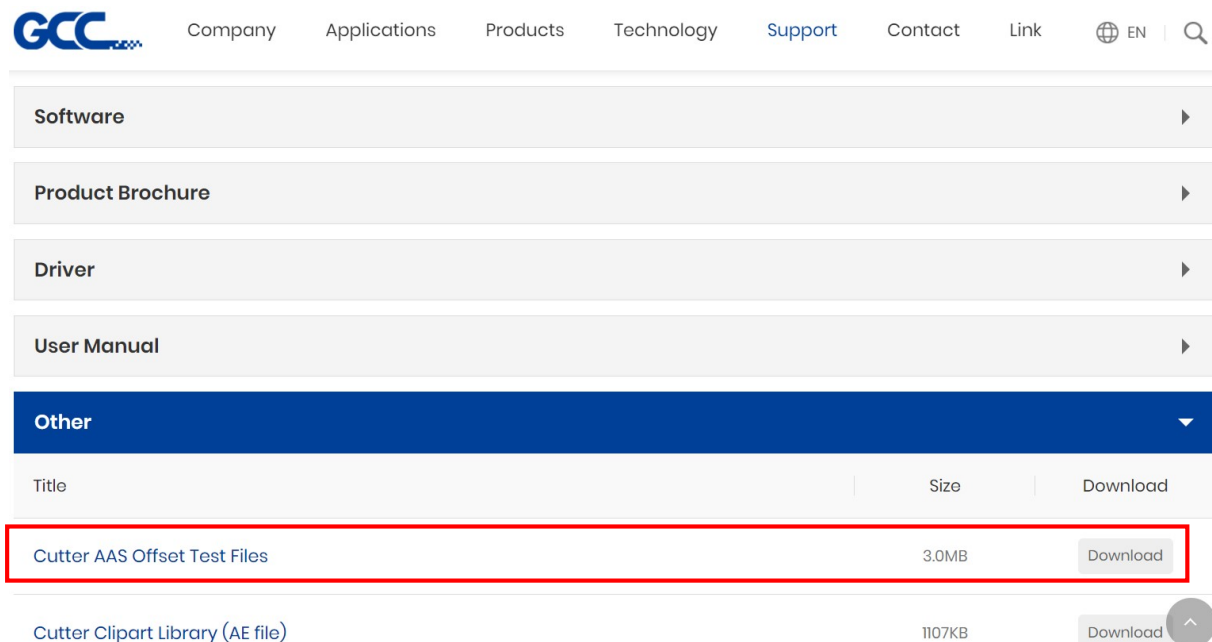

Title	Size	Download
Cutter AAS Offset Test Files	3.0MB	Download
Cutter Clipart Library (AE file)	1107KB	Download

There are two testing files for AASII:

1. AAS II_X_Y_Offset_Caberation_A4 .eps (A4 size)
2. AAS II_X_Y_Offset_Caberation_600_600 .eps (Default setting, it is recommended for testing)
 - Print out the testing graphic. (Please use high precision printer)
 - Load the graphic to machine and sent the file to test the cutting job
 - If there are any adjustments to be made, you can change the offset value by following the steps:
 - Measure the offset values from the printed line and the actual cutting line.
 - Enter the AAS Offset under MISC function for the values you just measured, then press Enter
 - Test the cutting again
 - AAS II offset X and Y value is defined as following:
Horizontal line is defined as X and vertical is defined as Y (when facing the cutting plotter)
 - When the actual cutting line and the printed line need to be changed towards the direction of origin mark, then simply add the negative value of the offset. If the direction is from the opposite of the origin mark, then enter positive values for the offset (see the following figure) s method applies to both X and Y axes.

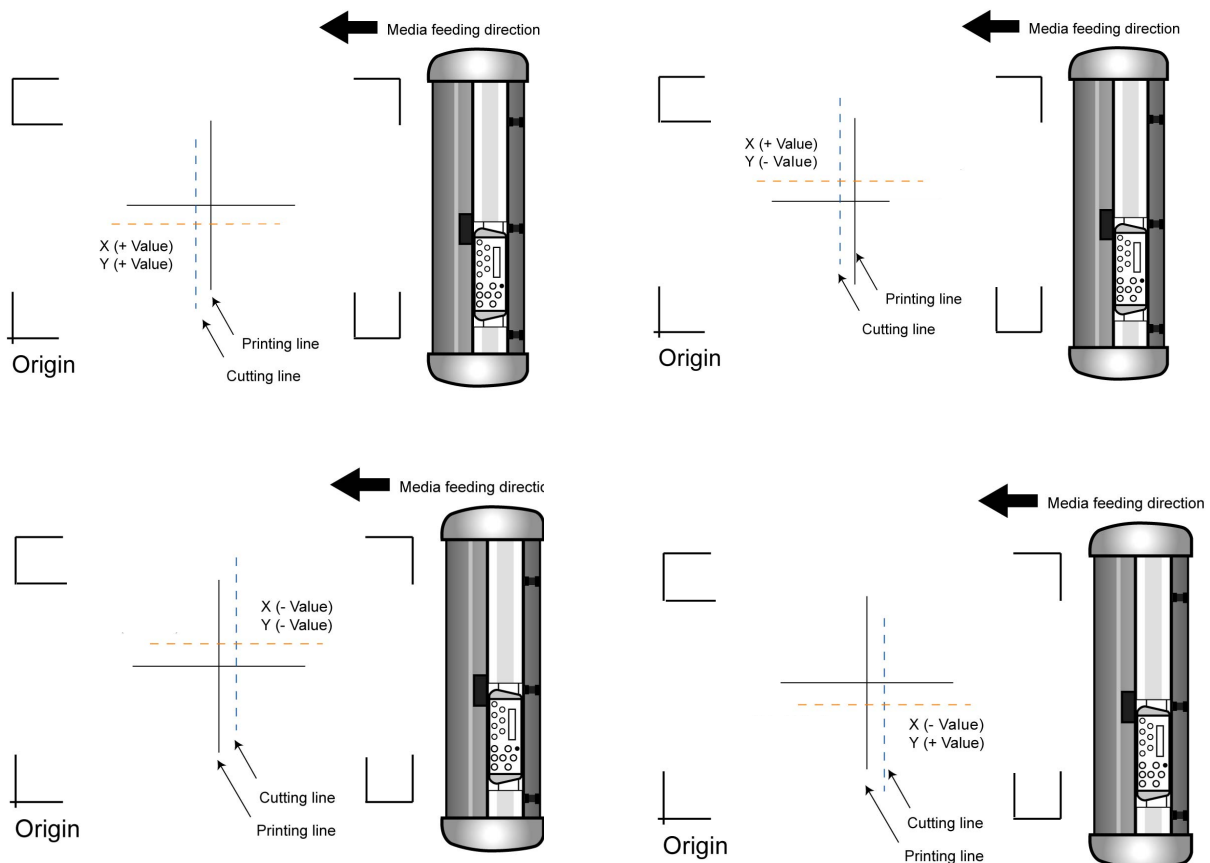


Note:

- Before adjusting the AAS II settings, please proceed scaling for width and length.
- The blade offset value isn't set for this test graphic, please set it according to the blade you use.
- If you have any question, please contact us or your local distributor for assistance.

5.4 Registration Mark Offset Range

Please correctly load your media (refer to the alignment ruler on the platen) to make sure the registration marks are successfully detected. Deviation exceeds the range below will lead to detection failure.

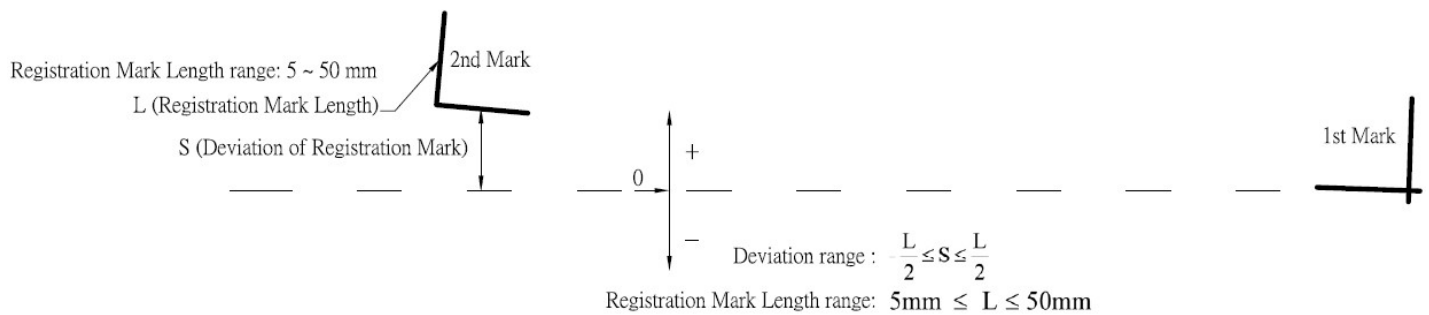

5.5 Contour Cutting

For accurate contour cutting with AAS function, please proceed the following steps:

Step 1 Creating Graphics

- Create the graphic that you want to print and cut in your software.



- Create a contour for cutting around the graphic.



TIPS1: Leave some space between the graphic and contour line.

TIPS2: Create the contour in a separate layer and assign a different color for it.


- Add registration marks around the graphic.

Note:

The Multiple Copies function is also available. It automatically copy the graphic and registration marks.

Step 2 Placing the Registration Marks

- The AAS Layout Instruction:

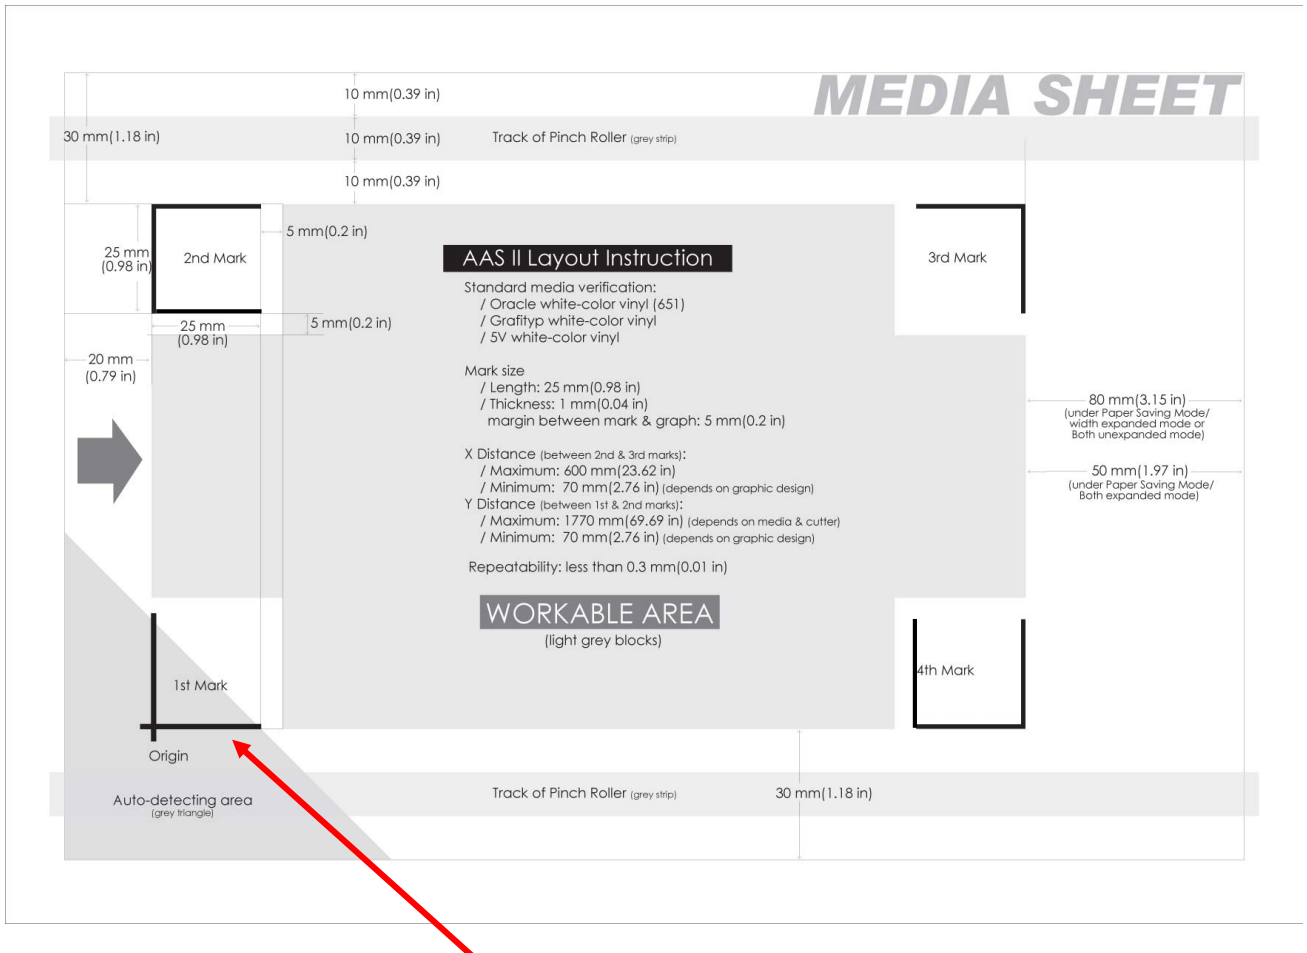


* Auto-detection function on the 1st mark covers the grey area

- Suggested 30mm margin on both left and right sides of media sheet.
- Suggested 20~30mm margin on top of media sheet, and at least 50mm margin on the bottom edge to prevent sheets dropping or any error occurred while media sizing.

Step 3 Print the Graphics

- Print the graphic and the marks with your printer

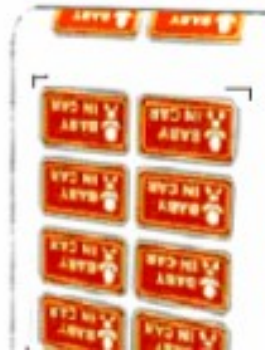


(Scaling = 100%).

- When printing on a roll media, make sure the orientation as following:

Step 4 Load the printout onto cutter

- The Origin Mark is different from the rest registration marks. Please make sure the media is fed with correct direction.

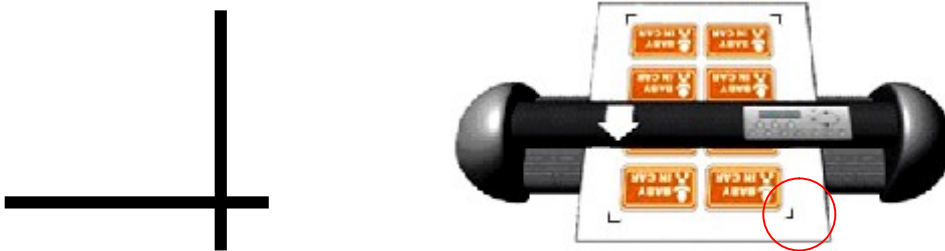**Step 5 Cut the Contour**

- Send out the command from software to perform the contour cutting job.

5.6 Tips for AAS

For getting better results of contour cutting, there are some tips below for your reference.

- Keep light sources simple and avoid illuminating from the sides of cutter.
- Before operating AAS, change the maximum paper size in Expert II A driver property.

Step 1 Find the **Expert II A model** in the "Printer & Fax" folder of your PC.

Step 2 Open the Properties window and select the "Paper" tab.

Step 3 Change the maximum Paper Size of X to **1200mm**.

- Adjust the cutting speed to between 200~400mm/sec.
- Avoid the registration marks locating on the tracks of pinch rollers.
- Make sure the edge of the media is not bent up when detecting registration marks.

Chapter 6 Troubleshooting

This chapter helps you to correct some common problems you may come across. Prior to getting into the details of this chapter, please be sure that your application environment is compatible with the cutting plotter.

Note:

Before contacting your local dealer, please make sure that the problems are coming from your cutting plotter, not from the communication between the computer and cutting plotter or from a malfunction in your computer or software.



Why doesn't the cutting plotter operate?

6.1 What if Expert II A cannot operate?

If your cutting plotter doesn't plot, please check the following items first:

- Is the power cord plugged in properly?
- Is the power cord connected to the power connector properly?
- Is the power switch turned on properly?







Solutions: If the POWER LED lights on, the cutting plotter should be in a normal condition. Turn off the cutting plotter and turn it on again to see if the problem still exists. If the POWER LED doesn't light, please call your local dealer to resolve this problem.

6.2 Light Indicators

Some of the operating problems can be identified by the lights on the control panel. When your cutting plotter stops operating or the lights are on or flashing unexpectedly, see the following descriptions of the panel light patterns and the actions you should take.

6.2.1 Warning Indicators

When the ERROR LED flashes (as shown below), take the necessary actions according to the following instructions. When the problems are solved, the ERROR LED will turn off automatically. Pressing the ON/OFF LINE button can also turn off the ERROR LED.

Warning Indicators		ERROR	ON/OFF LINE	REPEAT	DATA CLEAR	CUT TEST
1	Graph was clipped		●	●	○	○
2	HPGL/2 command Error		●	○	●	○
3	Lever up or no media		●	○	○	○
4	Cannot repeat		○	●	○	○
5	Communication error		○	○	●	○
6	Width sensor error		○	○	○	●
7	Check media, drum or X motor	●	○	○	●	○



= flash



= on



= off

Warning 1 The graph is clipped

This condition indicates that the cutting graph is bigger than the cutting area.

You can solve the problem by:

1. Reload a wider or longer media.
2. Move the pinch rollers to widen the cutting area.
3. Re-scale the graph to a smaller size. Then send the cutting job again from your computer to the cutting plotter.

Warning 2 HPGL/2 command error

If the cutting plotter cannot recognize the commands from your computer, please check the commands applied to your cutting plotter in the HP-GL/2 or HPGL commands. Then send the same job to the cutting plotter again.

If that doesn't solve the problem, please contact your local dealer.

Warning 3 Lever up or no media

Check that you have lowered the lever down and make sure that you load the media before cutting.

Warning 4 Cannot repeat cutting

There are two possibilities:

1. There is no data in the buffer: please send the job again from your computer;
2. The buffer is full: please send the same job from your computer again.

Under both conditions, press the ON/OFF LINE key to clear the warning message.

Warning 5 Communication error

Check that the serial/USB cable has been connected to the cutting plotter and computer properly.

If so, then check whether the interface settings are correct. Check that the communication settings in your PC are the same as the ones on your cutting plotter (for example – 9600bps, no parity, 8 bits, 1 stop bit). Then, press ON/OFF Line key to switch back to On Line mode.

Warning 6 Width sensor error

Check that the pinch rollers are positioned above the grid drum and reload the media again.

Note:

In order to identify the warning messages easily, please stick the warning sticker (in accessory box) on the side cover of your cutting plotter.

6.2.2 Error Indicators

If some mechanical problems occur during the operation, the ERROR LED will turn on. Please follow the instructions below to solve the problem. If the cutting plotter still cannot work, please contact your local dealer and tell him or her about the error indicator.

	Error Indicators	ERROR	ON/OFF LINE	REPEAT	DATA CLEAR	CUT TEST
1	SRAM error	●	●	○	○	○
2	DRAM error	●	○	●	○	○
3	Check media, drum, or X motor	●	○	○	●	○
4	Check media or Y motor	●	○	○	○	●



= flash



= on



= off

Error 1 and 2

Please contact your local dealer to replace SRAM or DRAM.

Error 3 Check the media, drum or X-motor (Drum driven motor)

This message indicates that there might be a problem on the **X-axis**.

Please check that the drums are working normally and see that the media is well loaded. Then turn on the power and reboot the cutting plotter.


Error 4 Check the media, or Y motor (carriage driven motor)

This message indicates that there might be an obstruction to the carriage relating to a problem on the **Y-axis**.

Please clear the obstruction and check that the carriage can move smoothly. Then turn on the power and reboot the cutting plotter.

6.3 Cutting Quality Problems

Note: The daily maintenance of your cutting plotter is very important. Be sure to clean up the grid drum and pinch rollers regularly for better cutting accuracy and output quality.

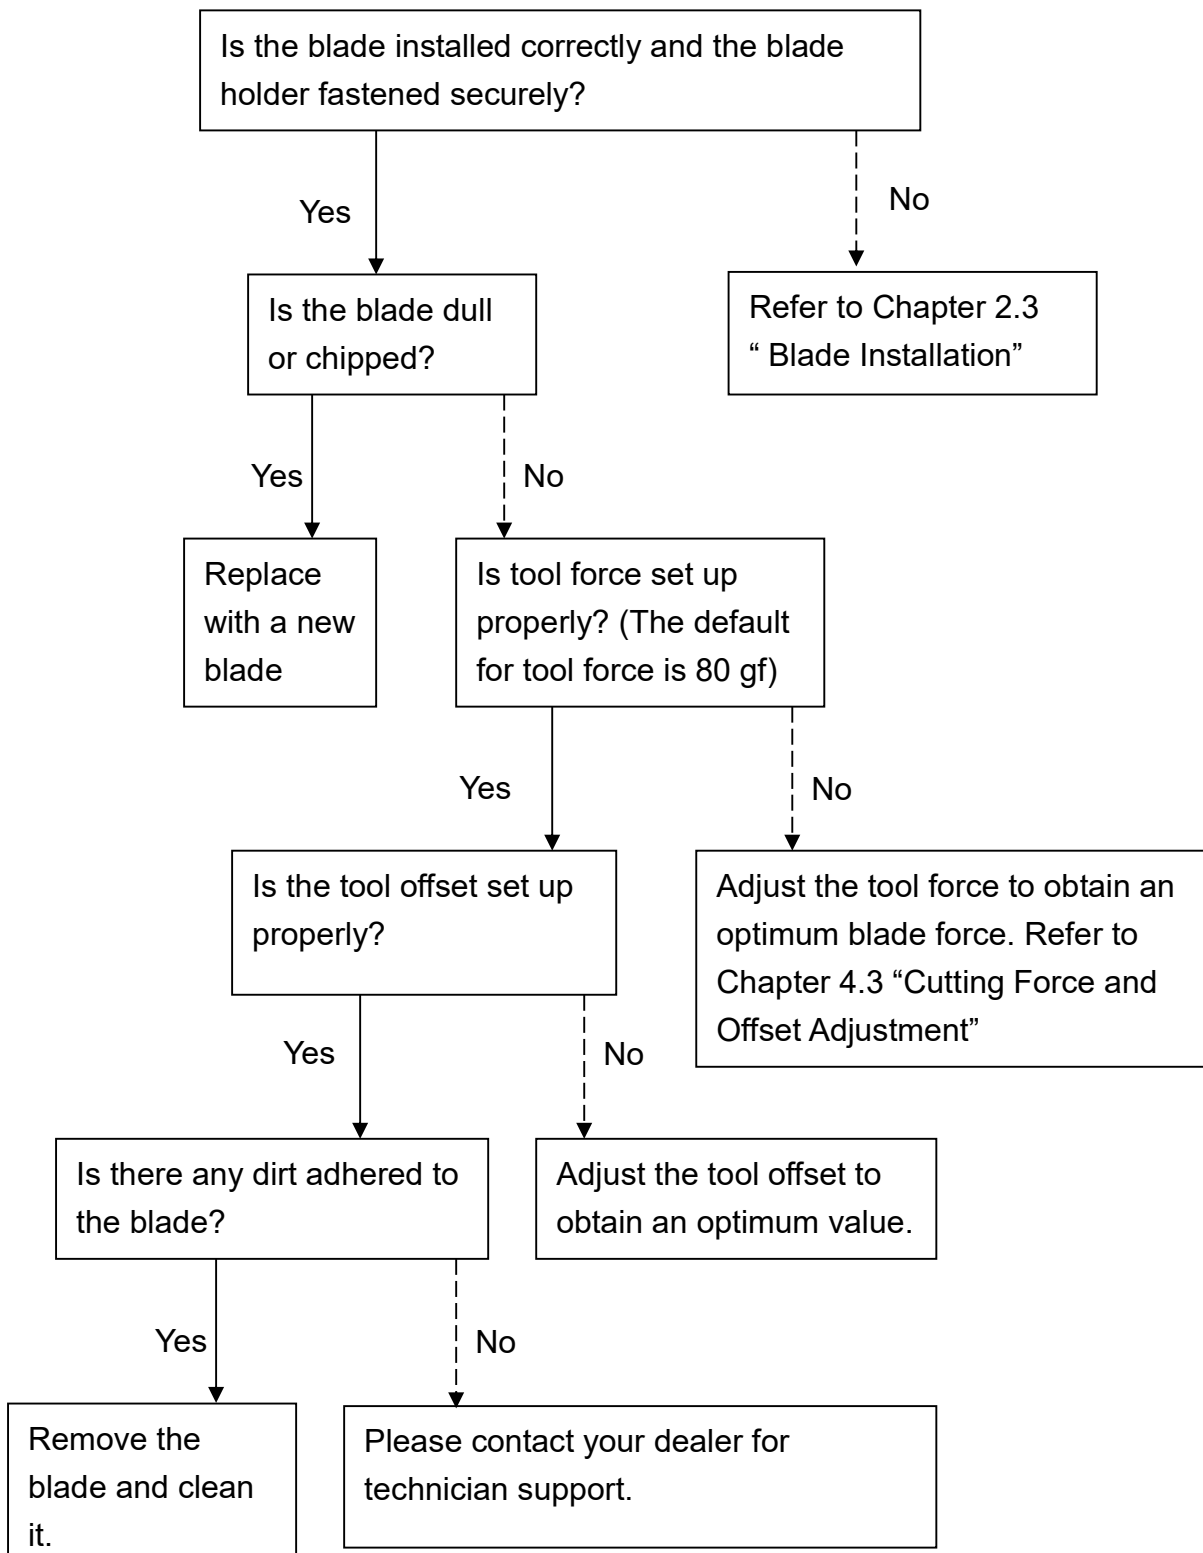






Expert II A Series Specification

Model Number	EX II-24	EX II-24LX	EX II-52	EX II-52LX
Max. Cutting Width	600 mm (23.6 in.)		1320 mm (51.96 in)	
Max. Media Width	719 mm (28.3 in.)		1470 mm (57.87 in.)	
Material Thickness	0.8 mm			
Max. Cutting Force	350 g			
Max. Cutting Speed	705 mm/sec (27.8 ips) (at 45 degree direction)		635 mm/sec (25 ips) (at 45 degree direction)	
Mechanical Resolution	0.009 mm (0.00035 in.)		0.012 mm (0.00049 in.)	
Software Resolution	0.025 mm (0.00098 in.)			
Distance Accuracy	±0.254 mm or ±0.1% of move, whichever is greater			
Repeatability	±0.1mm			
Tracking	3M			
Memory Buffer	32 MB			
Interfaces	USB 2.0 (Full Speed) & RS-232			
Type of Command	HPGL, HPGL/2			
Configurable Origin	Yes			
Control Panel	6 LEDs, 10 Keys / 5LEDs, 10 Keys			
Diameter of Blade	2.5 mm			
Dimension	(H*W*D) mm	233*880*255		1065*1632*620
	(H*W*D) in	9.1*34.6*10		41.93*62.25*24.41
Net Weight	11KG (24.3lb)		53KG (116.4lb)	
Stand	Optional		Standard	
Automatic-Aligning System (AAS II)	Available on Expert II LX models			
Power Supply	100-240 VAC, 50 /60 Hz (auto switching)			
Power Consumption	Max. 288 W			
Operation Environment	Temperature	15°C~30°C / 60°F~86°F		
	Humidity	25% ~ 75%		

- Compatible with Windows 7 and above & MAC OS X 10.6 and above. (*Purchasing serial number for "Sure Cuts A Lot" software to work with Mac OS.)
- The specification and data sheet may vary with different materials used. In order to obtain the best output quality, please maintain the machine regularly and properly.
- GCC reserves the right to change the specifications at any time without notice
- GCC certified material in tracking is Avery MPI 3000.
- The above listed specification values are effective only when operated with media certified by GCC.


Blade Specification

202003480G	For cutting thick fluorescent and reflective vinyl. Also for cutting detailed work in standard vinyl.
	The blade is 45° with Red Cap (5-unit package), 0.25 mm offset, and 2.5 mm blade diameter.
	
290088080G	For cutting reflective vinyl, cardboard, sandblast, flock, and stencil sharp edge.
	The blade is 60° with Green Cap (2-unit package), 0.50 mm blade offset, and 2.5 mm blade diameter.
	
265017550G	For cutting thin sandblast mask and stencil. The blade with sharp angle and special design, allowing it to maneuver around sharp corners.
	The blade is 60° with Blue Cap , 0.25 mm blade offset, and 2.5 mm blade diameter.
	
265017560G	For Cutting small text and fine detail. Sharp blade with smallest offset.
	The blade is 50° with Black Cap , 0.175 mm blade offset, and 2.5 mm blade diameter.
	
265017530G	For thin and delicate media such as window tint.
	The blade is 25° with Yellow Cap , 0.25 mm blade offset, and 2.5 mm blade diameter.
	


About the Tool

A generic term referring to the blade that cuts the sheet, the pen that does plotting, and the LED bombsight (option) used for pointing to the reference point.

OFFSET is the distance that the blade tip is displaced from the centerline of the blade.

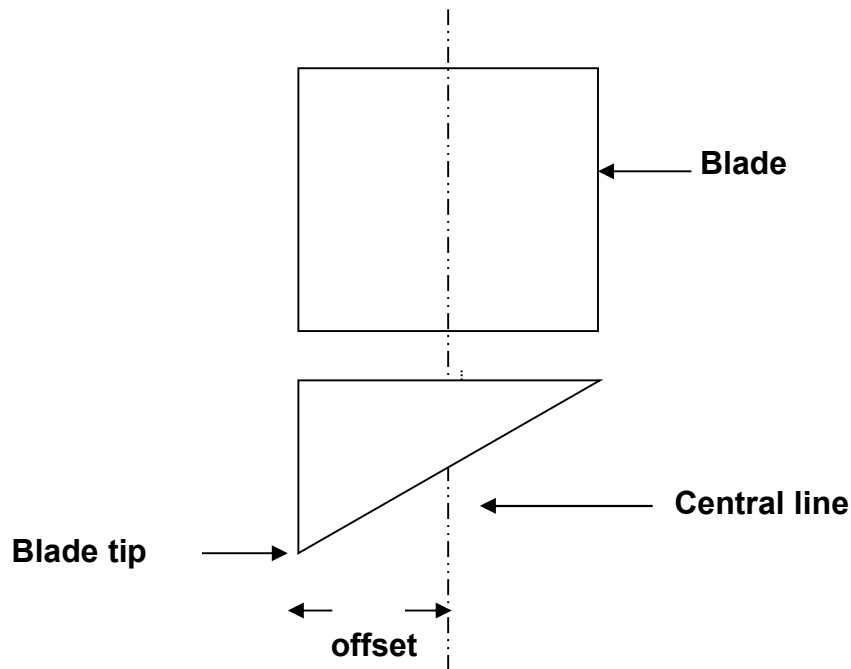

Protrusion Length of the Blade

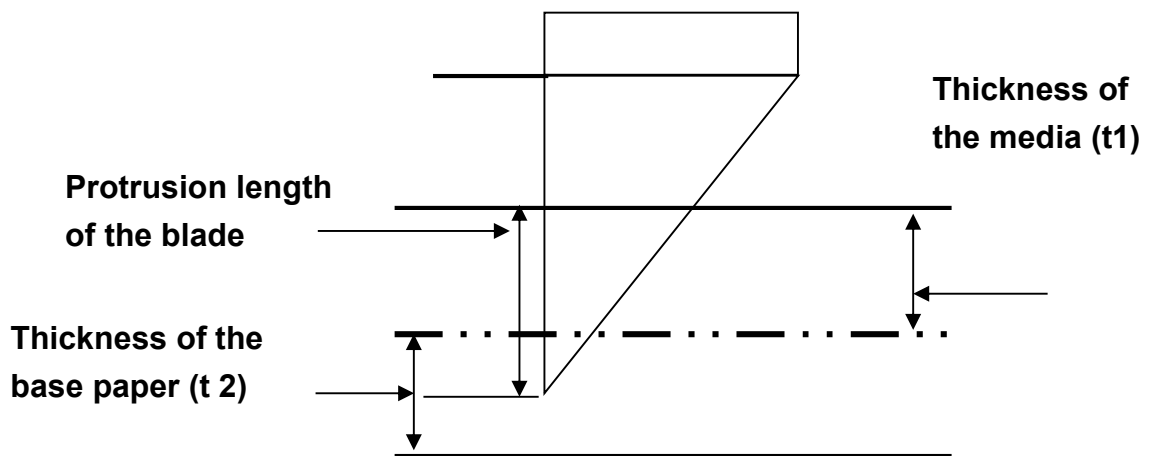


Length of protrusion = $t_1 + t_2 / 2$, but for your convenience you may just make it about 0.3mm ~ 0.5mm beyond the blade holder tip.

CoreIDRAW Output Instruction


The following is an example of how to output the file with CoreIDRAW.

User Instructions


1. Open CoreIDRAW, finish editing all the files you wish to plot and select all the images at once.
2. Select “Outline Pen” to adjust the outline for cutting.

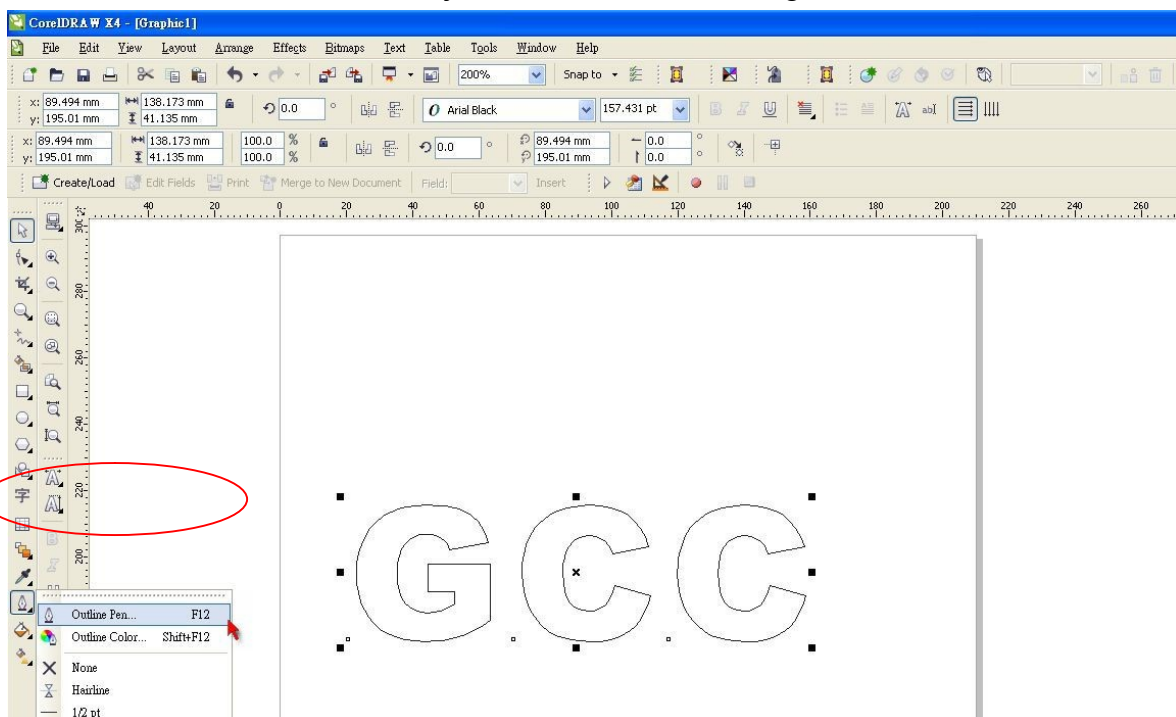


3. Adjust the value of pen width to 0.001 mm and click “OK” to save your input.

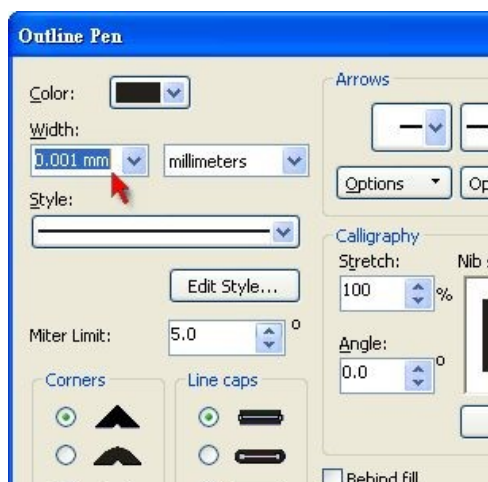


4. Select “ File → Print” to output the file to your cutters.

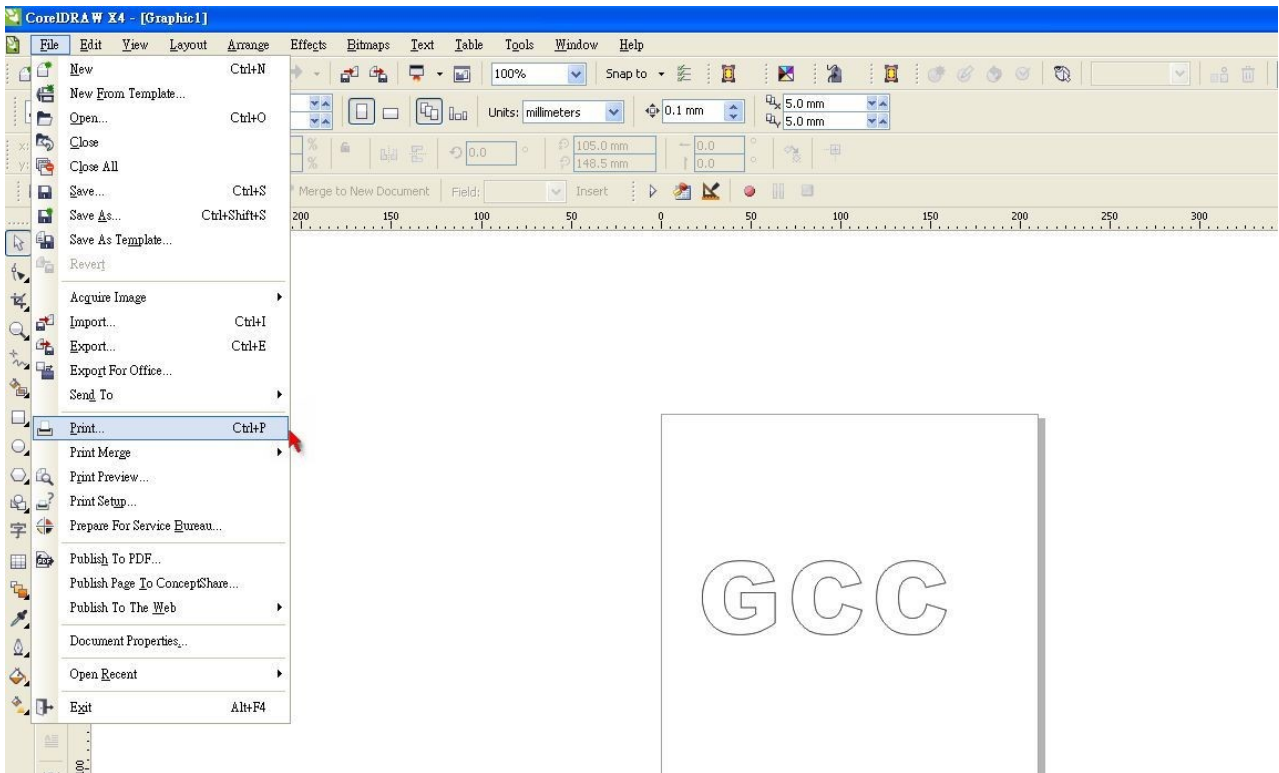


5. Choose the correct model you have installed.

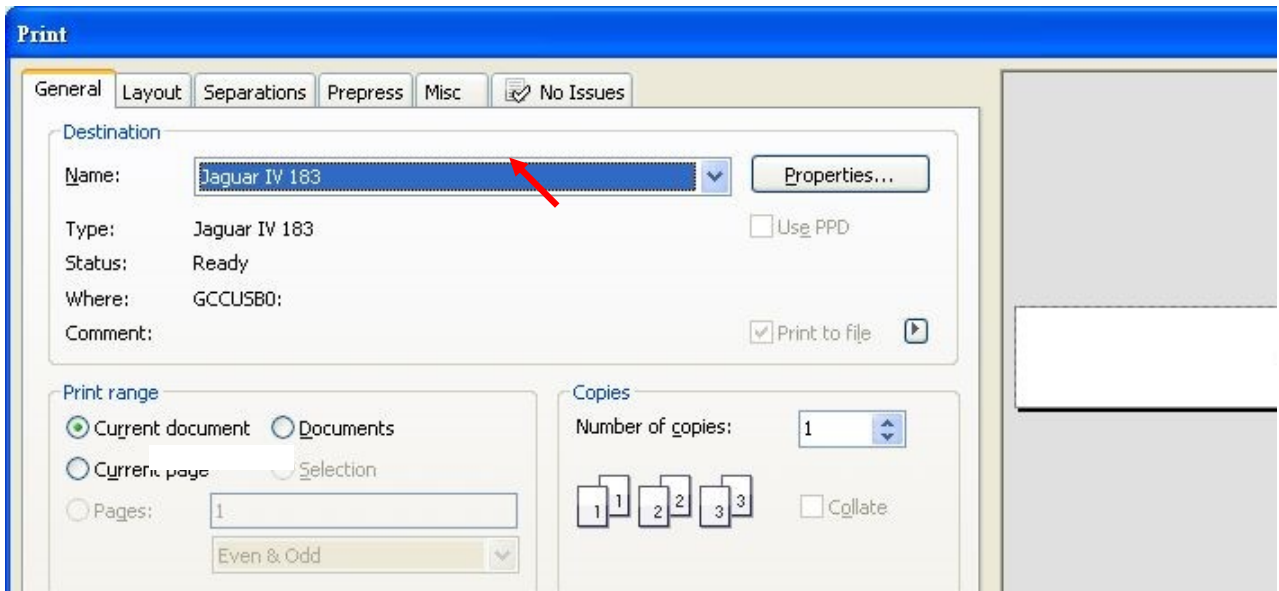

6. Choose the “Layout page” and click the “Reposition images to: → Bottom left corner”.
Please note that you must put your image at the bottom left corner.

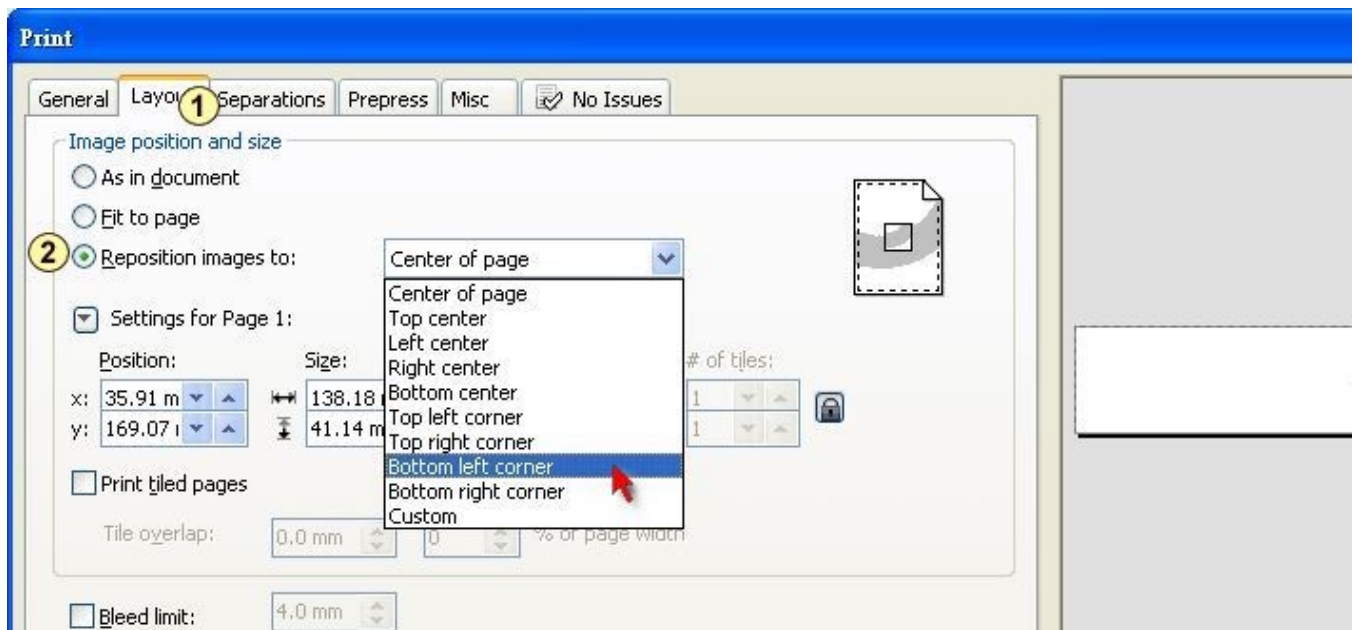

7. Go back to the General page and check that your image is at the bottom left corner. Click “Print” and get a wonderful cutting image.

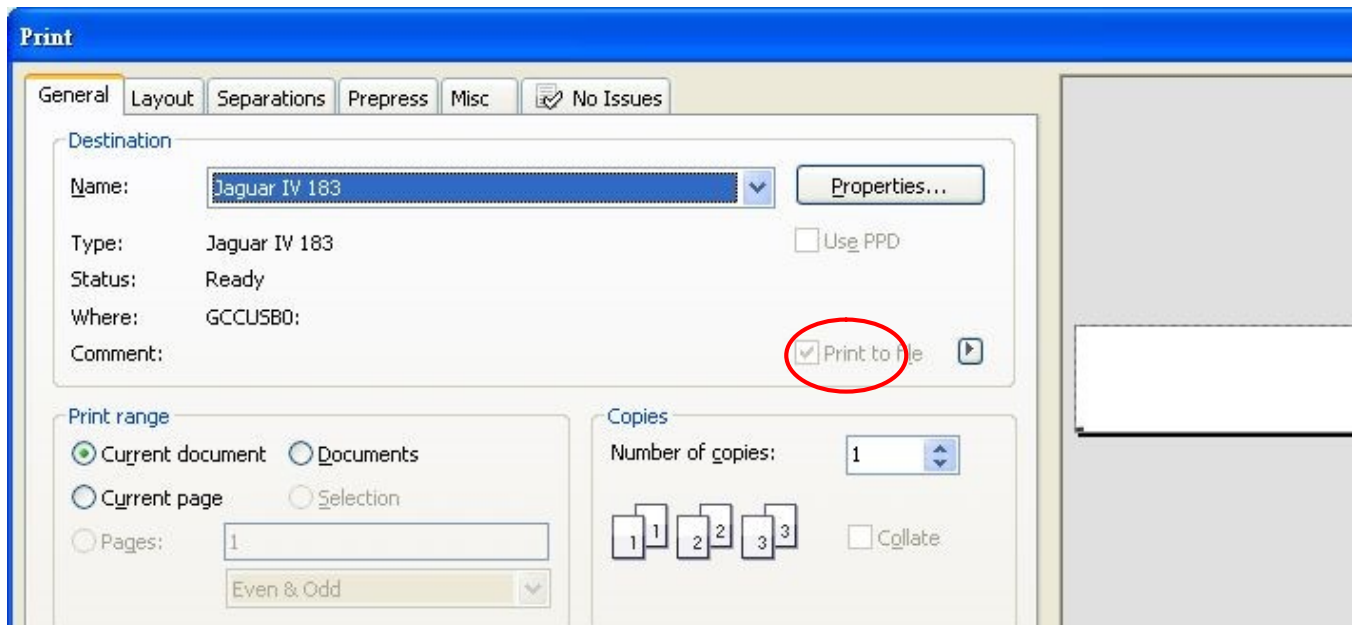

CoreIDRAW Plug-In Instruction

AASII VBA Installer is applicable for CoreIDRAW Version 13, 14, 15, 16, 17, 18


Installation

Please refer to Step 8 in Chapter 2.7.1.2 Driver Installation to install AAS plug-in for CoreIDRAW.


Run CoreIDRAW AAS Plug-in

Step 1 Run CoreIDRAW to edit your graphics and select all images at once when you wish to plot.

Step 2 Select “Tools→Macros→Run Macro.” Then select **Global Macros (GCCAASII_Draw13.gms)** under the “Macros in” manual, and press “Run”.

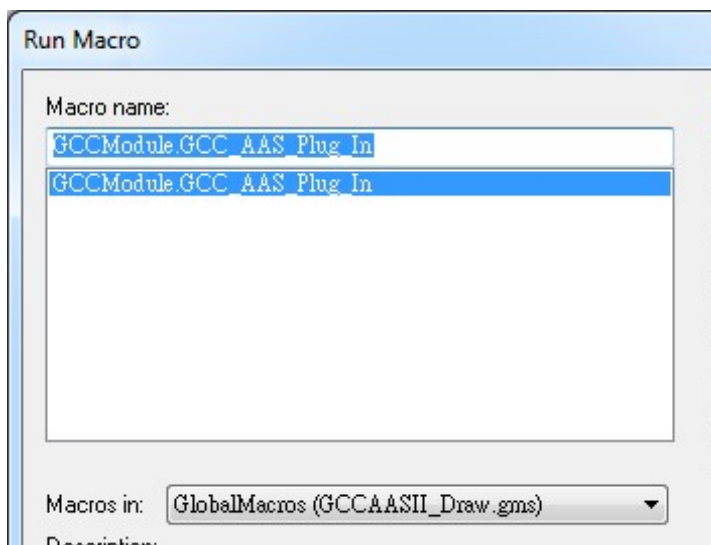

Step 3 Click on “Apply” and select whether you would like to add the registration marks by page size or by object.

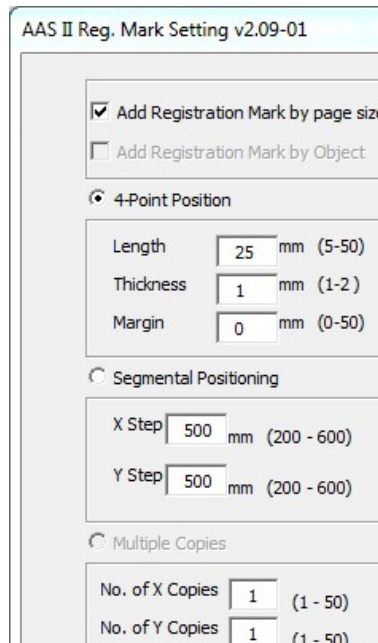


Step 4 Now you can print out the image file with registration marks.

Note: “Add Registration Mark by Object” will be the default selection if you click on the image whereas “Add Registration Mark by page size” will be the default one when the blank area on the page is clicked.

You can also add a Hot Icon for the AAS Plug-in

Select “Tools→ Options→ Workspace→ Customization→ Commands→ Macros→ GCCMadual.GCC_AAS_Plug_In” and Click OK.

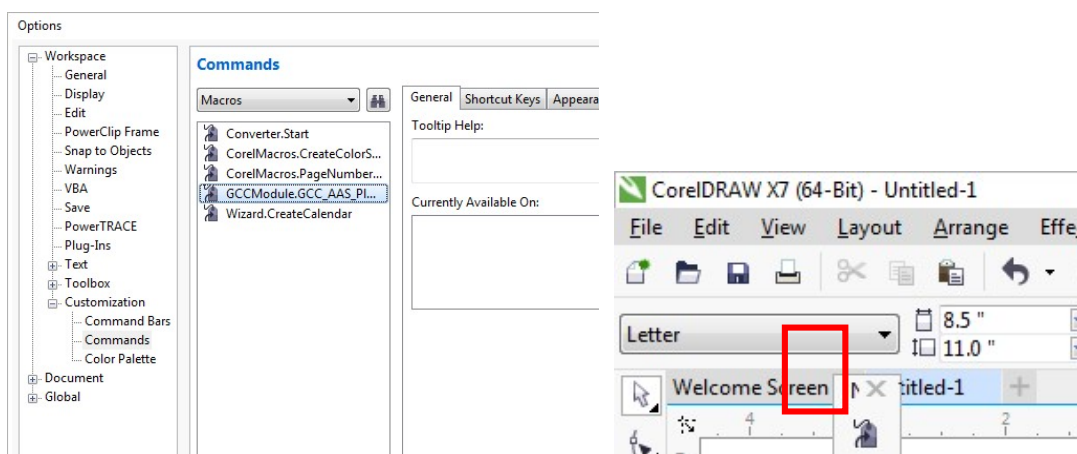

Add Registration Mark by page size

If you tick “Add Registration Mark by page size” as shown in the figure below and click “Apply”, your registration marks will be created automatically (please see Figure A3-1).

Note:

1. The length setting will be in the range of 5-25mm according to your page size.
2. Please **DO NOT** make any changes to the “Origin” section when you choose to add registration marks by page size as indicated below otherwise the position of the marks will be changed (please see Figure A3-2).

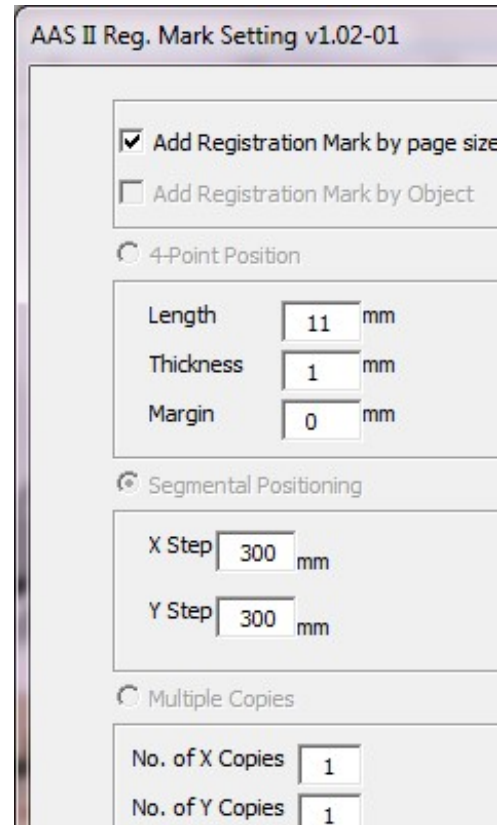


Figure A3-1

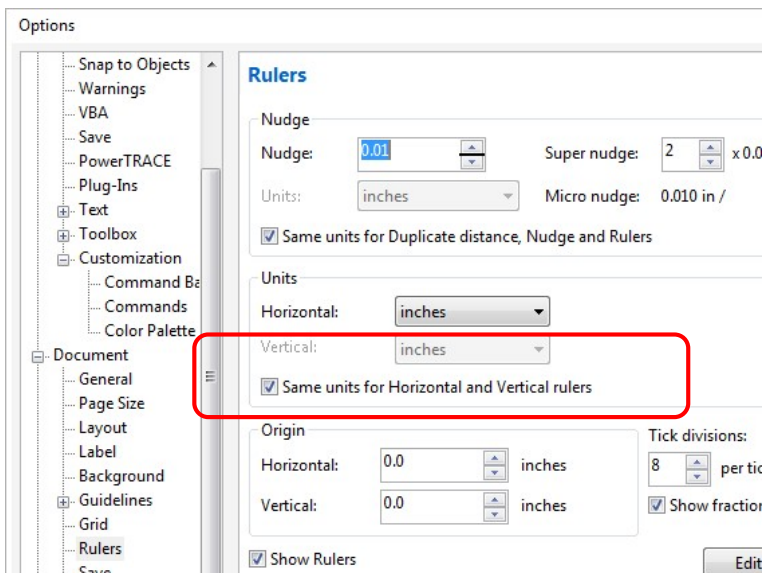


Figure A3-2

The system will create the 4 marks on the 4 corners of the page as shown in the picture below wherever you move your image.

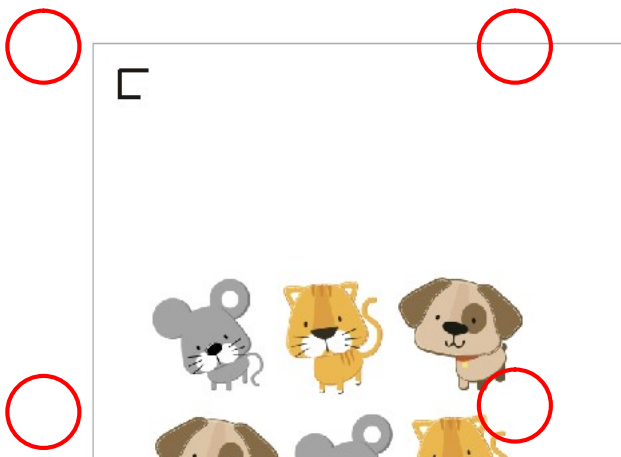



Figure A3-3

Workable area

It allows users to edit and cut graphics in the area outside the registration marks when adding registration marks by page.

For A4 size media sheet, the workable area is 2.5mm extended from the registration mark on left and right sides and 4.5mm extended from the registration mark on top side. On the bottom side, it is suggested to leave at least 25mm margin from the edge of media sheet to prevent sheets dropping or any error occurred while media sizing.

For A3 size media sheet, the workable area is 10mm extended from the registration mark on the left side, 9mm extended from the registration mark on the right side and 11mm extended from the registration mark on top side. On the bottom side, it is suggested to leave at least 25mm margin from the edge of media sheet to prevent sheets dropping or any error occurred while media sizing.

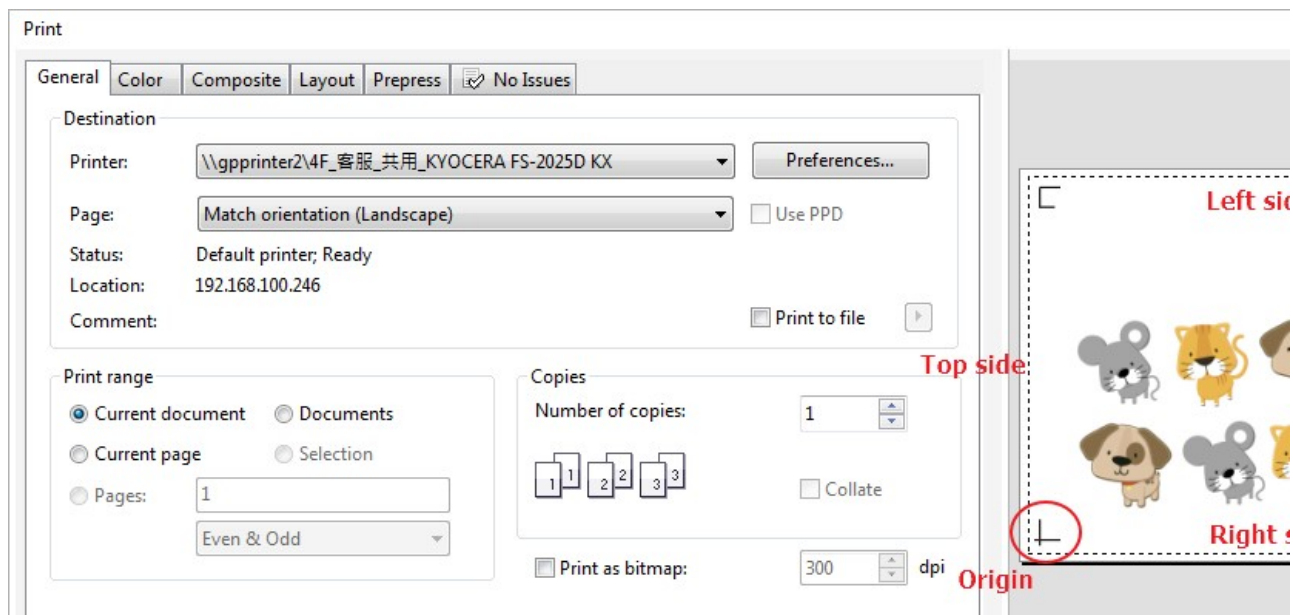

Note: Select “**Edge**” mode when media sizing to allow the media sheet to be unrolled. If you select “**Single**” mode, the media sheet will not be able to be moved back and hence fail to be detected by front paper sensor.

Add Registration Mark by Object

If you tick “Add Registration Mark by Object”, you will be offered three options of registration marks as shown below.

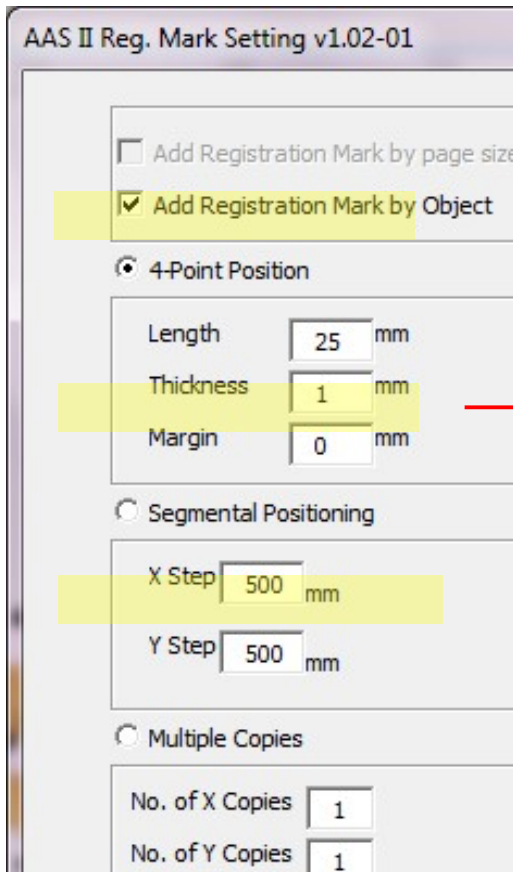


Figure A3-4

4-Point Positioning

- Length: The length of marks
→ Range: 5mm~50mm
→ Optimized Setting: 25mm
- Thickness: The line thickness of marks
→ Range: 1mm~2mm
→ Optimized Setting: 1mm
- Margin: The distance between marks and images
→ Range: 0mm~50mm
→ Optimized Setting: 5mm

Segmental Positioning


- X Step: The distance of intermediate position on the X axis
- Y Step: The distance of intermediate position on the Y axis
→ Range: 200mm~600mm
→ Optimized Setting: Less than 500mm

Multiple Copies

- No. of X Copies: The numbers of copies on X axis
- No. of Y Copies: The numbers of copies on Y axis
→ Range: 1~50. (The more copies you make, the more time is needed for data transmission.)
→ Numbers of X Copies * Numbers of Y Copies = The total amount of image copies
- Copies with outline: To show outlines of image graphics

Note: The values entered in the “4-Point Positioning” section (length, thickness and margin) will still be applied when you tick “Segmental Positioning” or “Multiple Copies”.

4-Point Positioning

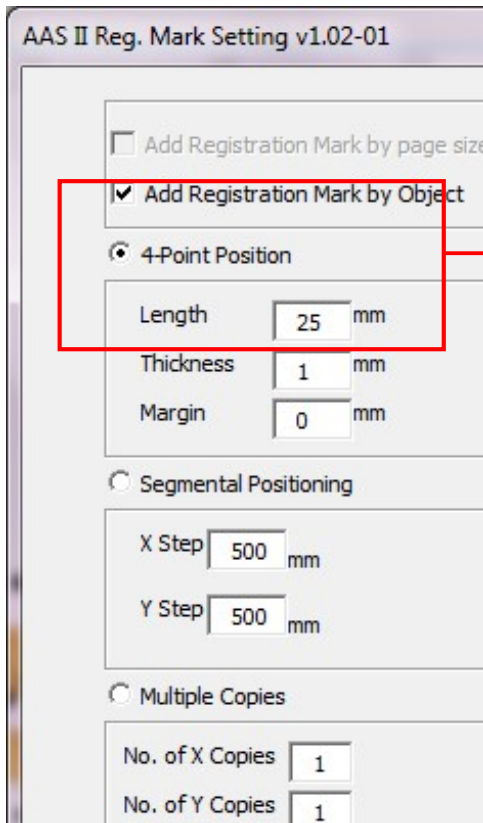

4-Point Positioning

- Length: The length of marks
→ Range: 5mm~50mm
→ Optimized Setting: 25mm
- Thickness: The line thickness of marks
→ Range: 1mm~2mm
→ Optimized Setting: 1mm
- Margin: The distance between marks and images
→ Range: 0mm~50mm
→ Optimized Setting: 5mm

Figure A3-5

The system will create the 4 marks as shown in the picture below.

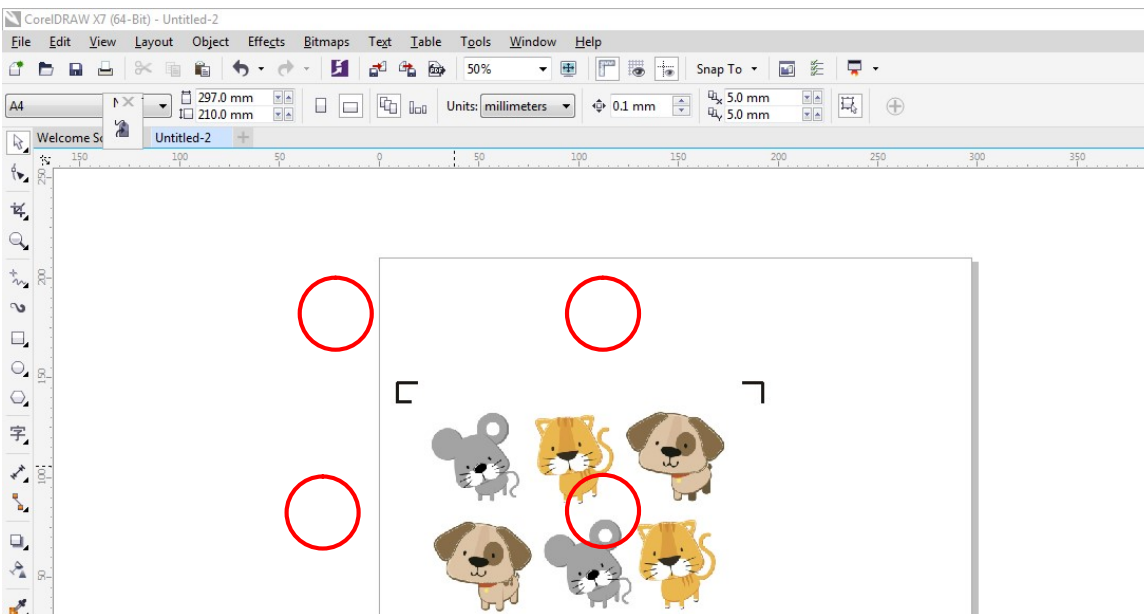
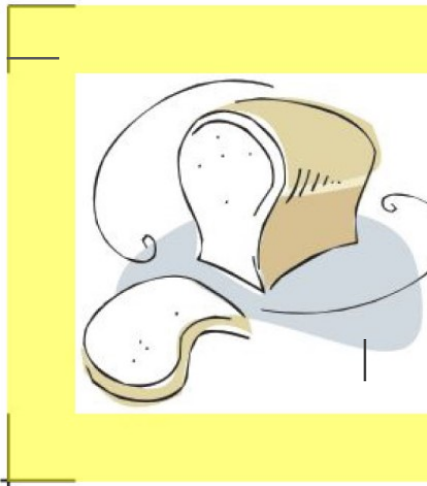
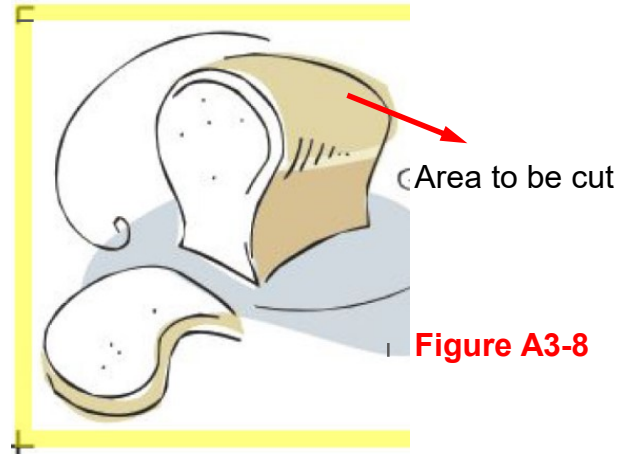


Figure A3-6

Note:

1. To save your materials, in addition to amending object margins, you can also adjust the length of the registration marks (5mm minimum) when you apply 4-Point Positioning (see table 1 for suggestions based on different material sizes). The smaller the size is, the smaller the distance between the object and the registration marks is (see the figures below).

**Figure A3-7****Figure A3-8**

Page size (unit: mm)	Suggested mark length (unit: mm)
A6 (105 x 148)	5
A5 (148 x 210)	8
A4 (210 x 297)	11
A3 (297 x 420)	16
A2 (420 x 594)	23
A1 (594 x 841) and above	25*


Table 1

*25mm is the suggested value for the registration mark length

2. The size of the registration marks would affect the accuracy of registration mark detection so please make sure the amount you enter is reasonable.
3. If you change the paper size, you will have to reset the registration marks otherwise the previous setting will be applied.

Segmental Positioning

For precise cutting quality, it is suggested to select “Segmental Positioning” when you are working on an extra long or large-sized image to increase cutting accuracy.

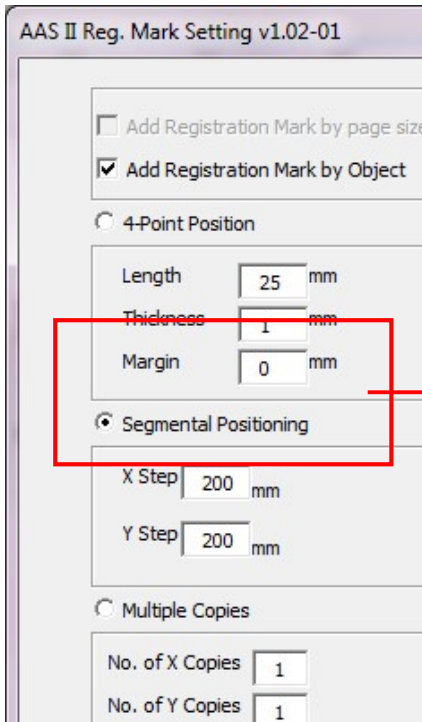

Segmental Positioning

- X Step: The distance of intermediate position on the X axis
- Y Step: The distance of intermediate position on the Y axis
- Range: 200mm~600mm
- Optimized Setting: Less than 500mm

Figure A3-9

The system will create the as shown in the picture below


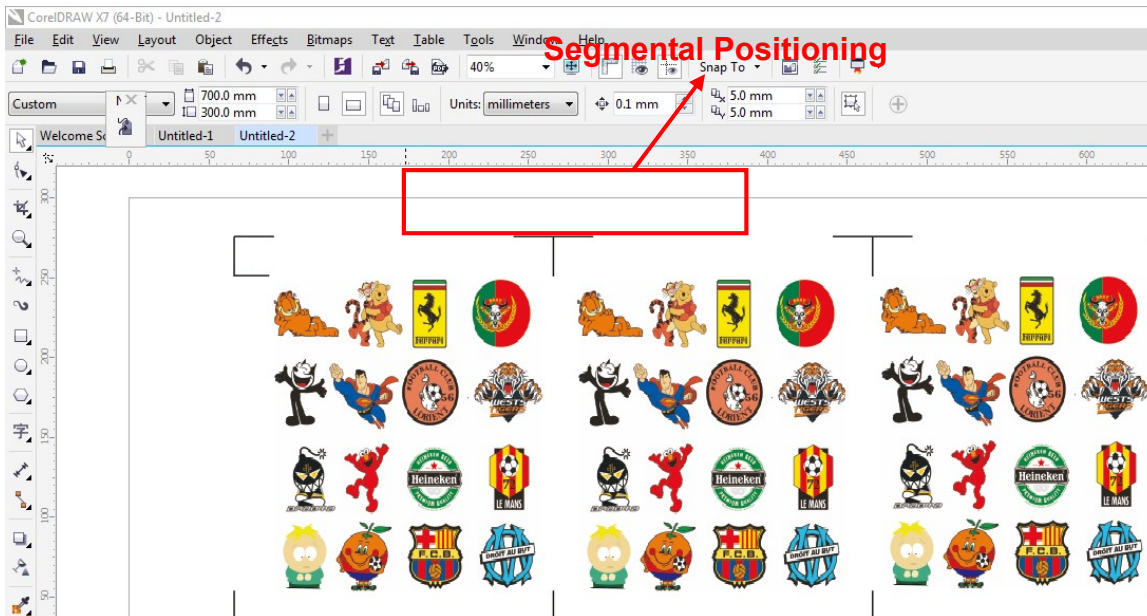


Figure A3-10

Segmental Positioning will be applied to Multiple Copies when the object to be copied is of large size (with the length or width over 200mm) to increase the accuracy of registration mark detection.

Multiple Copies

It is suggested to select “Multiple Copies” when you would like to make several copies of one image on your material to increase cutting accuracy.

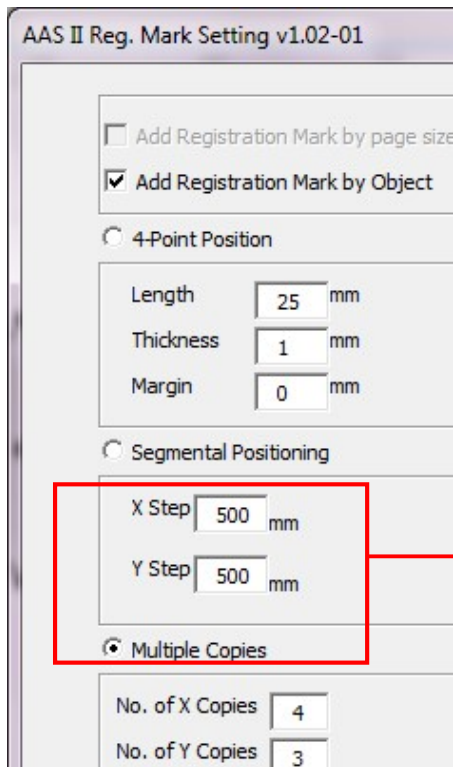

Multiple Copies

- No. of X Copies: The numbers of copies on X axis
- No. of Y Copies: The numbers of copies on Y axis
→ Range: 1~50. (The more copies you make, the more time is needed for data transmission.)
→ Numbers of X Copies * Numbers of Y Copies = The total amount of image copies
- Copies with outline : To show outlines of image graphics

Figure A3-11

The system will create the as shown in the picture below.

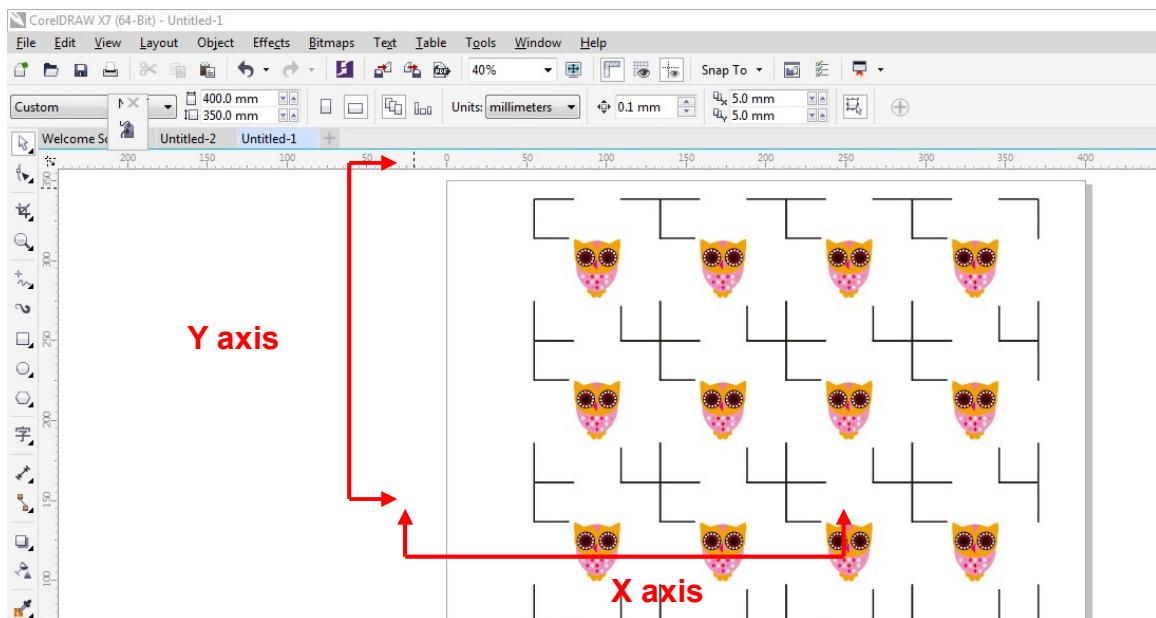


Figure A3-12

Contour cutting through CorelDraw

Step 1 Position the paper with registration marks printed by your printer on the GCC cutter.

Step 2 Select “Files→Print”.

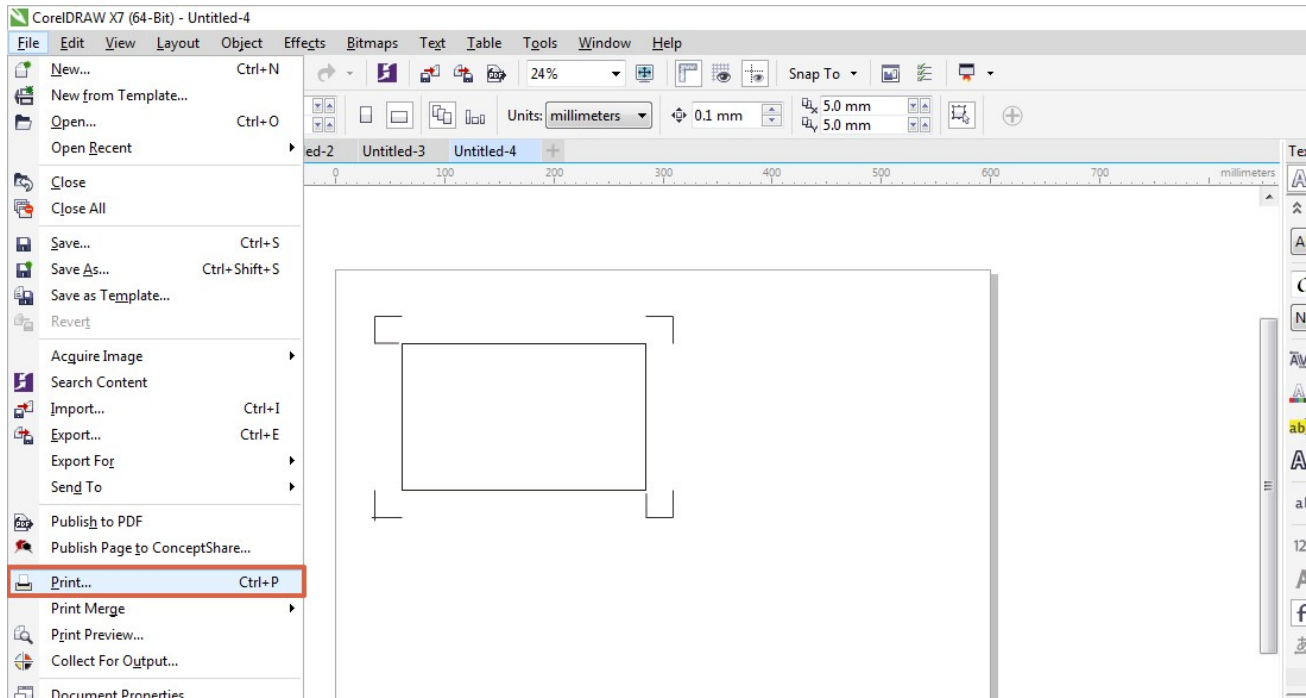


Figure A3-13

Note: if you use CorelDraw X5 and later, you must follow the steps below.

Step 1 Click the “color” page and go to the “Color conversions performed by:” and then select the model name of you cutter (please refer to Figure A3-14).

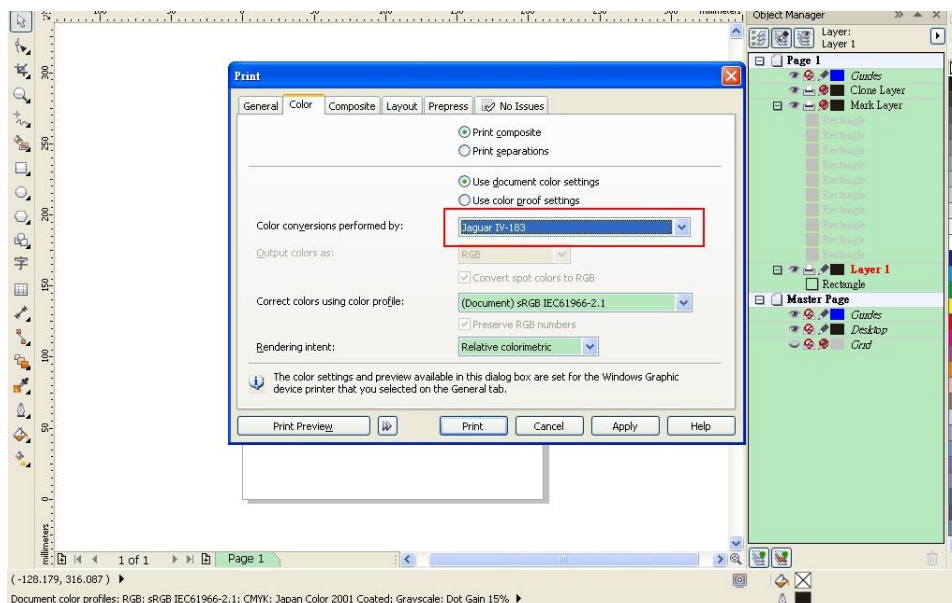


Figure A3-14

Step 2 Go to the “Layout” page and select Bottom left corner at “Reposition images to”.

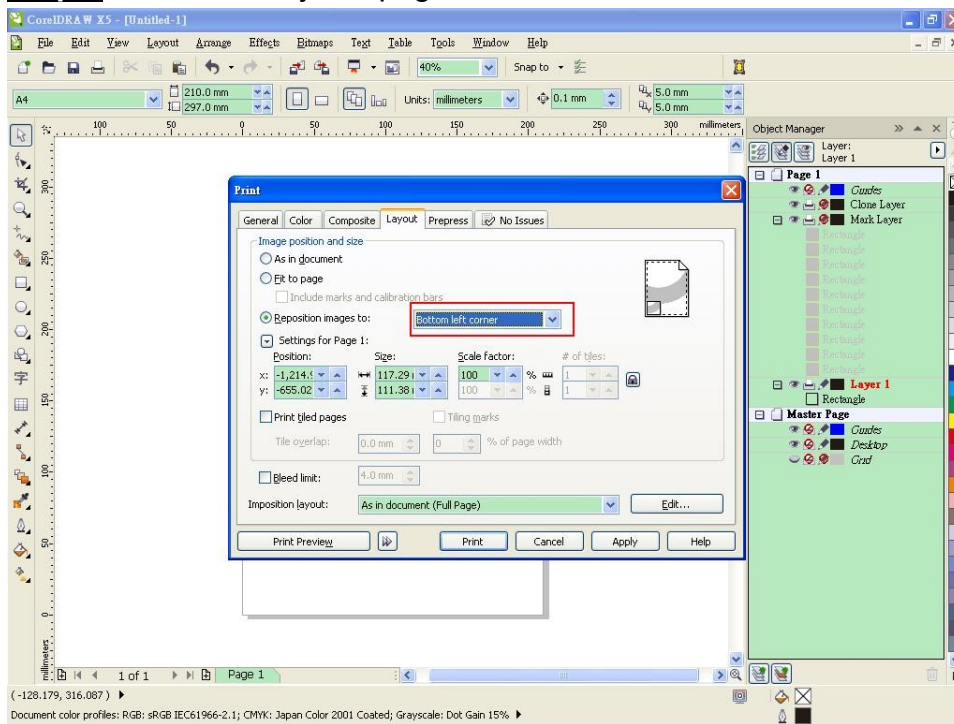


Figure A3-15

Step 3 Click “Print”.

Illustrator Plug-In Instruction


AASII VBA Installer is applicable for Adobe Illustrator Version CS4, CS5, CS6, CC.

Installation


Please refer to Step 8 in Chapter 2.7.1.2 Driver Installation to install AAS plug-in for Adobe Illustrator.

Printer Setting

Step 1 Go to Control Panel, right click on the printer and select Printer Properties to open the Printer Properties page

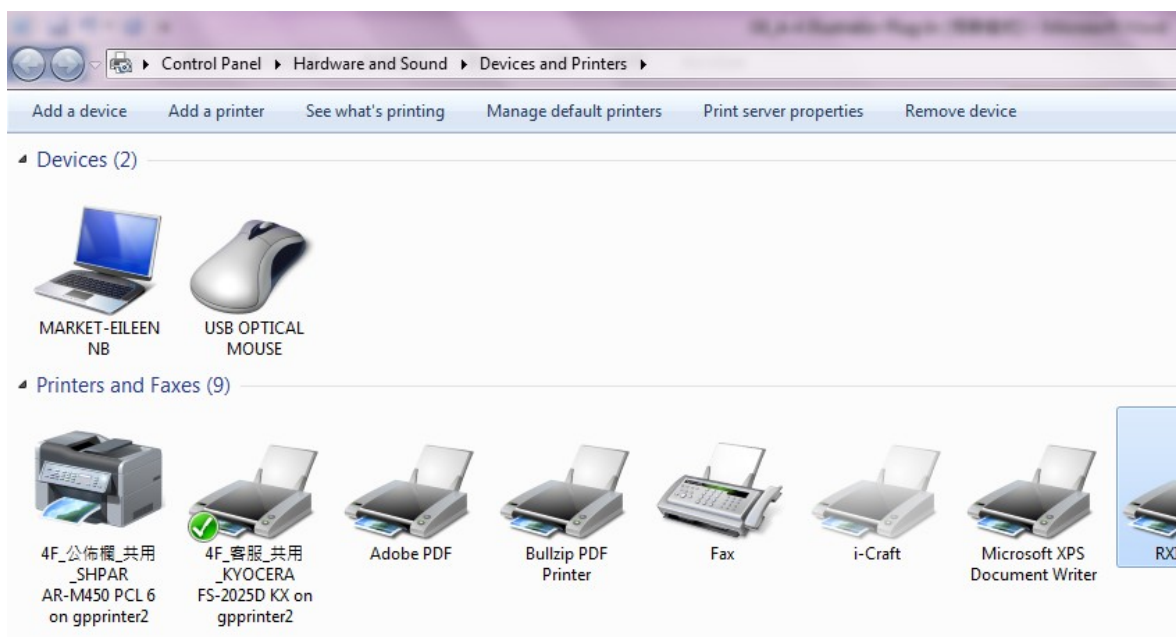


Step 2 Go to the Advanced page and make sure the “Enable advanced printing features” box is unchecked.

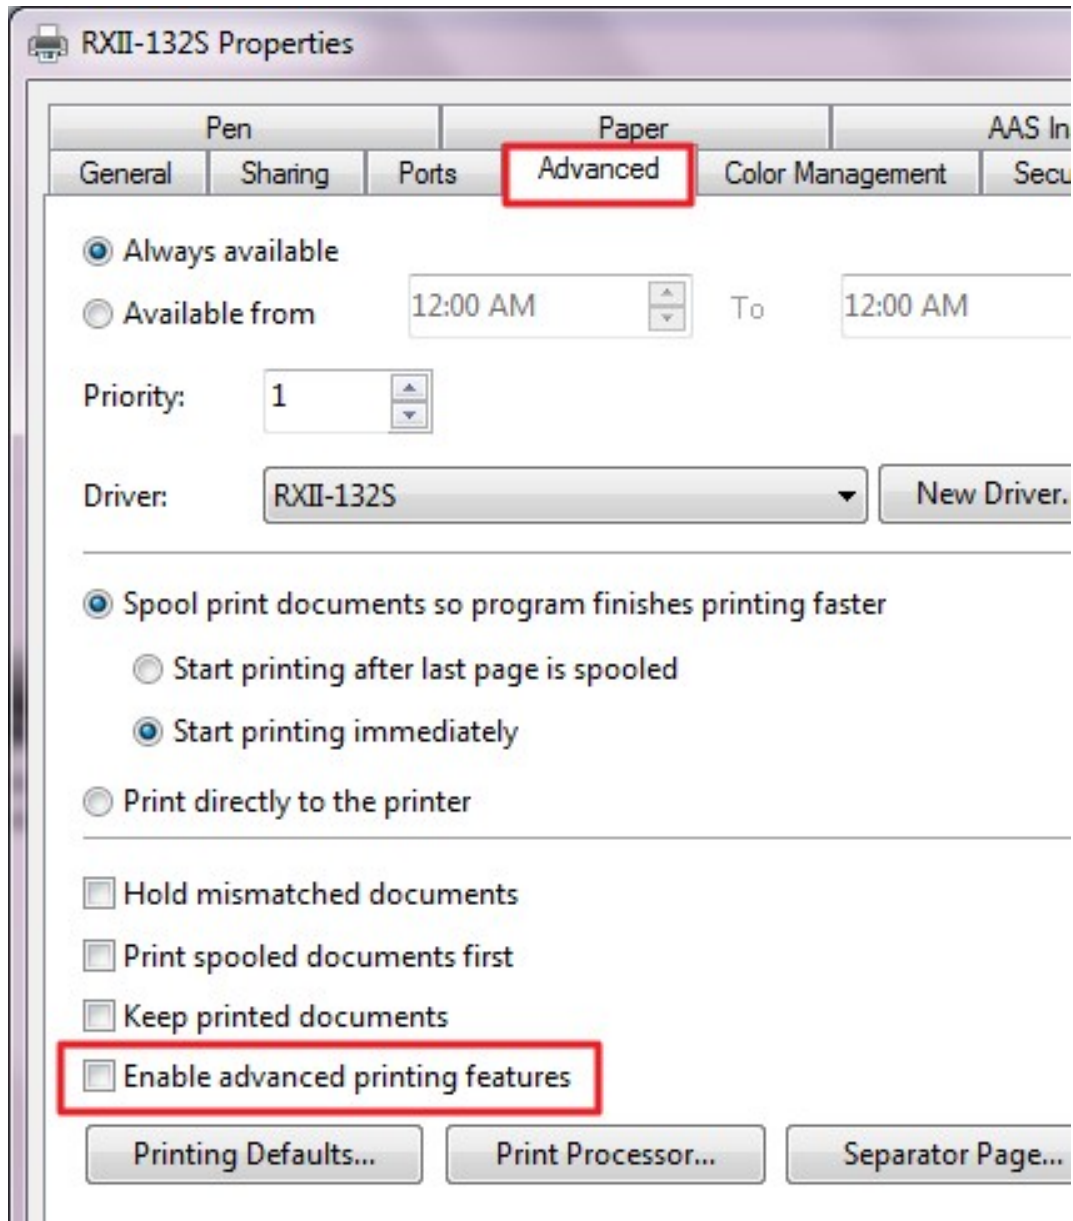


User Instructions

Step 1 Open Illustrator.


Step 2 Edit your image and create a contour line (**Note:** you must have the line width set as 0.001mm).

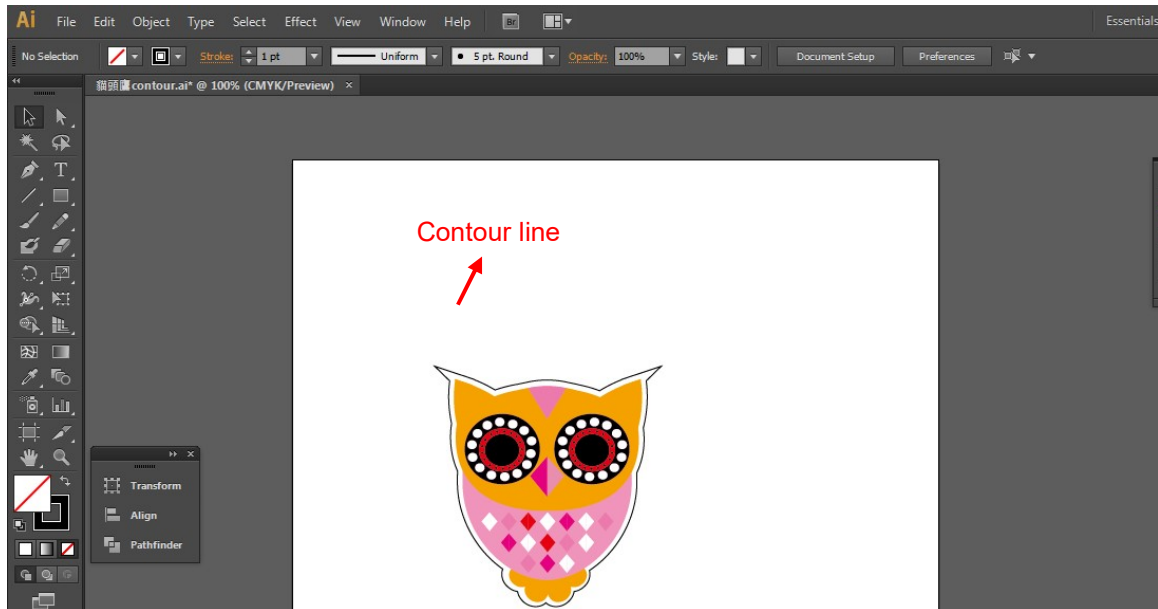


Step 3 Click on the image and apply the AAS function (File→Scripts→_AASII_Plug_In).

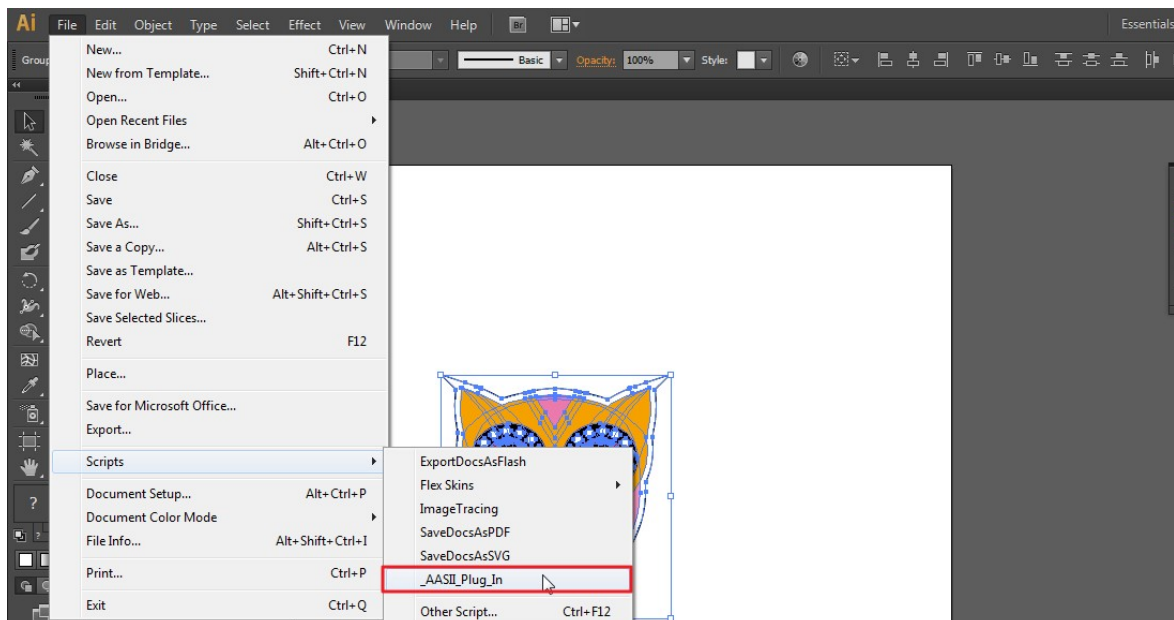

Step 4 Select the registration marks needed

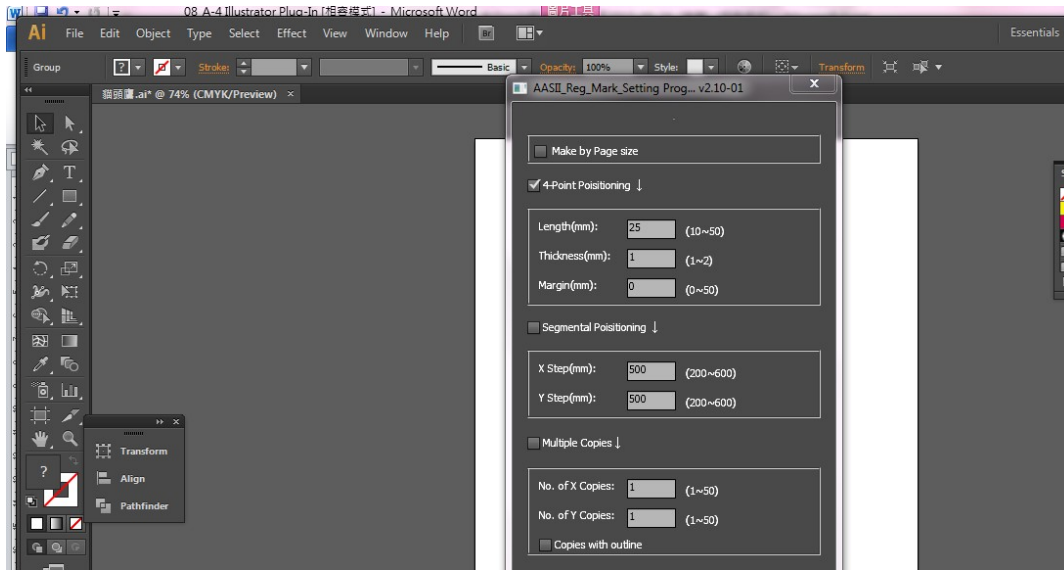


Step 5 Three types of registration marks are introduced here: 4-Point Positioning, Segmental Positioning and Multiple Copies.

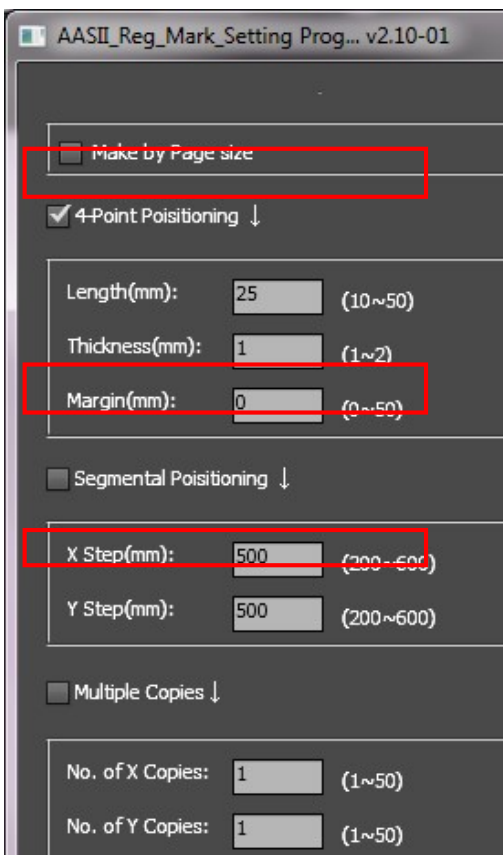


Note:



The values entered in the “4-Point Positioning” section (length, thickness and margin) will still be applied when you tick “Segmental Positioning” or “Multiple Copies.”

Step 6 Confirm the registration marks (the 4-Point Position mark is used as an illustration in the following steps).

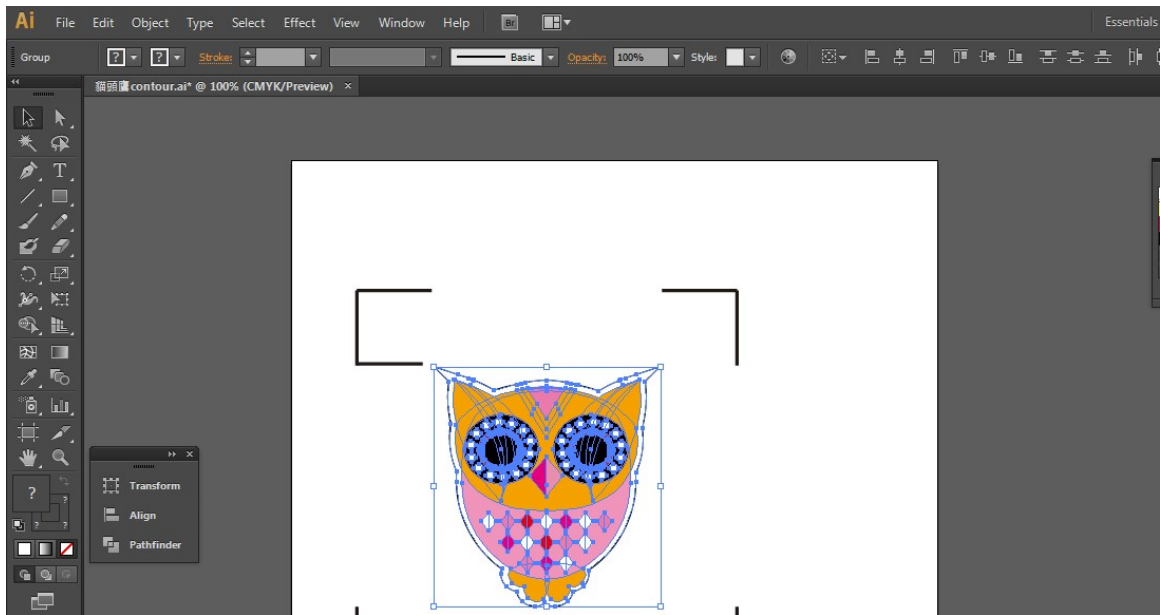


Step 7 Click on the blank area on the page and then click “Document Setup”.

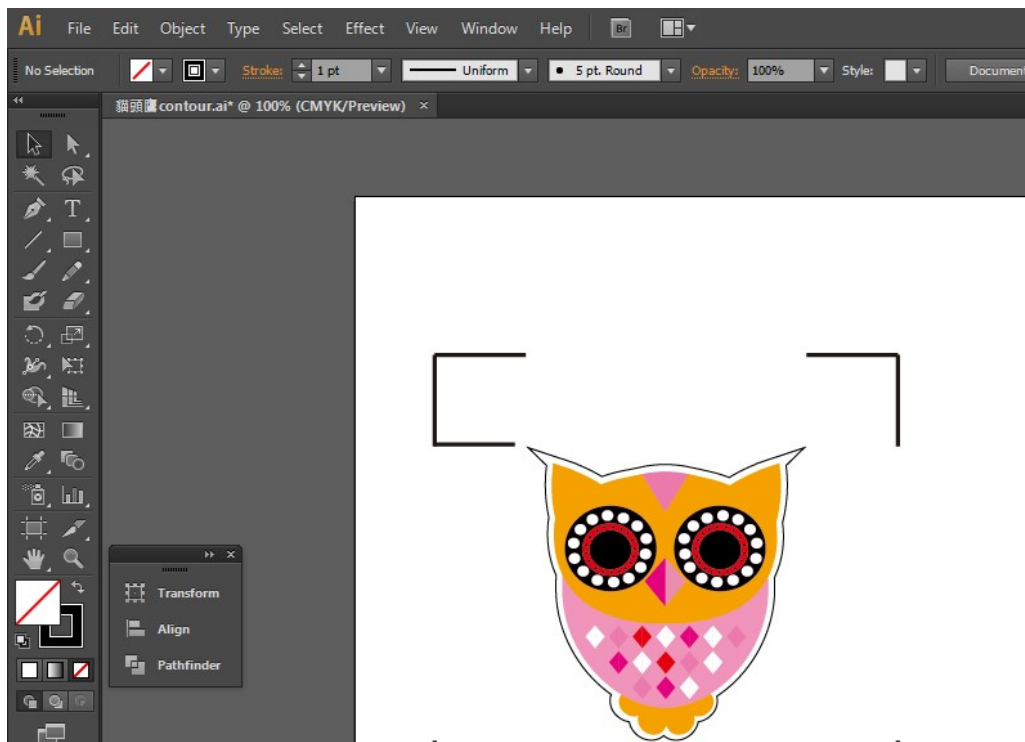


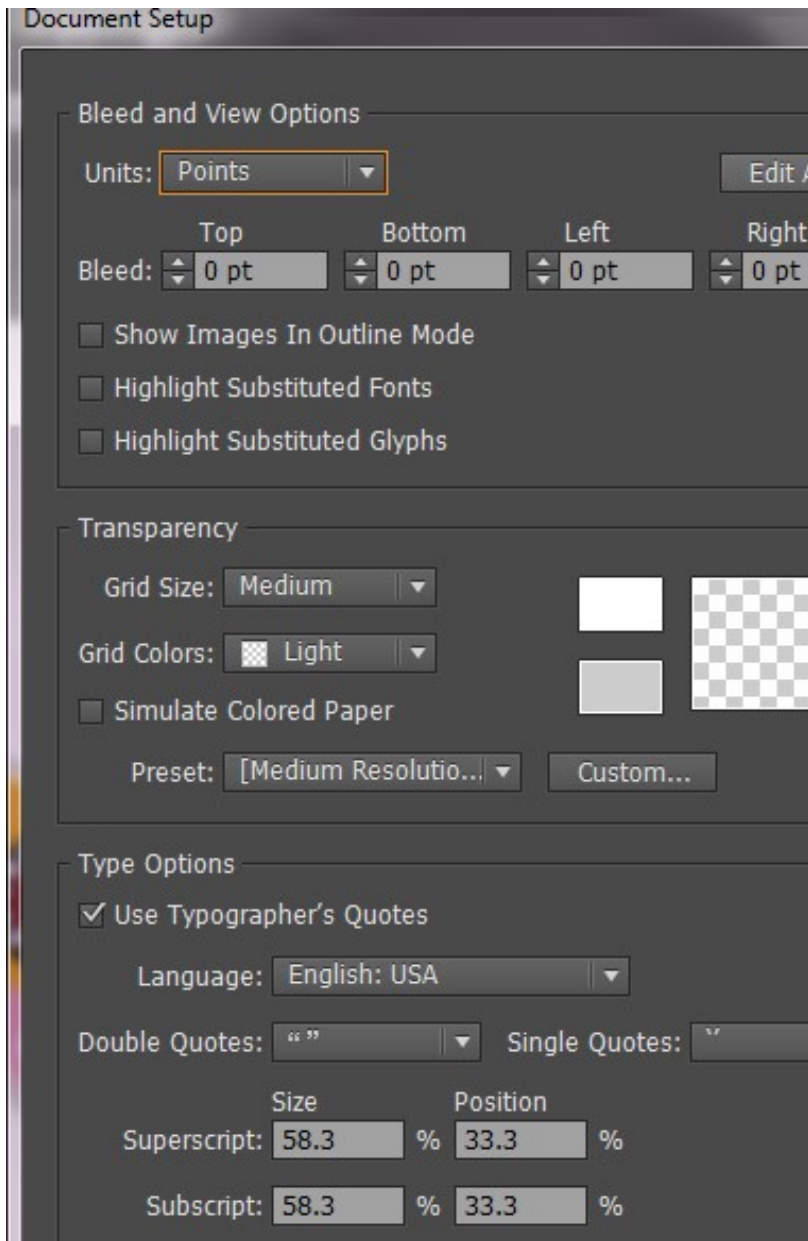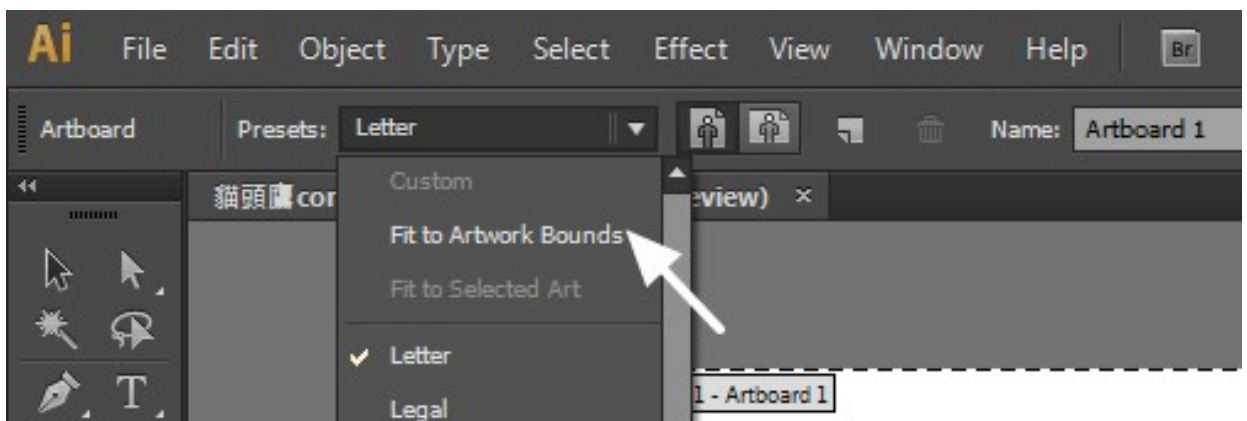Step 8 Hit “Edit Artboards”.**Step 9** Click on “Presets → Fit Artboard to Artwork bounds”.


Step 10 Please move your mouse to the tool bar on the left when step 9 is finished and then click “Selection Tool”.

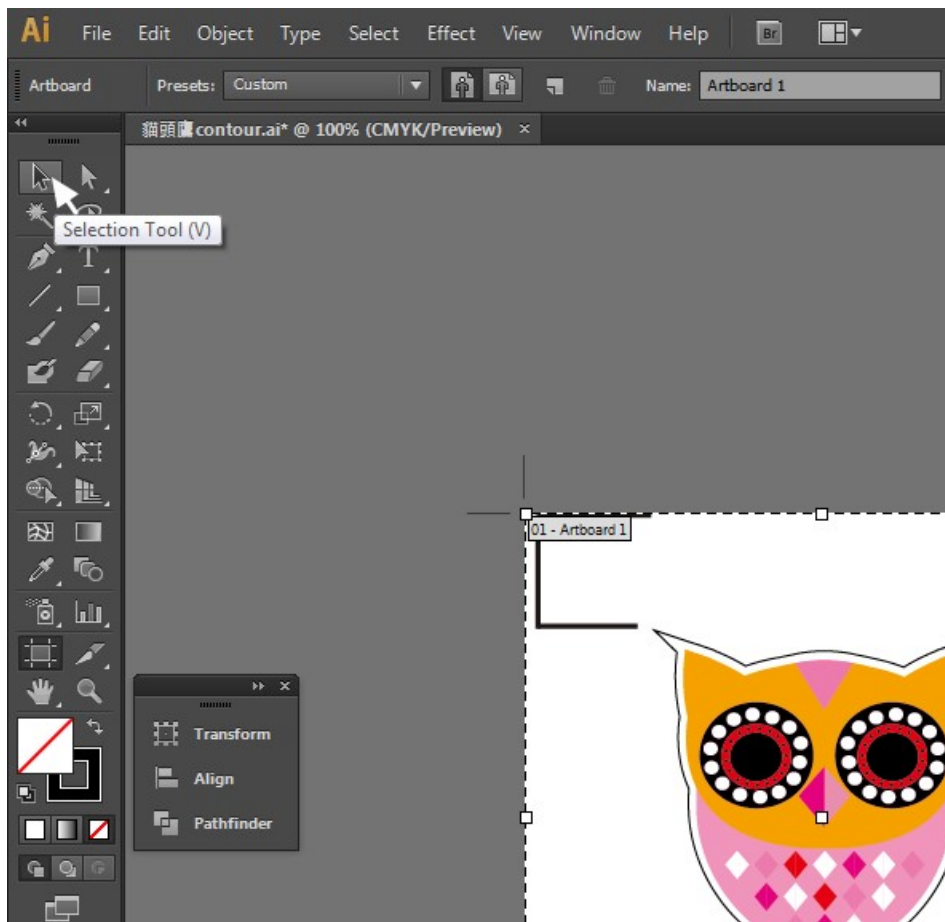

Step 11 This will take you back to the edit mode.

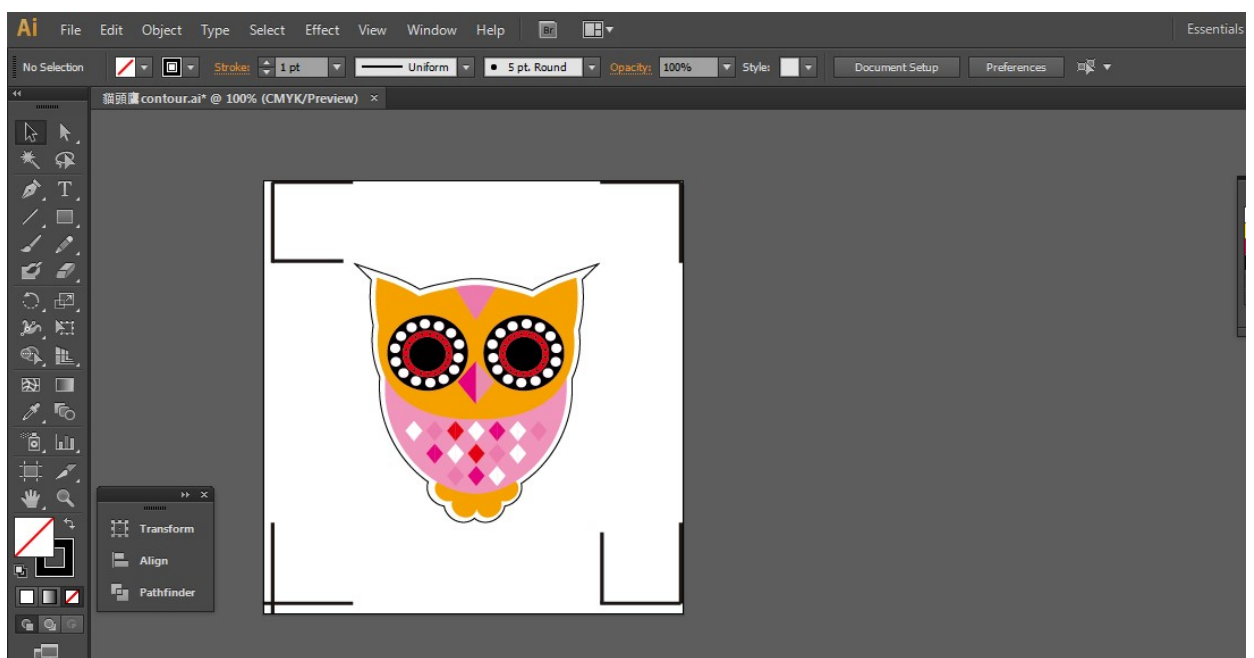


Step 12 Print out the file with the contour line and the registration marks.

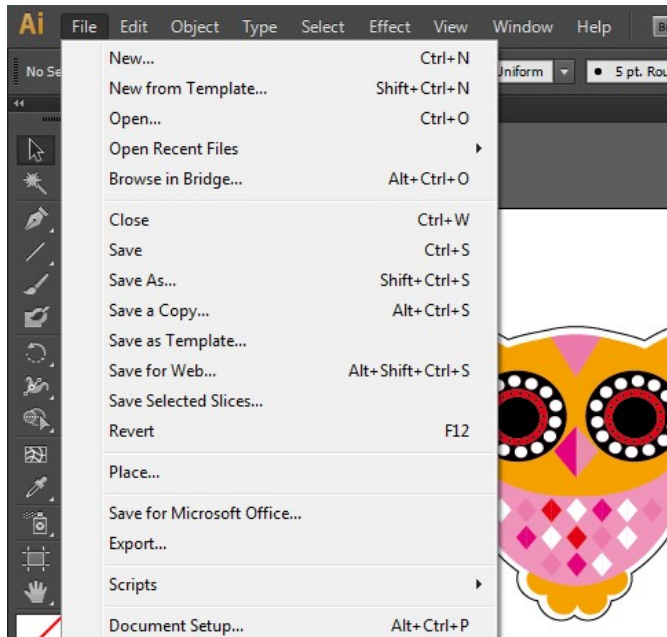


Step 13 Place the printed file on the cutter, lower the pinch rollers and then position the carriage at the origin of the registration marks.

Step 14 Send the file to the cutter.

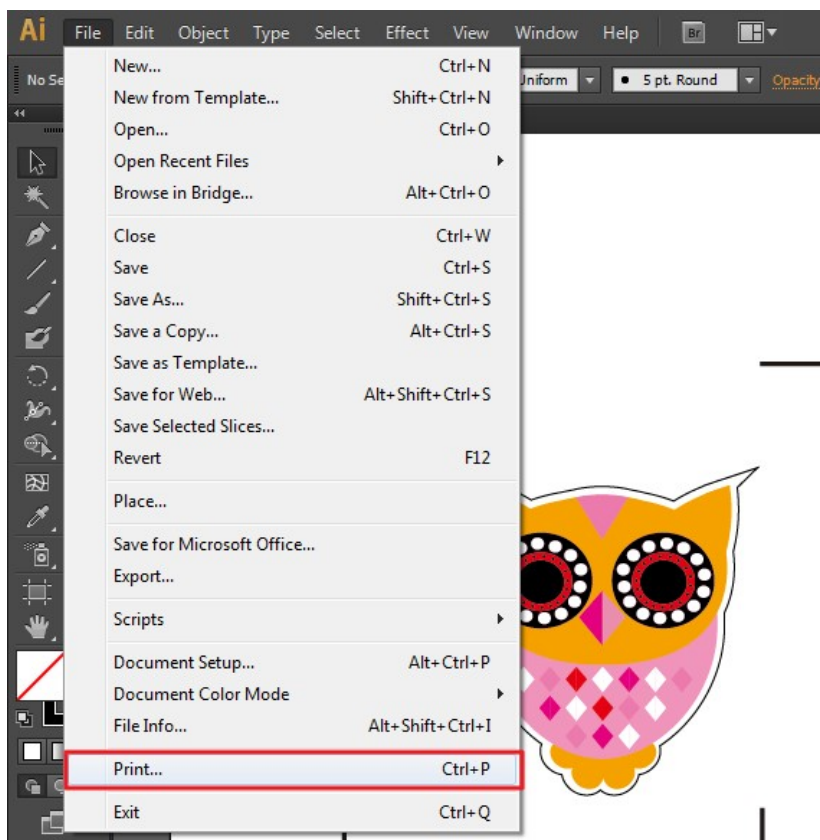


Step 15 Select the cutter model, position the object in the bottom left corner.

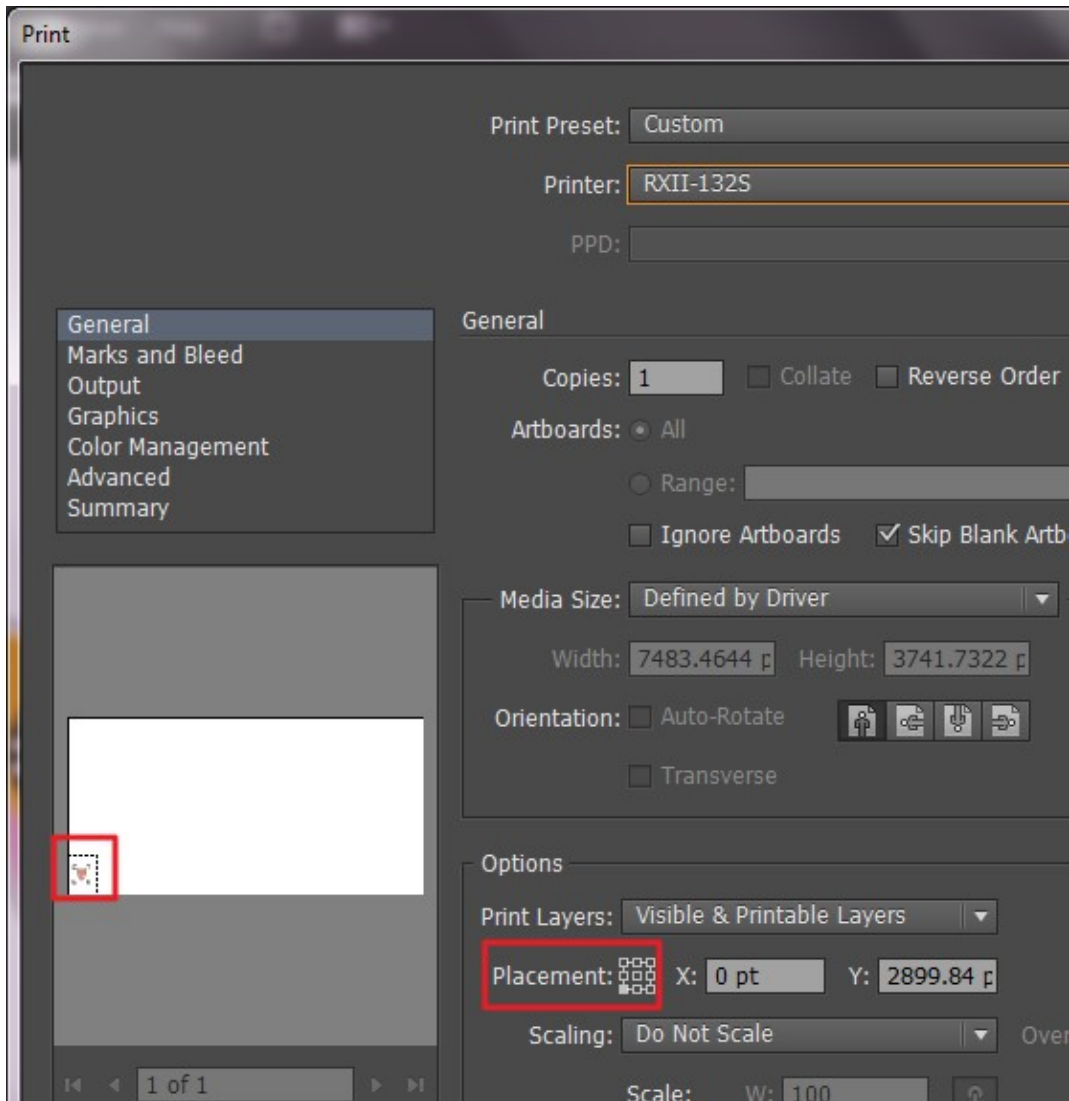


Step 16 Your job is now completed.

Add Registration Mark by page size

If you want to create registration mark by page size, select the object, go to “Scripts” under “File” and select “_AASII_Plug_In”

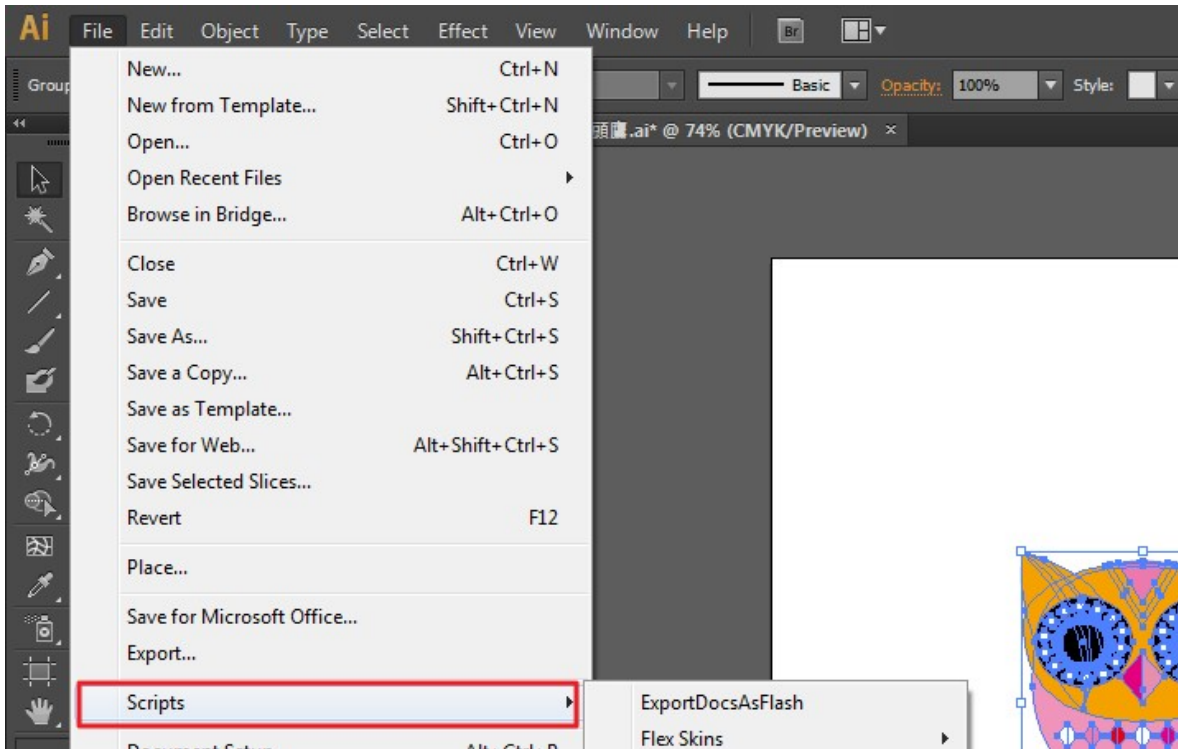

Tick “Make by page size” and click “Apply” and the registration mark will be created on the 4 corners of the page automatically, shown as below.

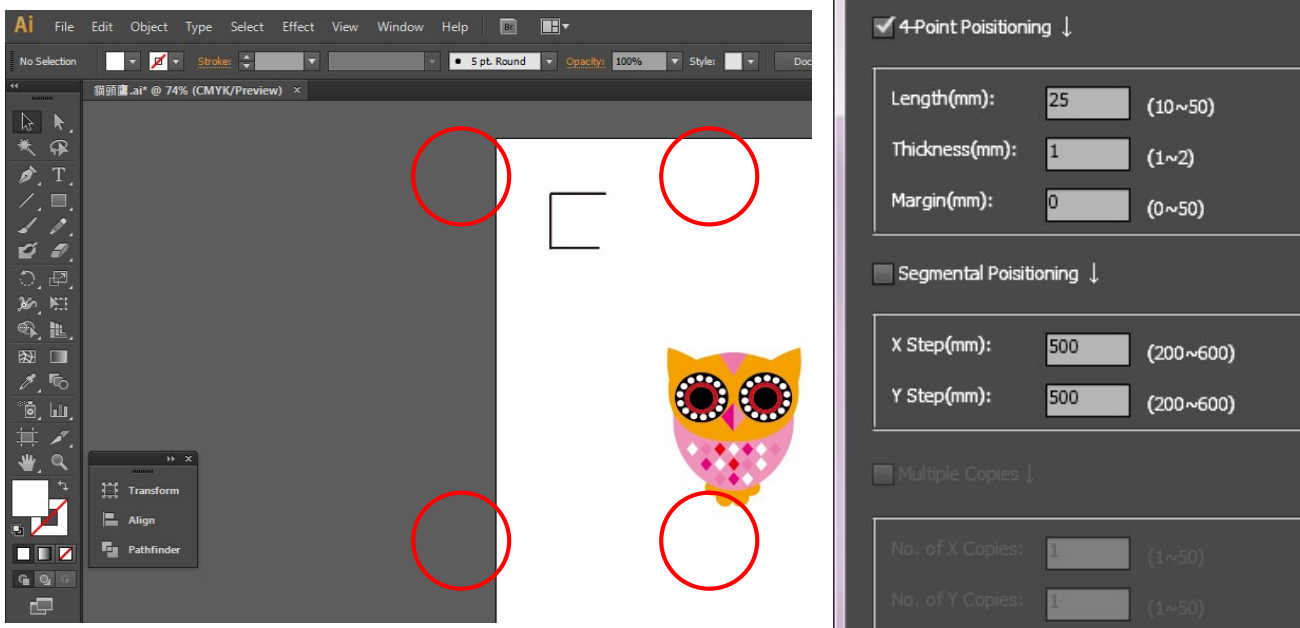

Note:


The length setting will be in the range of 10-50mm according to your page size.

Workable area

It allows users to edit and cut graphics in the area outside the registration marks when adding registration marks by page.

For A4 size media sheet, the workable area is 2.5mm extended from the registration mark on left and right sides and 4.5mm extended from the registration mark on top side. On the bottom side, it is suggested to leave at least 25mm margin from the edge of media sheet to prevent sheets dropping or any error occurred while media sizing.

For A3 size media sheet, the workable area is 10mm extended from the registration mark on the left side, 9mm extended from the registration mark on the right side and 11mm extended from the registration mark on top side. On the bottom side, it is suggested to leave at least 25mm margin from the edge of media sheet to prevent sheets dropping or any error occurred while media sizing.

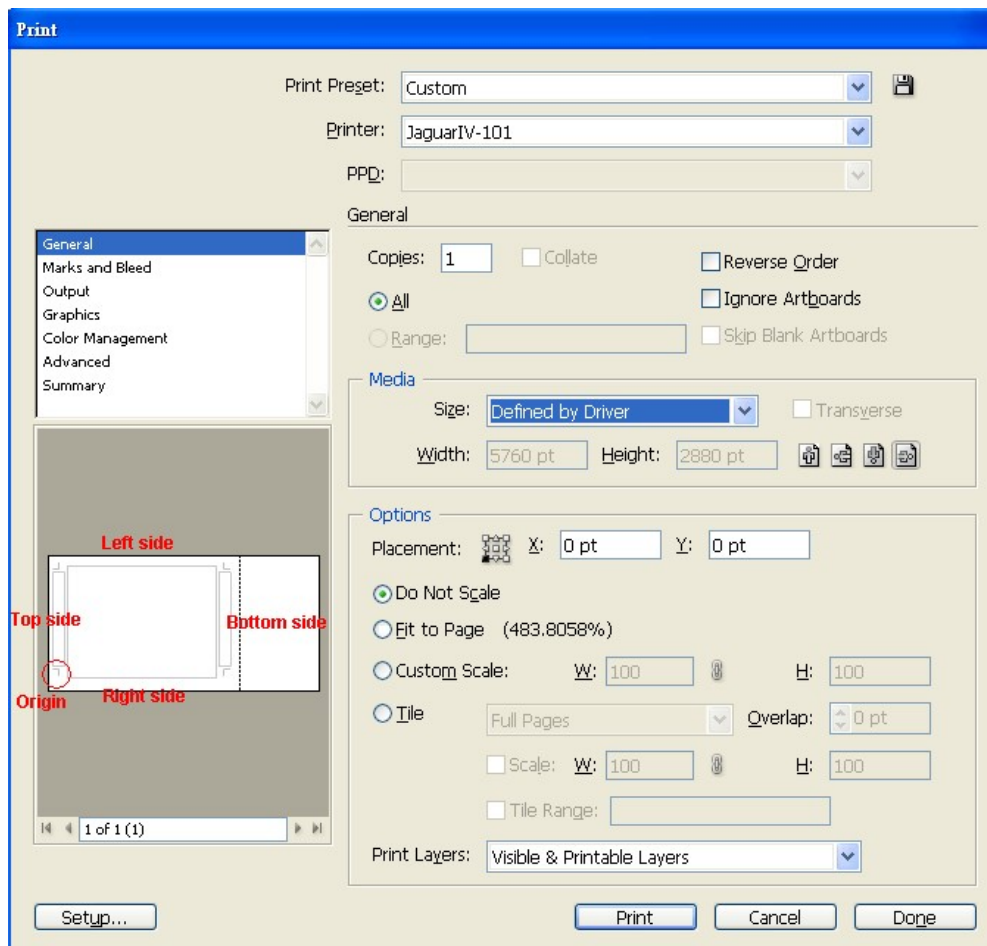


Note: Select “Edge” mode when media sizing to allow the media sheet to be unrolled. If you select “Single” mode, the media sheet will not be able to be moved back and hence fail to be detected by front paper sensor.


Add Registration Mark by Object

If you add registration mark by Object, you will be offered three options of registration marks.

Firstly, select the graphic which you want to add registration mark on and go to “Scripts” under “File” and select “_AASII_Plug_In”.

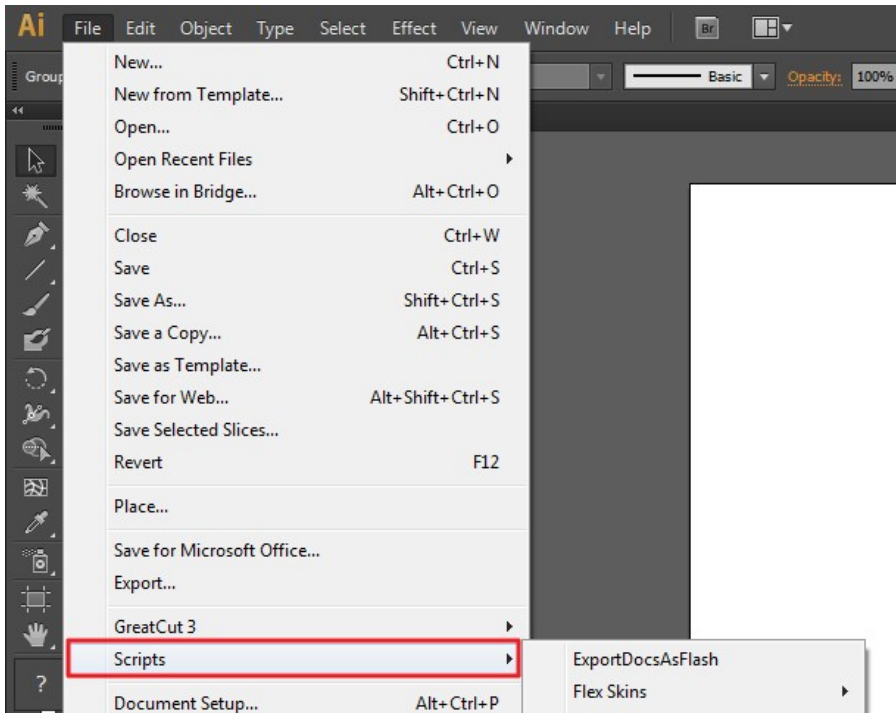


Make sure to untick “Make by page size” and choose one of the registration mark types whichever is suitable.

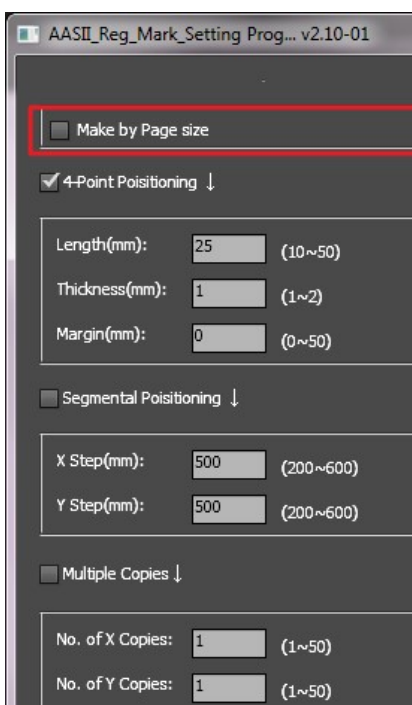

Three types of registration marks


4-Point Positioning

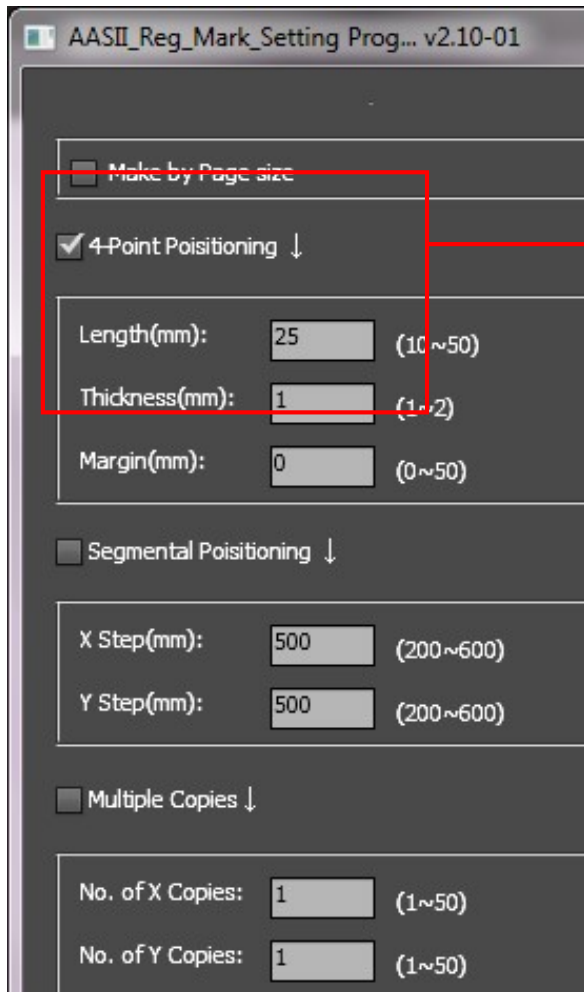

4-Point Positioning


- Length: The length of marks
→ Range: 5mm~50mm
→ Optimized Setting: 25mm
- Thickness: The line thickness of marks
→ Range: 1mm~2mm
→ Optimized Setting: 1mm
- Margin: The distance between marks and images
→ Range: 0mm~50mm
→ Optimized Setting: 5mm

The system will create the 4 marks as shown in the picture below.

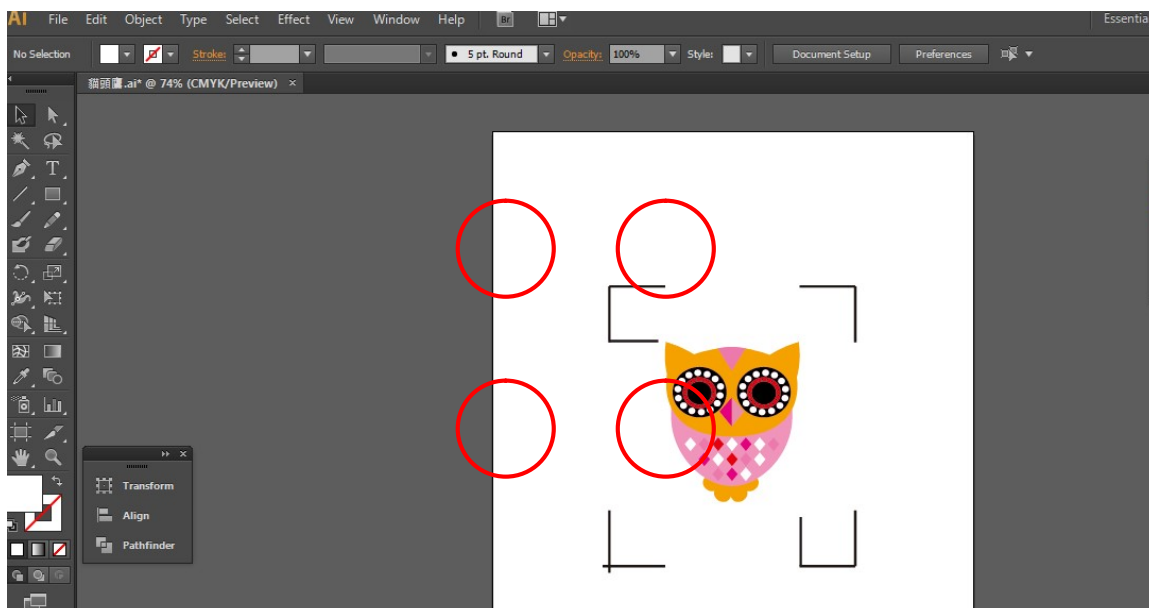

Note:

1. To save your materials, in addition to amending object margins, you can also adjust the length of the registration marks (5mm minimum) when you apply 4-Point Positioning (see table 1 for suggestions based on different material sizes). The smaller the size is, the smaller the distance between the object and the registration marks is (see the figures below).

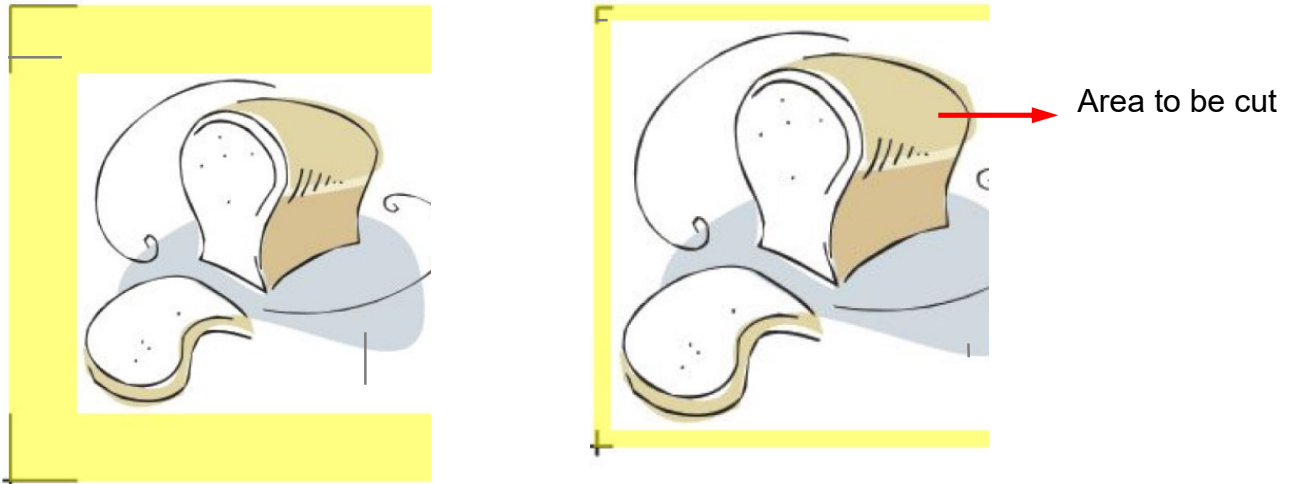

Page size (unit: mm)	Suggested mark length (unit: mm)
A6 (105 x 148)	5
A5 (148 x 210)	8
A4 (210 x 297)	11
A3 (297 x 420)	16
A2 (420 x 594)	23
A1 (594 x 841) and above	25*


Table 1

*25mm is the suggested value for the registration mark length

2. The size of the registration marks would affect the accuracy of registration mark detection so please make sure the amount you enter is reasonable.
3. If you change the paper size, you will have to reset the registration marks otherwise the previous setting will be applied.

Segmental Positioning


For precise cutting quality, it is suggested to select “Segmental Positioning” when you are working on an extra long or large-sized image to increase cutting accuracy.

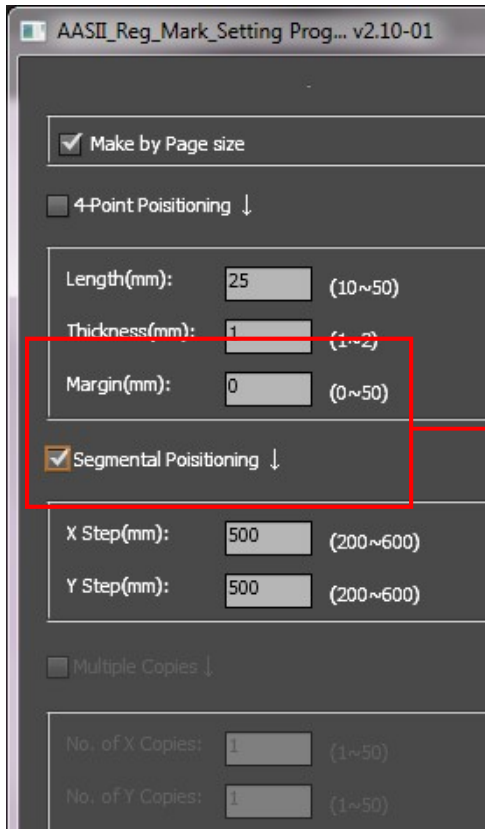

Segmental Positioning

- X Step: The distance of intermediate position on the X axis
- Y Step: The distance of intermediate position on the Y axis
 - Range: 200mm~600mm
 - Optimized Setting: Less than 500mm


The system will create the marks as shown in the picture below.

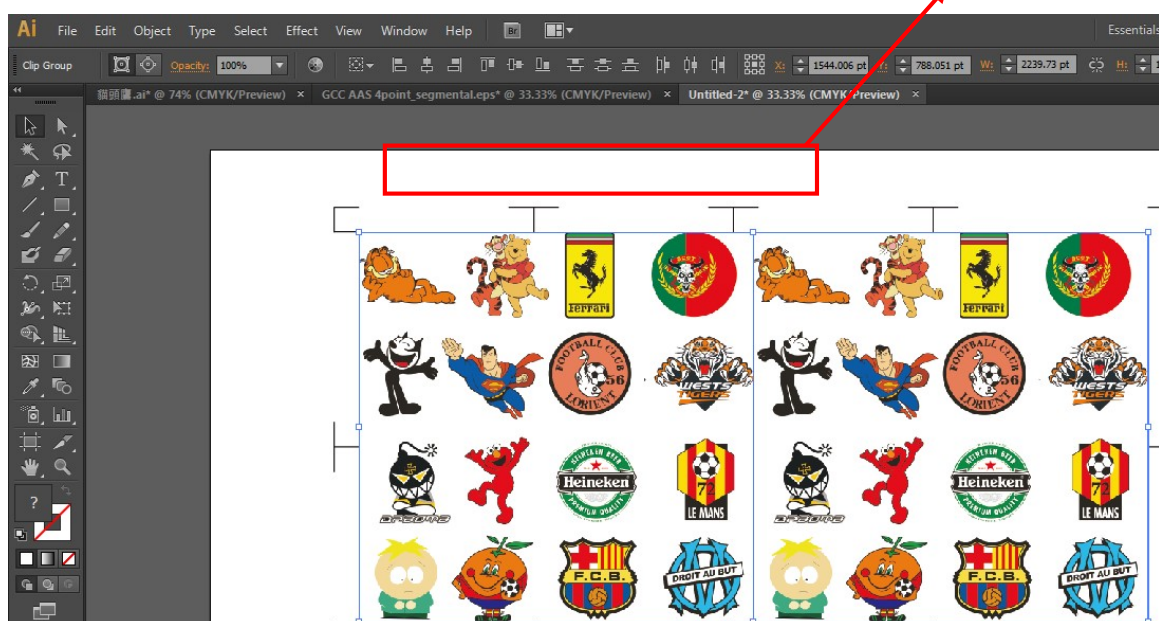

Segmental Positioning

Multiple Copies


It is suggested to select “Multiple Copies” when you would like to make several copies of one image on your material to increase cutting accuracy.

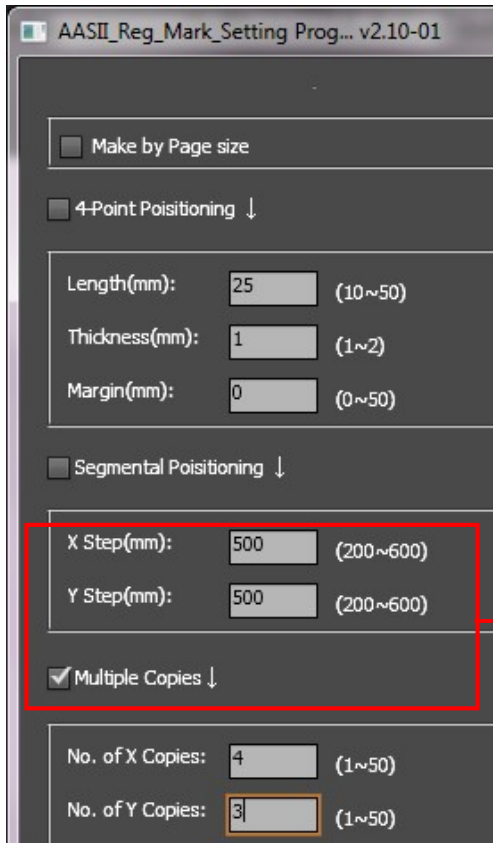

Multiple Copies

- No. of X Copies: The numbers of copies on X axis
- No. of Y Copies: The numbers of copies on Y axis
→ Range: 1~50. (The more copies you make, the more time is needed for data transmission.)
→ Numbers of X Copies * Numbers of Y Copies = The total amount of image copies
- Copies with outline : To show outlines of image graphics
- Margin: Space between marks; must be 0 or ≥ 20 , no negative numbers allowed


The system will create the as shown in the picture below.

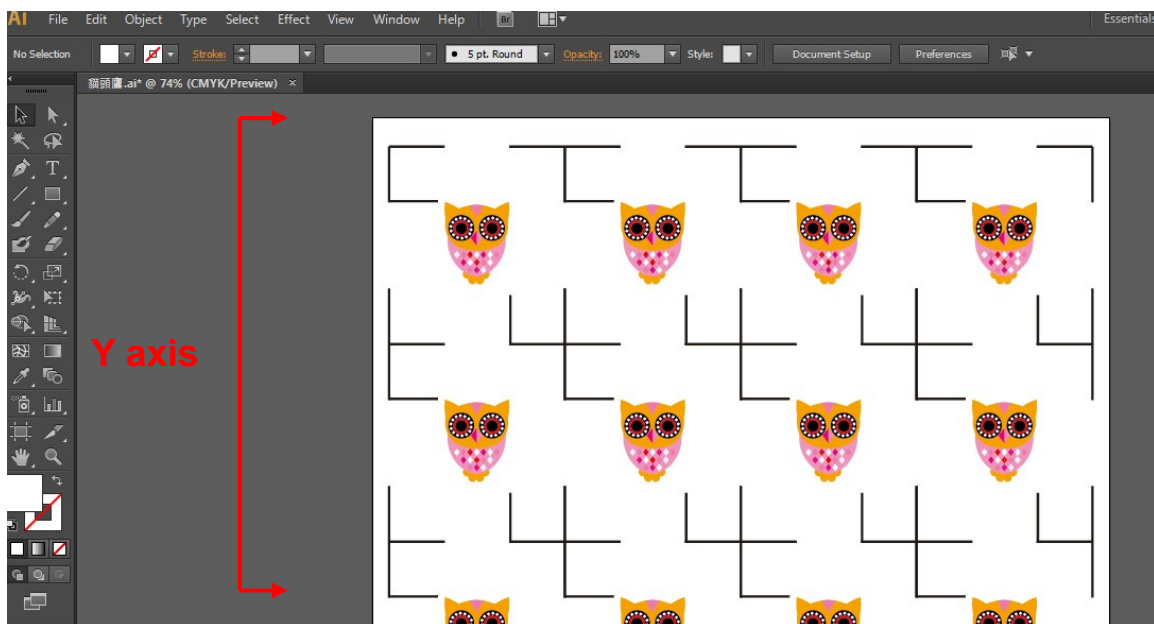


GreatCut Plug-In Instruction

The user manual of GreatCut software is available on GCC website download area.

<https://www.gccworld.com/download.php?act=view&id=20>

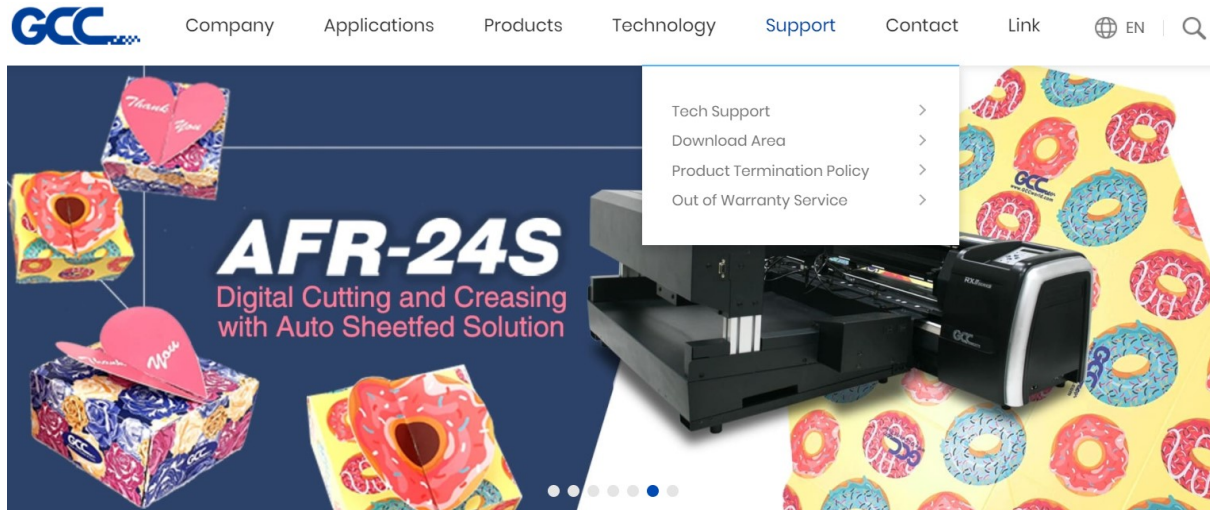

Download Area



Or browse by machine model



Download Area

Vinyl Cutter

Vinyl Cutter



Expert II A



i-Craft™ 2.0



AR-24



Expert II



Puma IV



Jaguar V / Jaguar V (PPF)



RX II / RX II (Creasing)



User Manual

Title	Size	Download
Jaguar V User Manual (V11.0)	16.8MB	Download
Jaguar V PPF User Manual (V4.0)		Download
Jaguar V PPF User Manual Simplified Chinese (V3.0)	2.65MB	Download
Jaguar V User Manual Simplified Chinese (V11.0)	15.8MB	Download
GreatCut 4 User Manual_English	3.4MB	Download
GreatCut 4 User Manual_French	4.3MB	Download


GCC AASII System

Below is a step-by-step instruction of using the AAS function in GreatCut software through CoreIDRAW and Adobe Illustrator.


Edit your image in CoreIDRAW

4-Point Positioning

Step 1 Create a new file in CoreIDRAW and click on the Create contour icon on the GreatCut toolbar (it would appear automatically once CoreIDRAW is open).

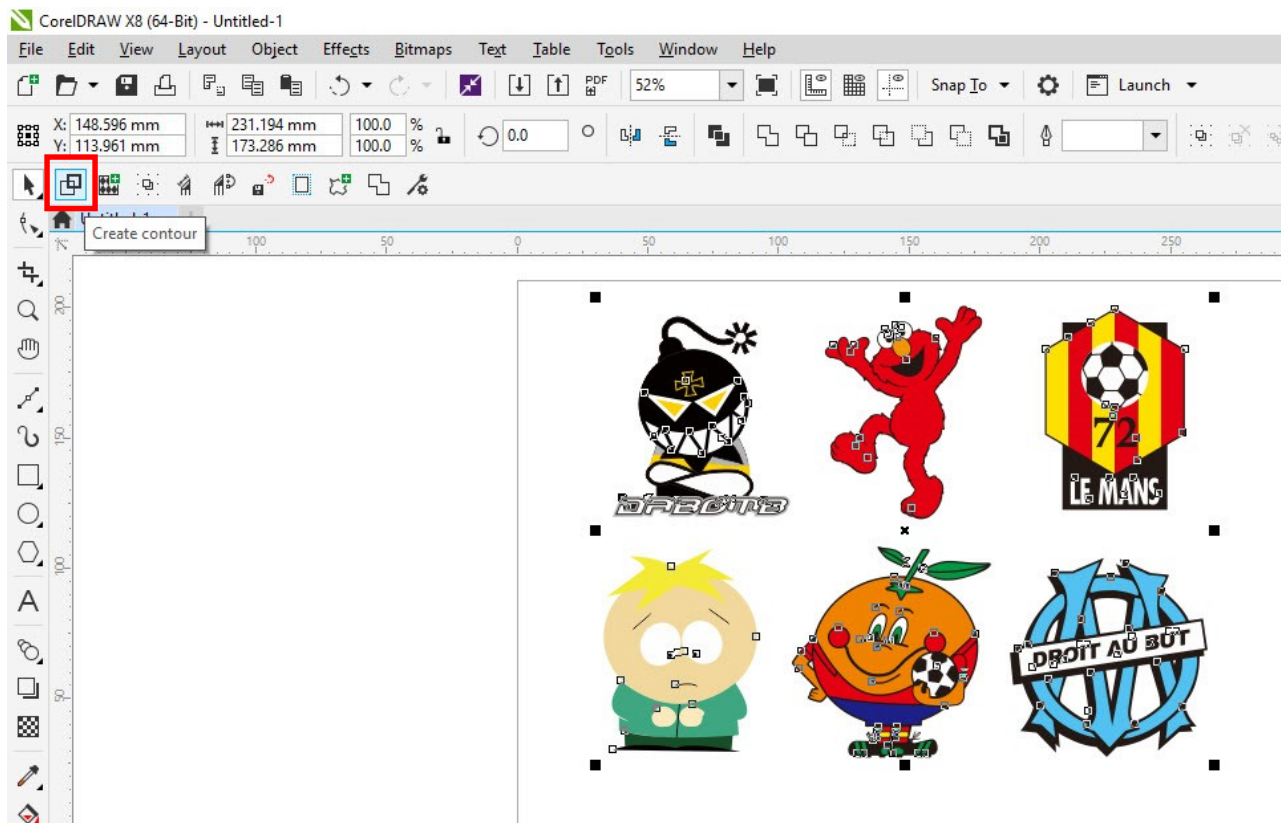


Step 2 Complete contour line settings (including contour offset value) and press Calculate to confirm.

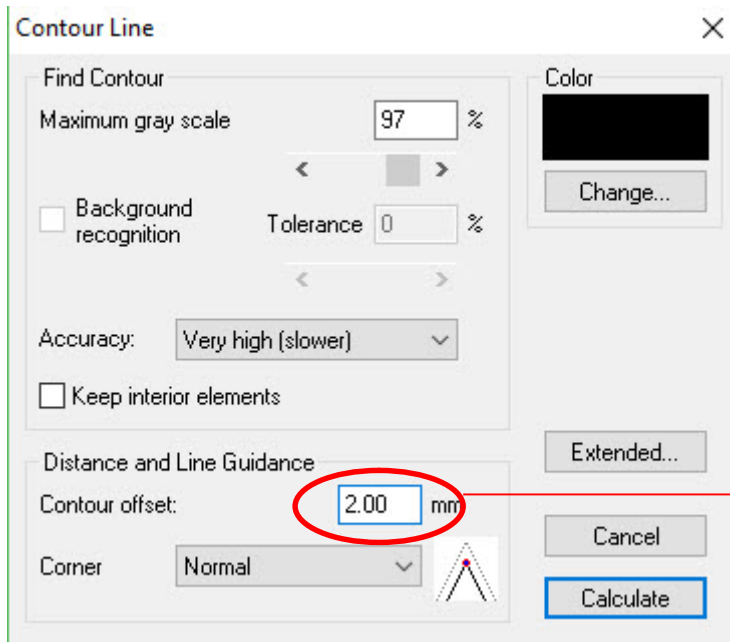


Contour offset is the distance between the object and the contour line.

Contour lines will be added to the images.

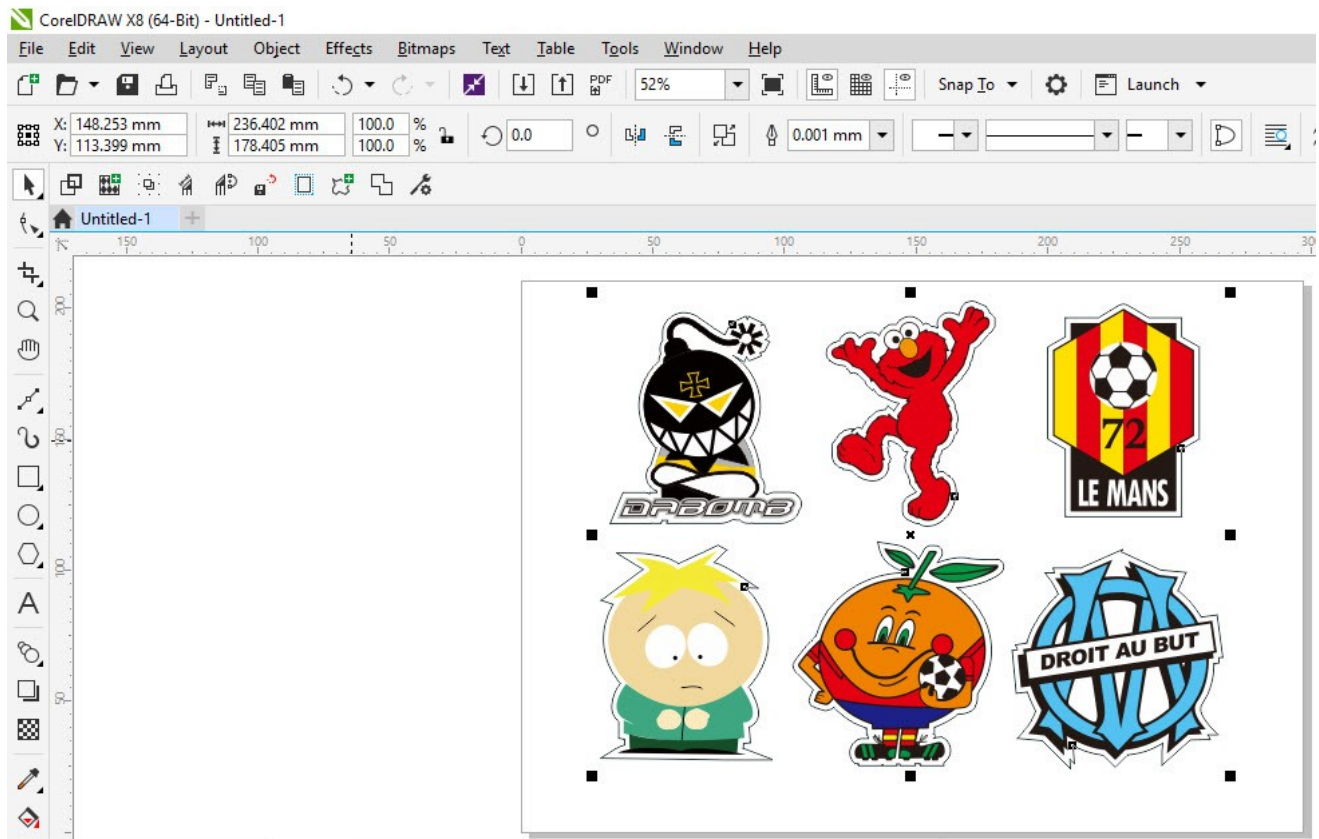


Tips: Vector object to create round outline

In general for vector objects you will get better results with the outline function. You will see the difference between "Normal" and "Round" in sharp corners. The picture is shown as below:

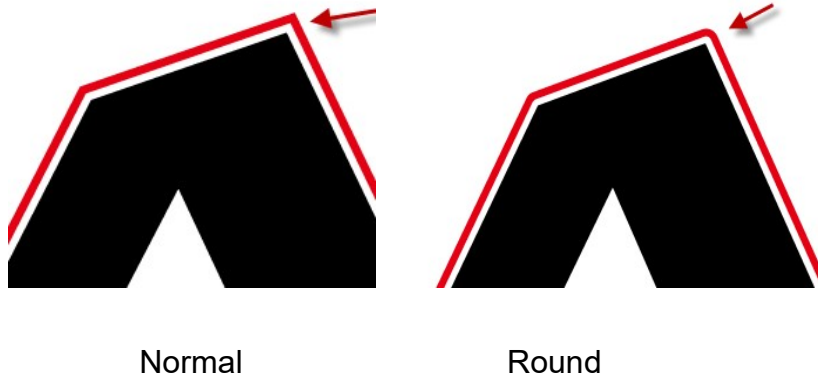


1. Click the "Create outline" to create contours in a freely definable distance around text objects.

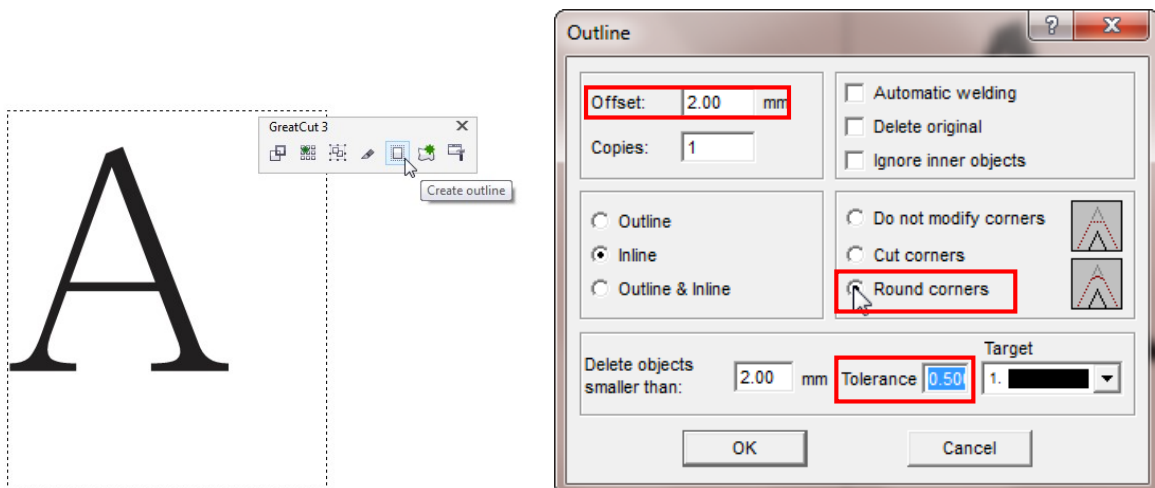


2. Select "Round corners" and set the value of "offset" and "tolerance."

Offset is the value for the distance of the inline and outline from the original object. The field **tolerance** indicates in which offset from the corner dot is cut respectively rounded.


Step 3 Press the Settings icon on the GreatCut toolbar.

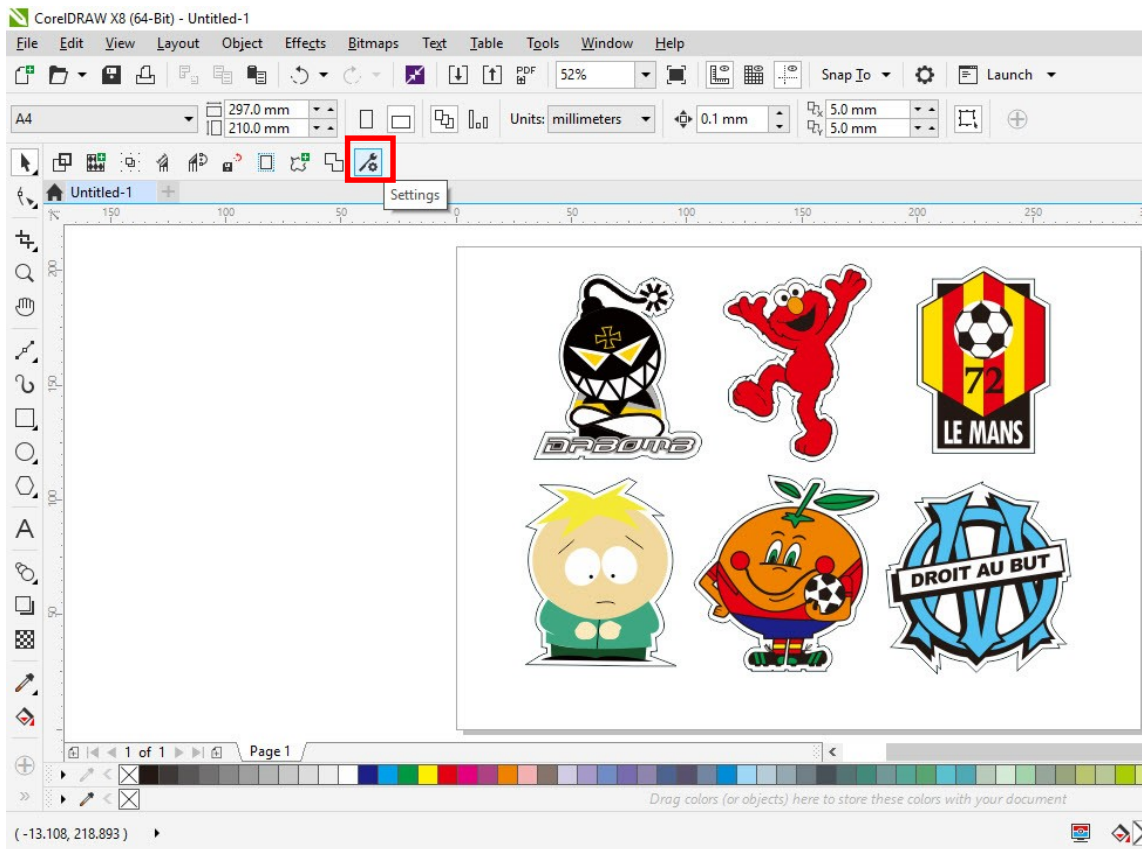

Step 4 Press the button on the right of Jog marks.

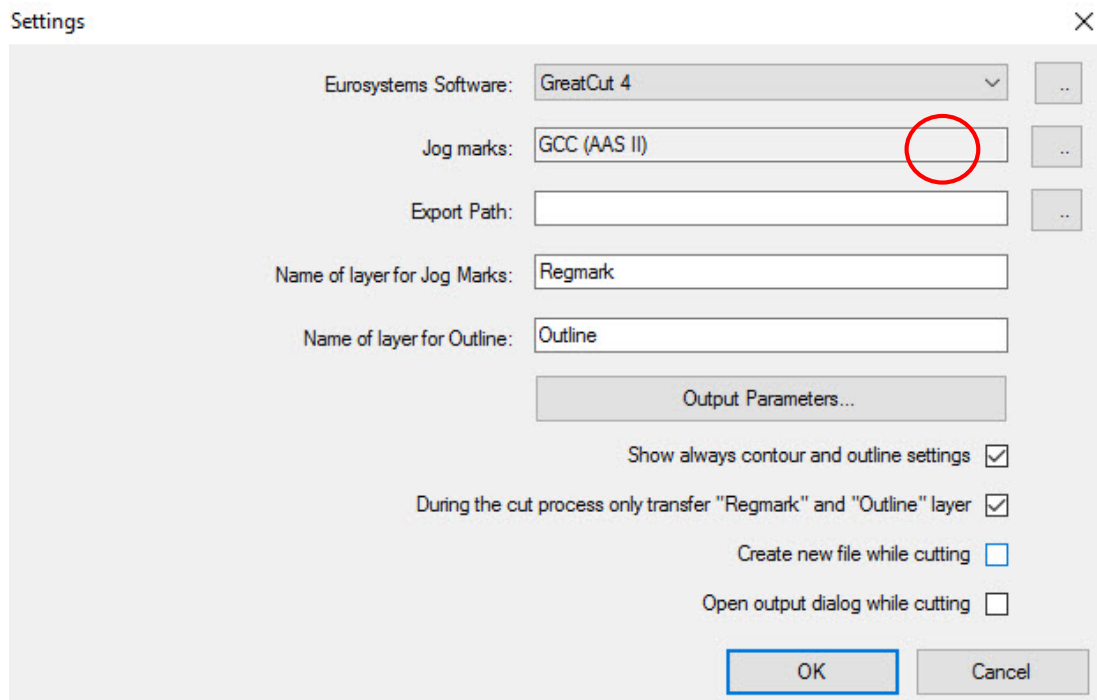


Step 5 Adjust the size, object margin and line thickness of your registration marks in the Setup-Jog Marks window and click OK.

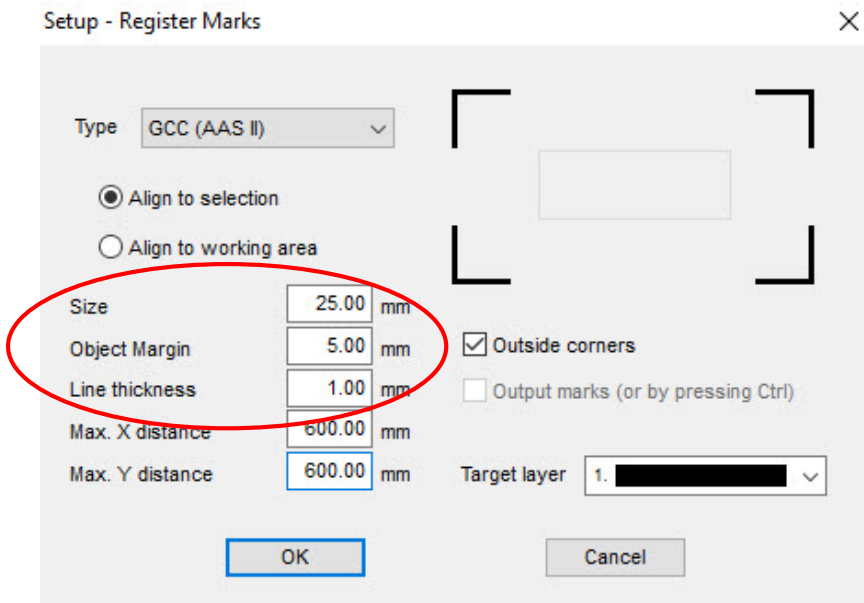


4-Point Positioning

- **Size:** The length of marks
→ Range: 5mm~50mm
→ Optimized Setting: 25mm
- **Object margin:** The distance between marks and images
→ Range: 0mm~50mm
→ Optimized Setting: 5mm
- **Line thickness:** the line thickness of marks
→ Range: 1mm~2mm
→ Optimized Setting: 1mm


Step 6 Ensure the three items below are selected and click OK.

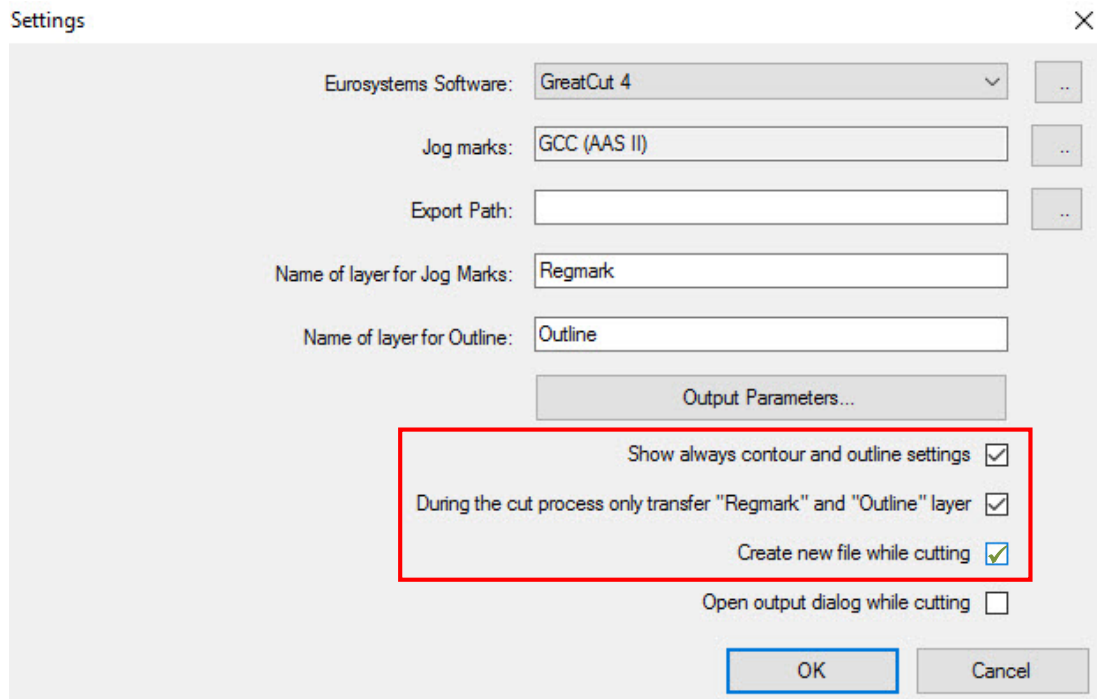

Step 7 Click the Set Jog Marks icon on the GreatCut toolbar.

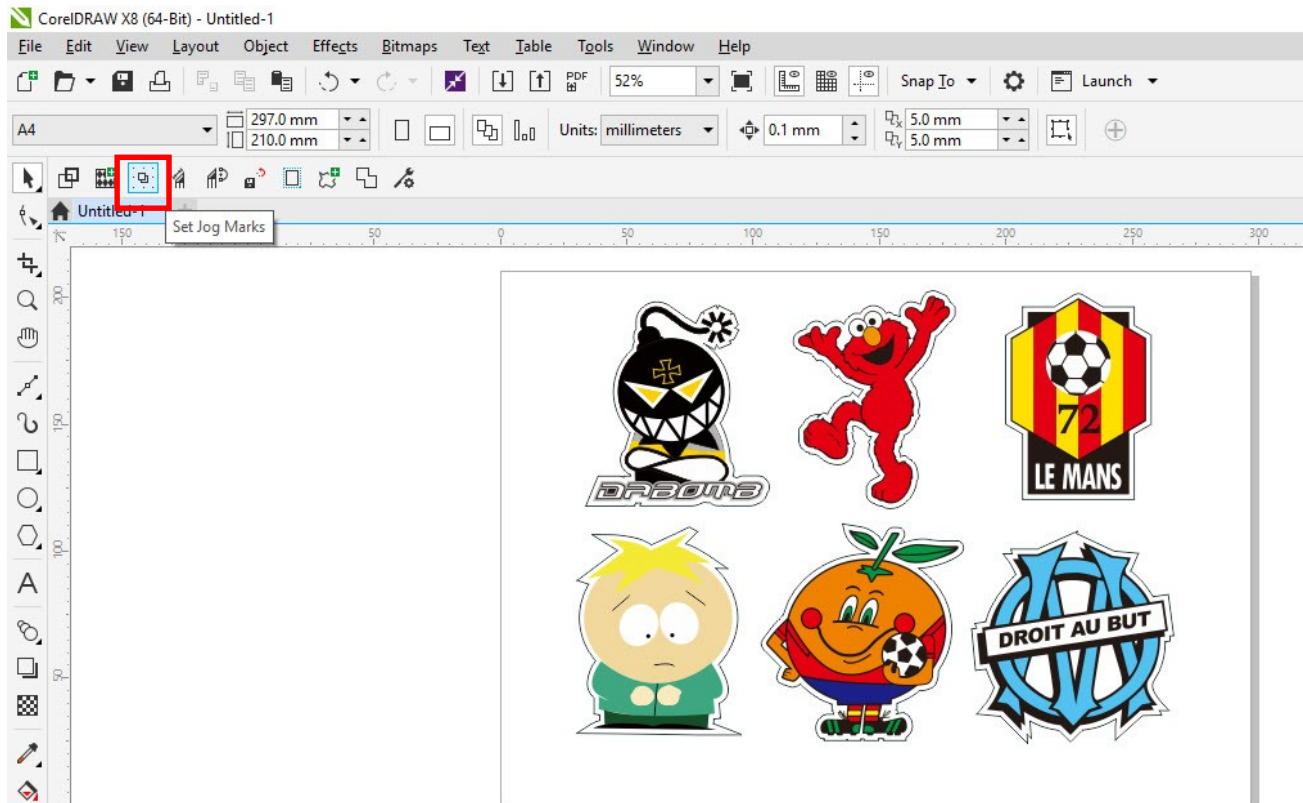


The system will create the 4 marks as shown in the picture below.

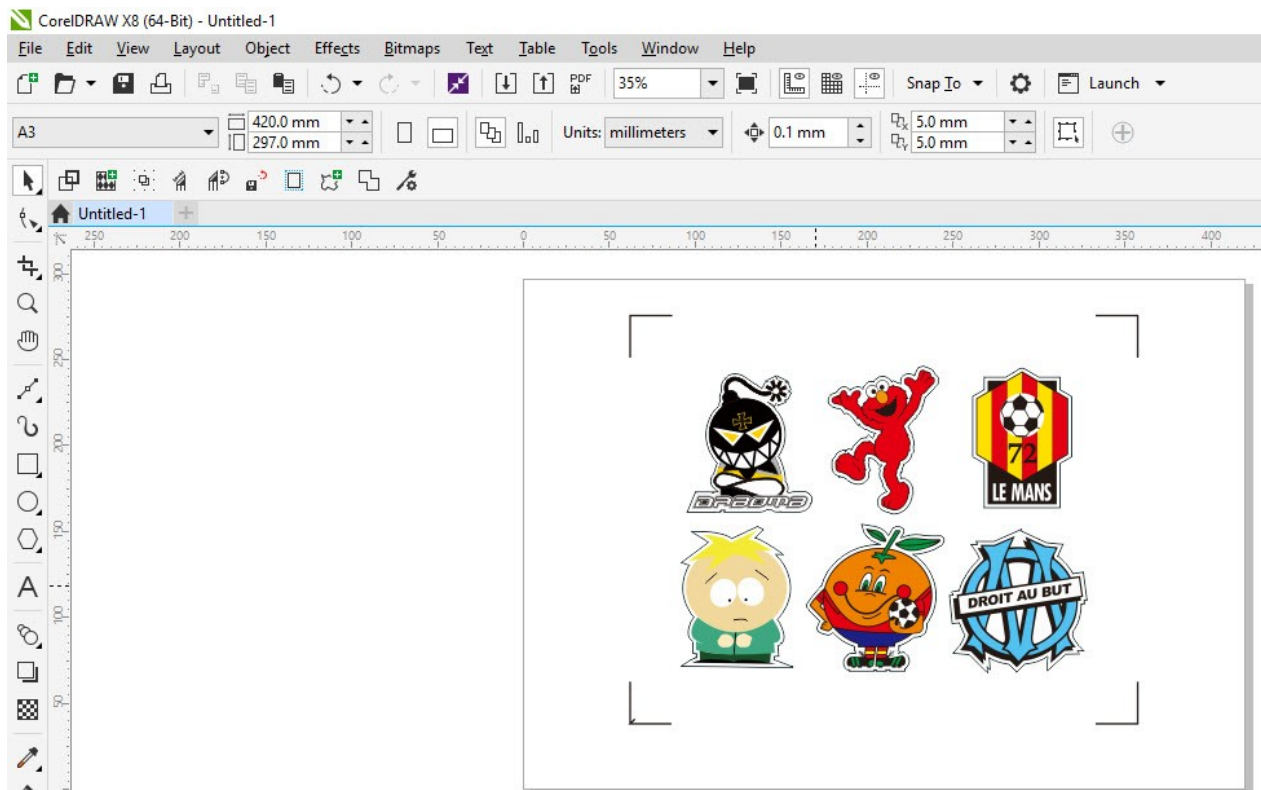

Note:

- To save your materials, in addition to amending object margins, you can also adjust the length of the registration marks (5mm minimum) when you apply the above function(see table 1 for suggestions based on different material sizes). The smaller the size is, the smaller the distance between the object and the registration marks is (see the figures below).

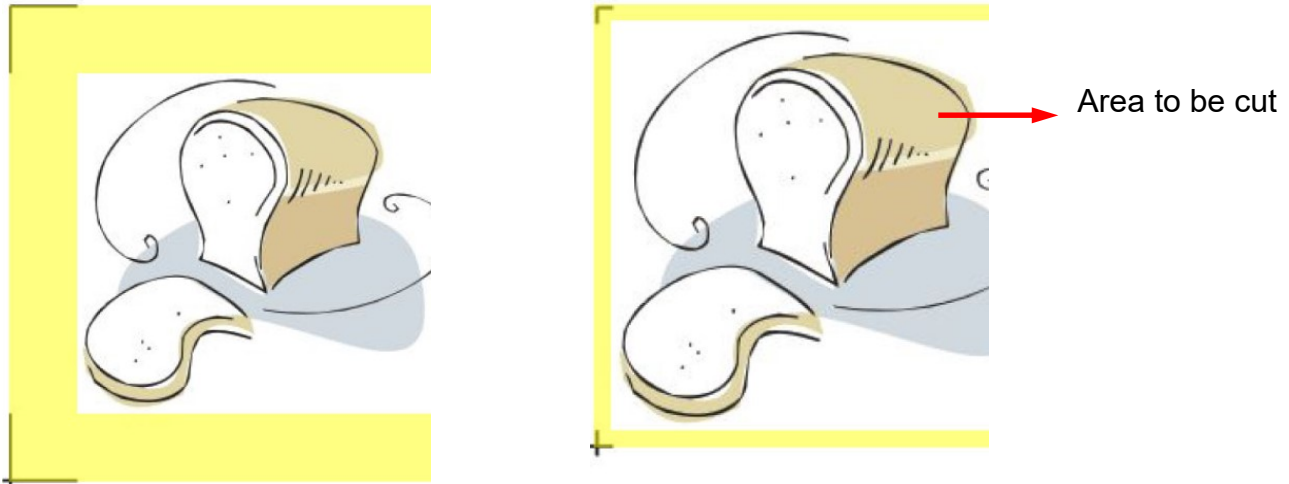

Page size (unit: mm)	Suggested mark length (unit: mm)
A6 (105 x 148)	5
A5 (148 x 210)	8
A4 (210 x 297)	11
A3 (297 x 420)	16
A2 (420 x 594)	23
A1 (594 x 841) and above	25*


Table 1

*25mm is the suggested value for the registration mark length


- The size of the registration marks would affect the accuracy of registration mark detection so please make sure the amount you enter is reasonable.


Output


Step 1 Select both the entire object (including registration marks and the contour line) and press the Cut icon on the GreatCut toolbar.

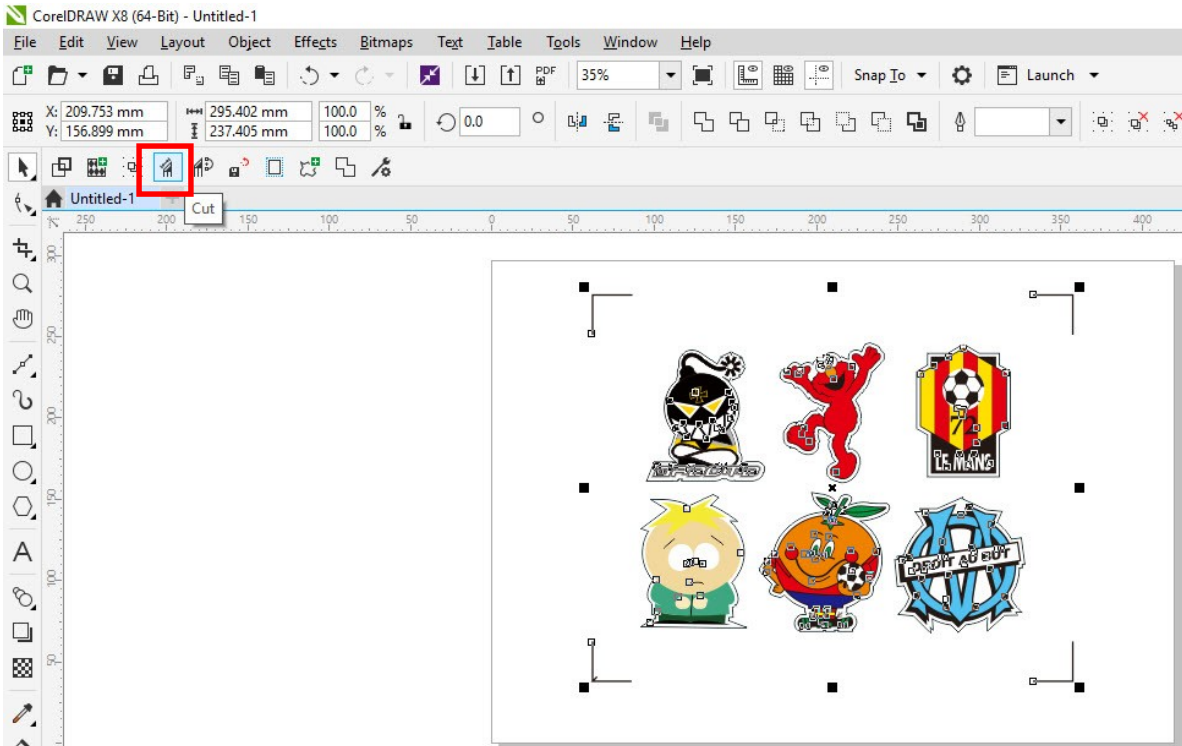


Step 2 The system will activate GreatCut automatically and import the registration marks and contour line to GreatCut.

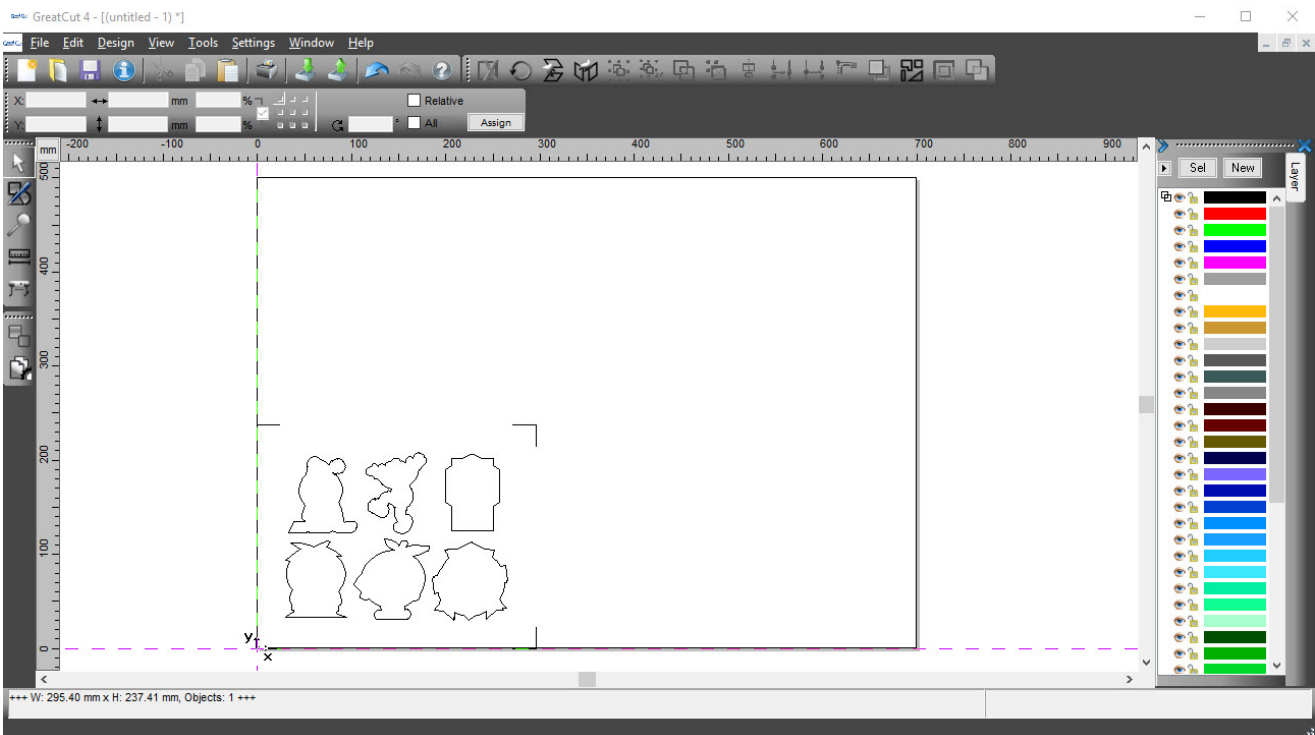

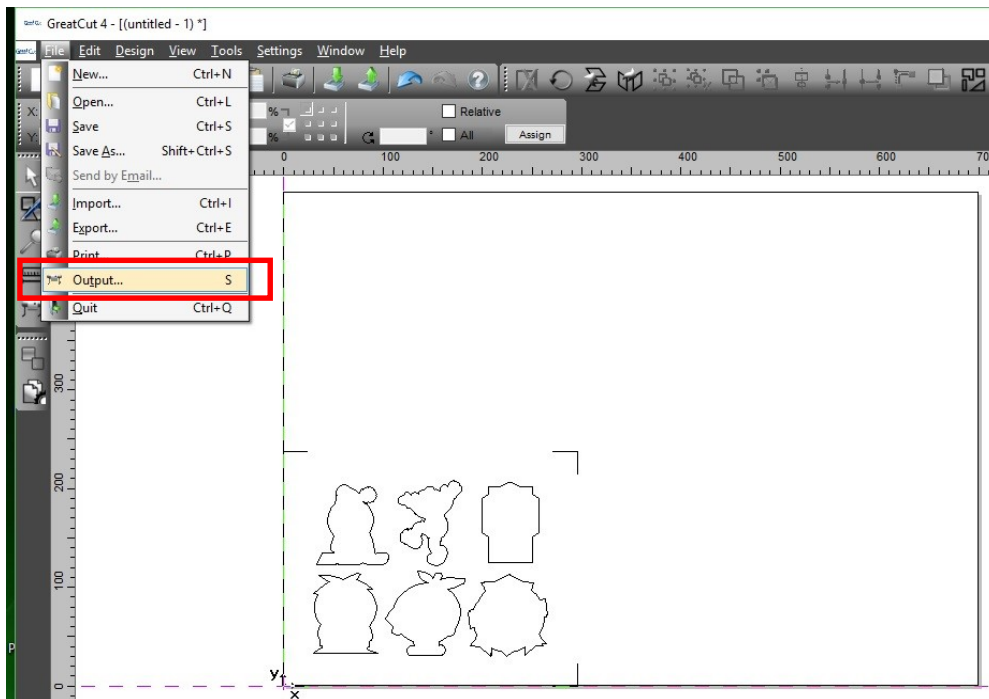Step 3 Select Output under File.**Step 4.** Select Cut with AAS in Mode/Tool in the Output to device window.

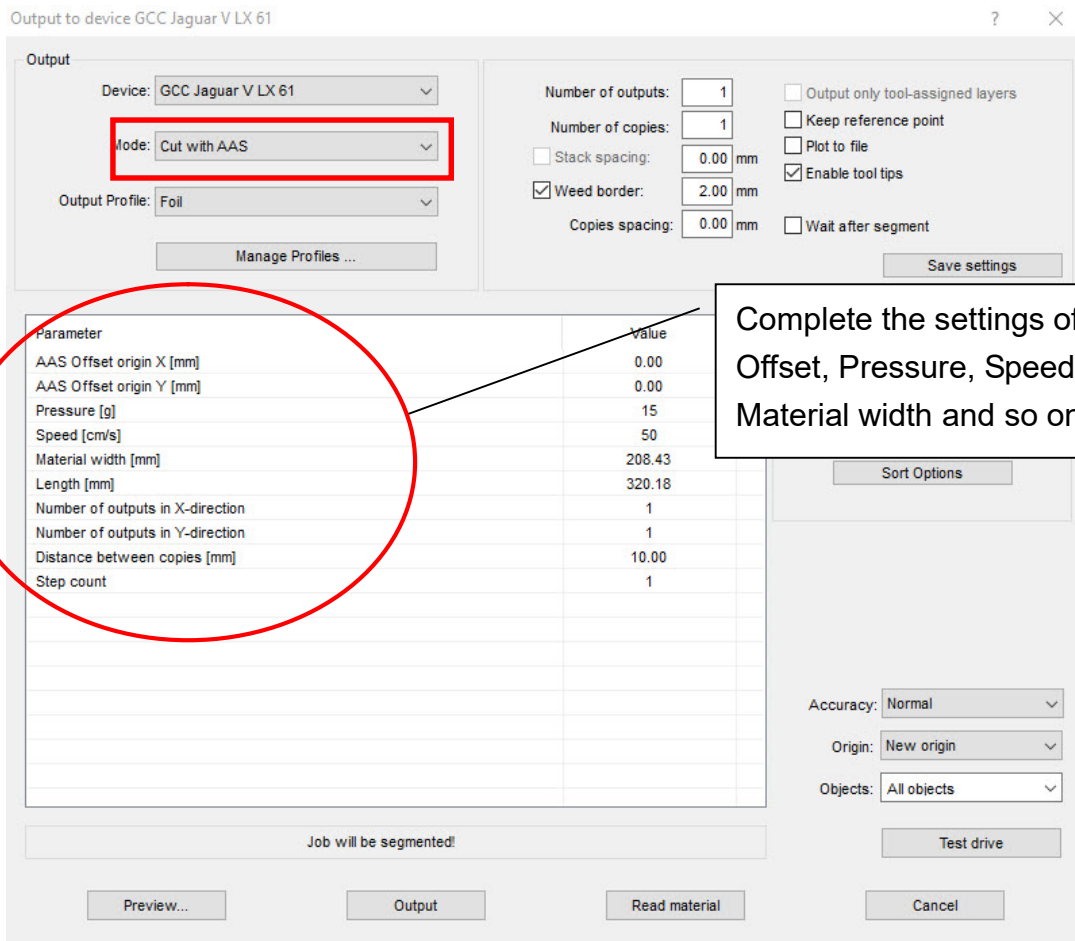

Step 5 Click output and the object will be sent to GCC Cutting Plotter.

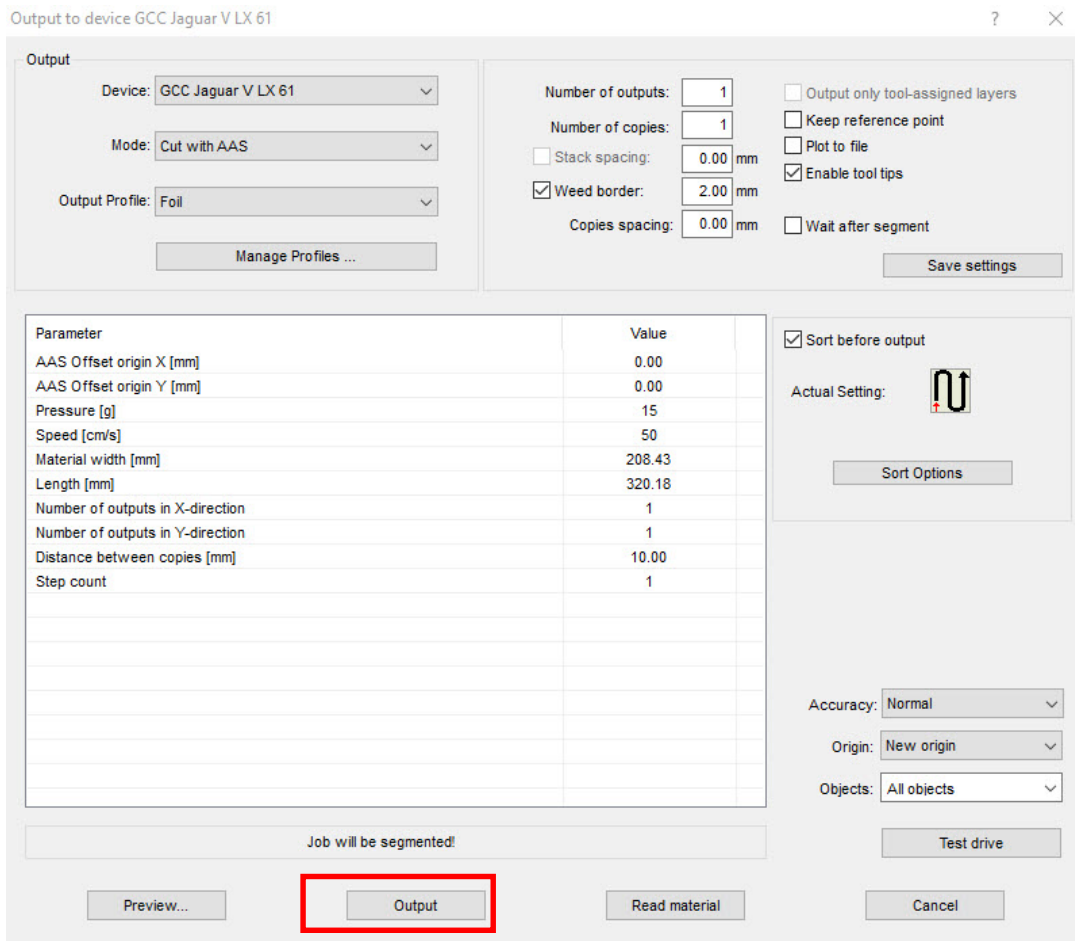

Note: The difference amount Number of outputs, Number of copies, and Step count in the

Output window.

Output to device GCC Jaguar V LX 61

Output

Device: GCC Jaguar V LX 61

Mode: Cut with AAS

Output Profile: Foil

Manage Profiles ...

Number of outputs: 1

Number of copies: 1

Stack spacing: 0.00 mm

Weed border: 2.00 mm

Copies spacing: 0.00 mm

Output only tool-assigned layers

Keep reference point

Plot to file


Enable tool tips

Wait after segment

Save settings

Parameter	Value
AAS Offset origin X [mm]	0.00
AAS Offset origin Y [mm]	0.00
Pressure [g]	15
Speed [cm/s]	50
Material width [mm]	208.43
Length [mm]	320.18
Number of outputs in X-direction	1
Number of outputs in Y-direction	1
Distance between copies [mm]	10.00
Step count	1

Sort before output

Actual Setting: 

Sort Options

Accuracy: Normal

Origin: New origin

Objects: All objects

Test drive

Job will be segmented!

Preview... Output Read material Cancel



1. When **Number of outputs** is set as 2, the square and the triangle will be cut 1 time and then the square and the triangle will be cut 1 time at next position.
2. When **Number of copies** is set as 2, the square and the triangle will be cut 2 times at the same position.
3. When **Step count** is set as 2, the square will be cut 2 times at the same position and then the triangle will be cut will be cut 2 times at the same position.


Advanced Settings

Segmental Positioning


For precise cutting quality, it is suggested to apply “Segmental Positioning” by adjusting the x and y distance when you are working on an extra long or large-size image to increase cutting quality.

Follow the same steps in the **4-Point Positioning** section to complete the contour line setting and registration mark creation procedures. Adjust the size, object margin and line thickness of your registration marks and the space between registration marks by changing X, Y distance in the Setup-Jog Marks window and click OK.


Step 1 Press the Settings icon on the GreatCut toolbar.

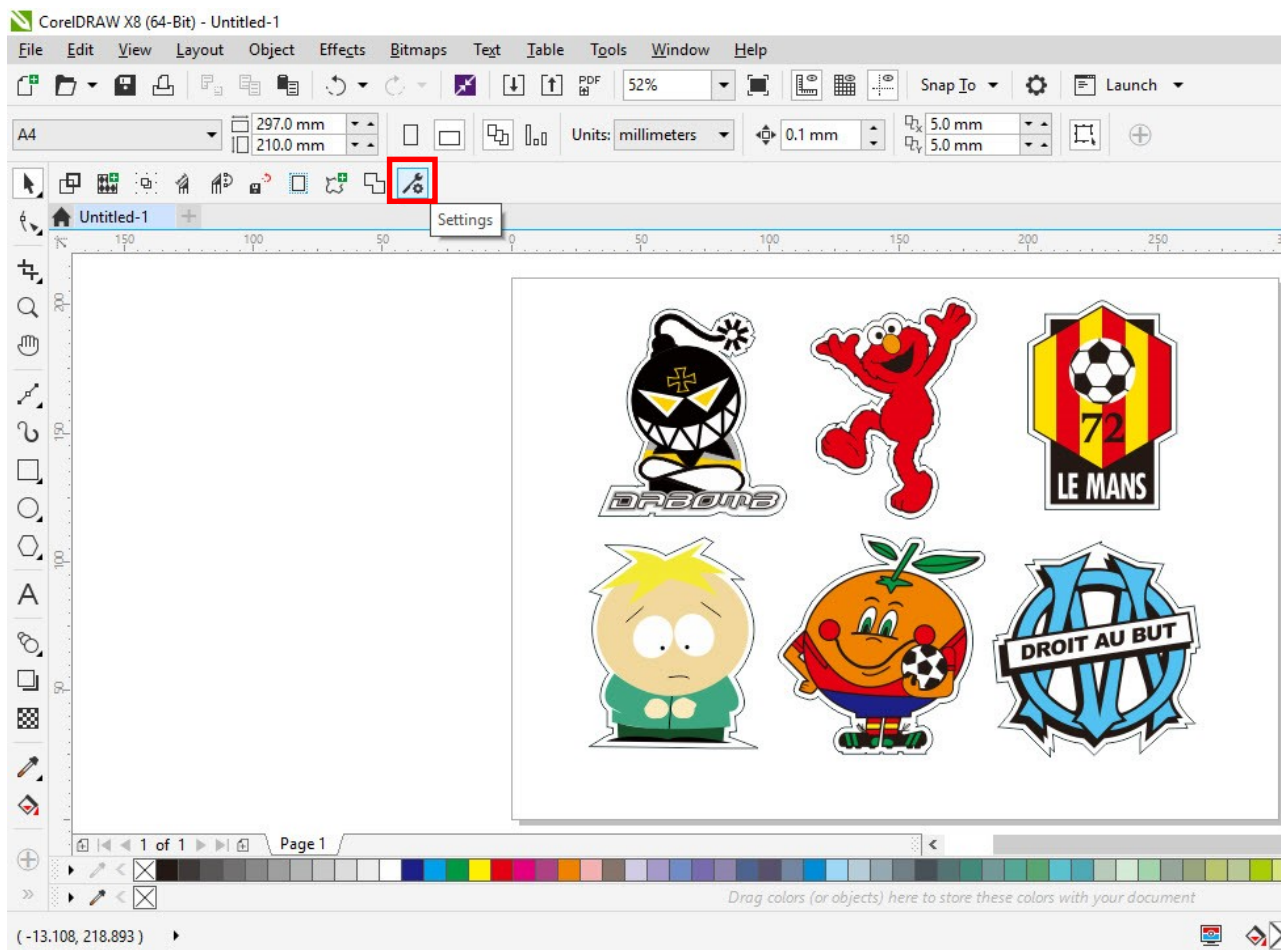

Step 2 Press the button on the right of Jog marks.

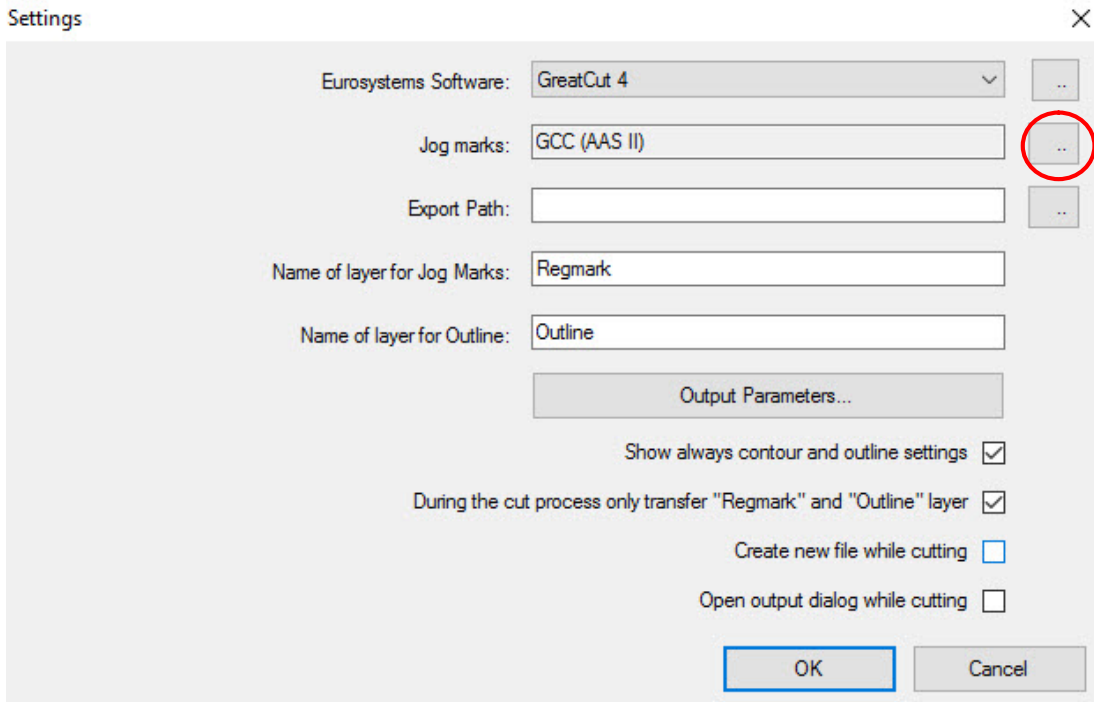


Step 3 Adjust the size, object margin and line thickness of your registration marks in the Setup-Jog Marks window and click OK.

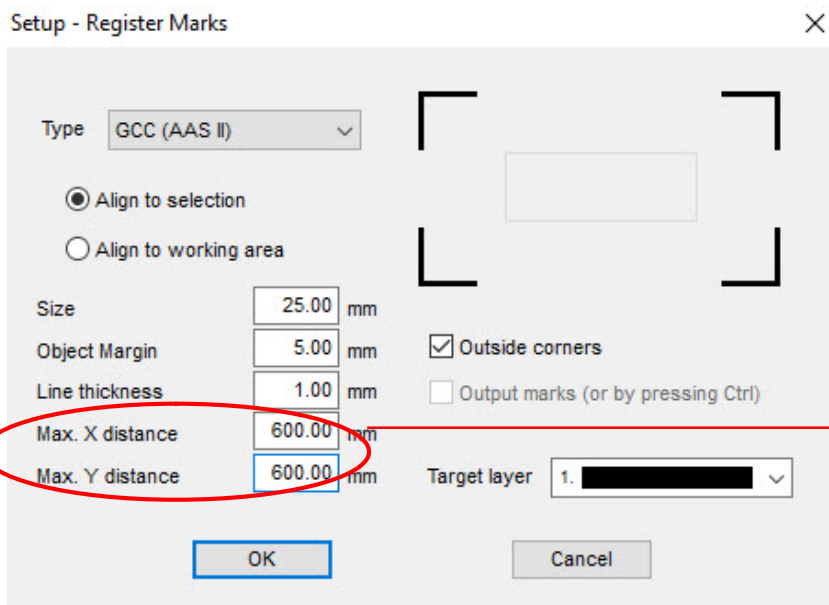


Segmental Positioning

- **Max. x Distance:** The distance of intermediate position on the X axis
→ Range: 200-500 mm
- **Max. y Distance:** The distance of intermediate position on the Y axis
→ Range: 200-500 mm


Step 4 Ensure the three items below are selected and click OK.

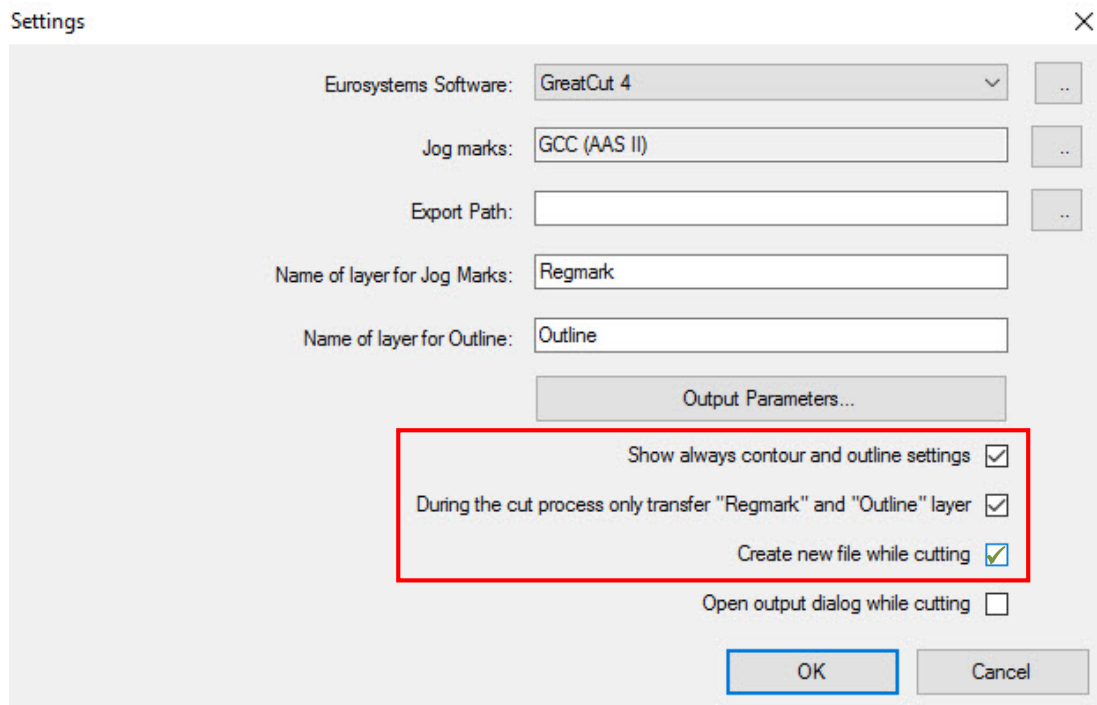

Step 5 Click the Set Jog Marks icon on the GreatCut toolbar.

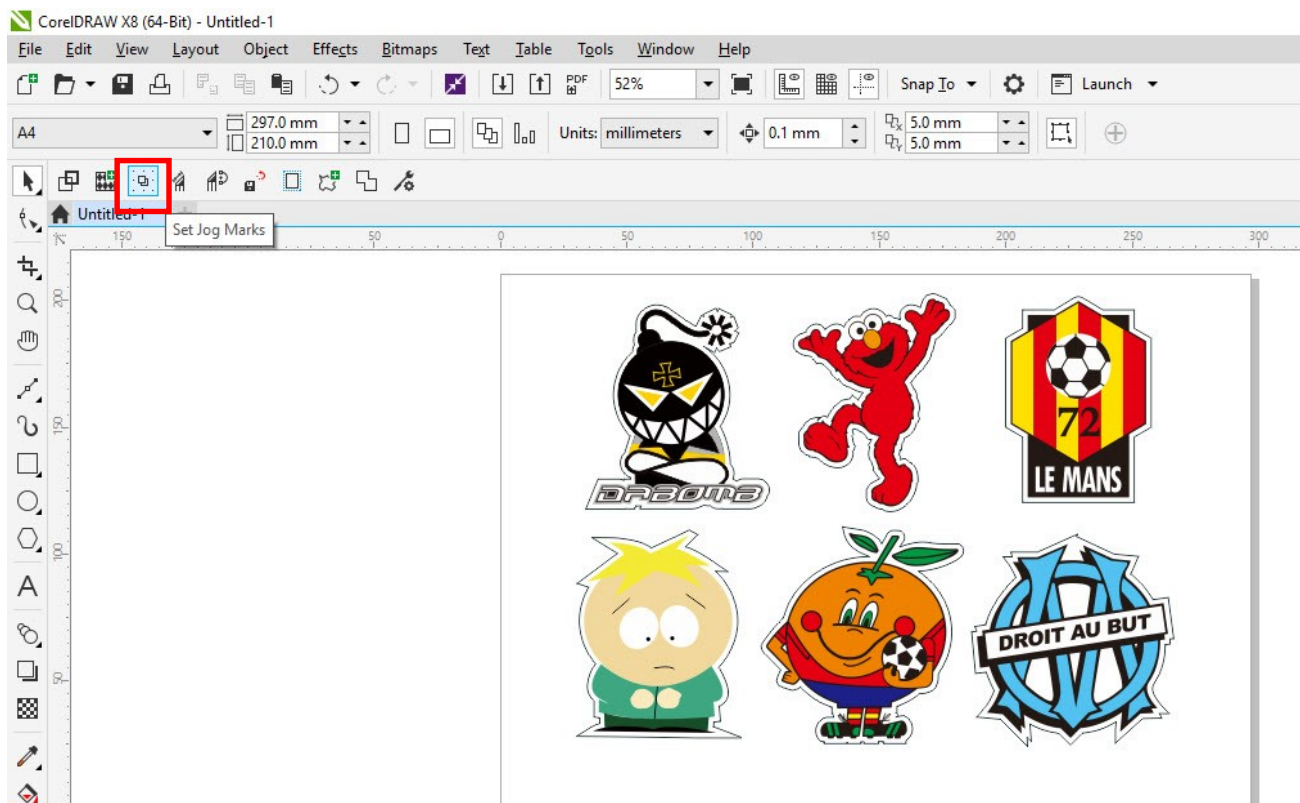


The system will create the marks as shown in the picture below.

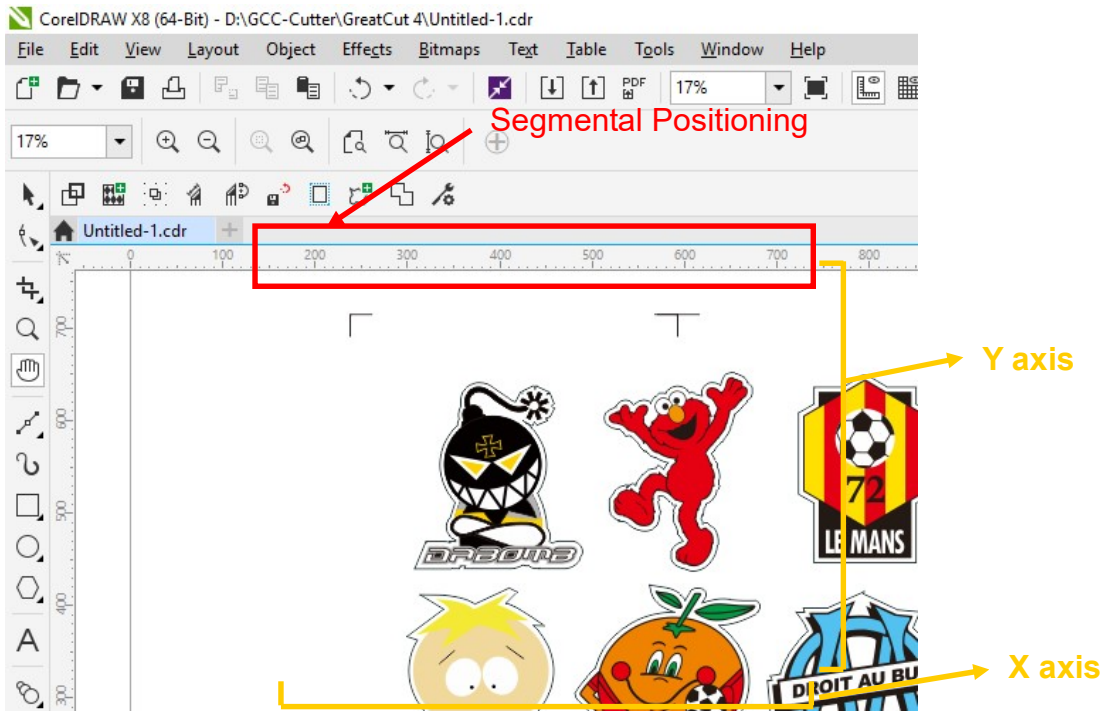

Follow the same steps in the **Output** section to output your image to GCC Cutting Plotter.

Multi-Copy



Step 1 Follow the same steps in the **4-Point Positioning** section to complete the contour line setting and registration mark creation procedures.

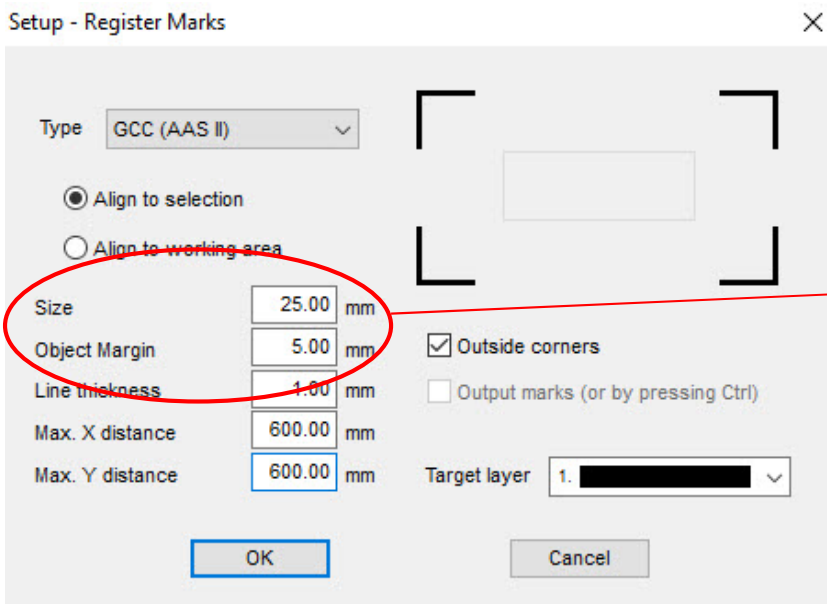

When you apply the “Multiple Copies” function, the value that has been set in this section will still be applied.


Step 2 Click on the Set Jog Marks icon on the GreatCut toolbar and 4 marks will be created as

shown in the picture below.

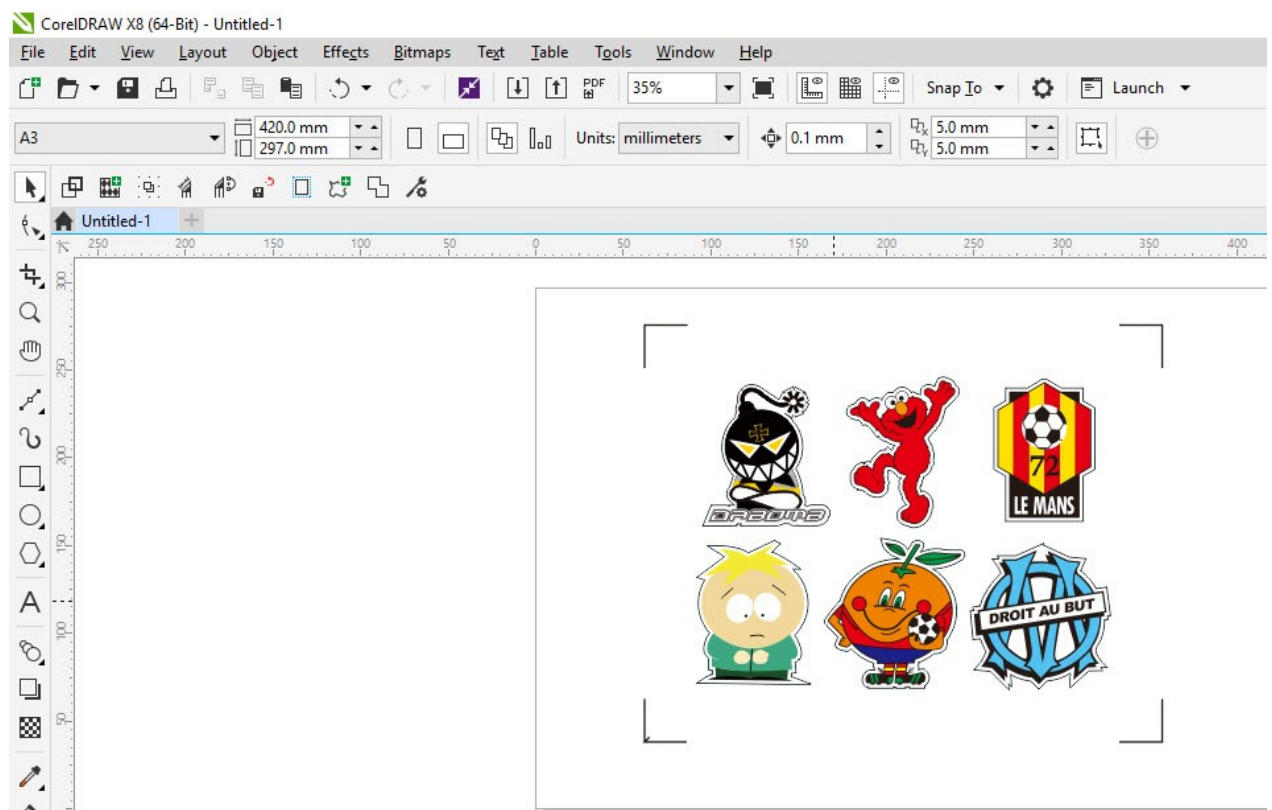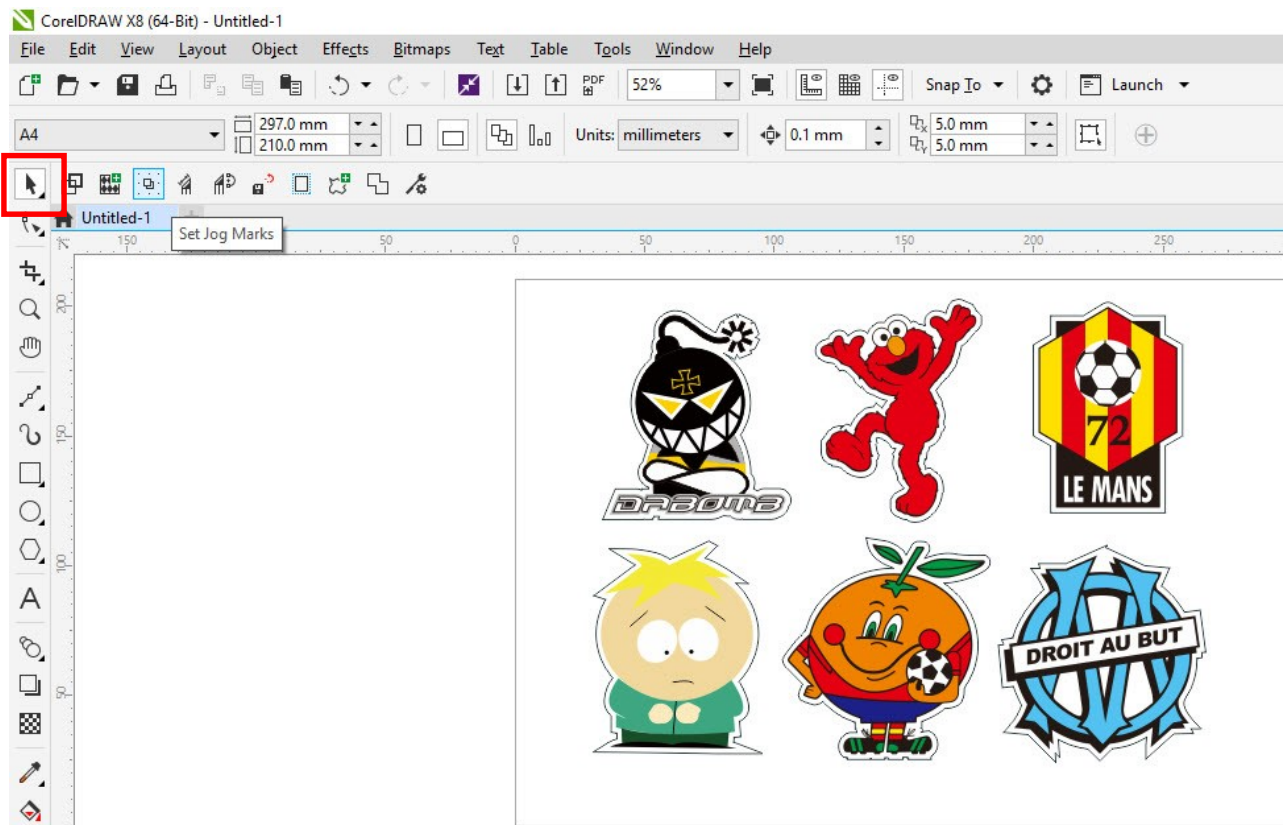


Step 3 Select both the entire object (including registration marks and the contour line) and press


the Cut icon on the GreatCut toolbar.

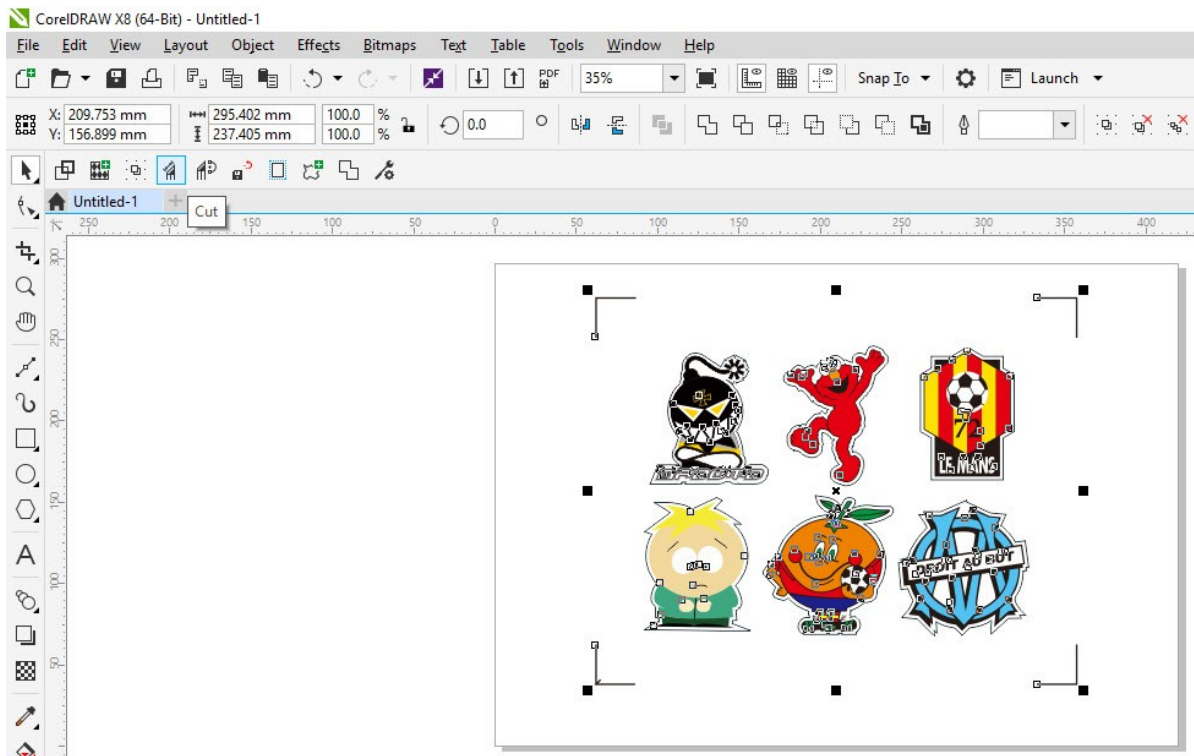


Step 4 The system will activate GreatCut automatically and import the registration marks and contour line to GreatCut.

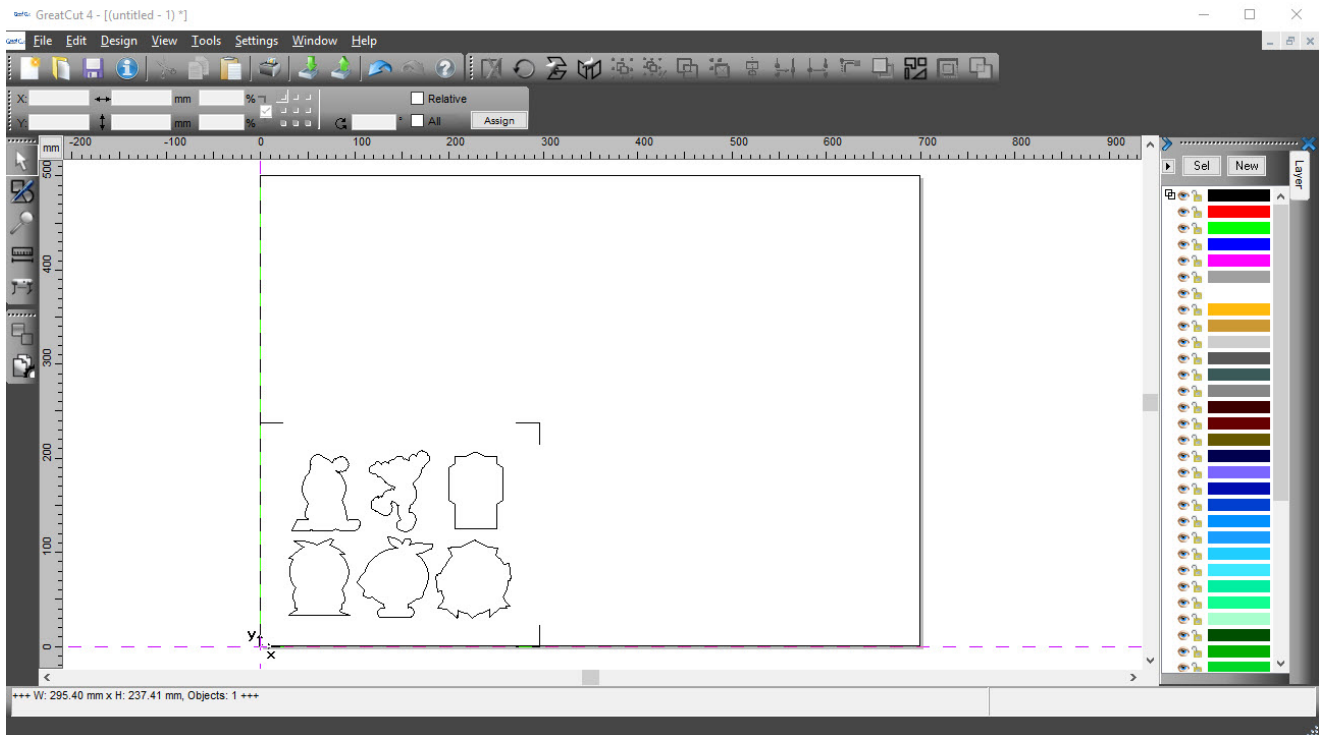


Step 5 Select Output under File.

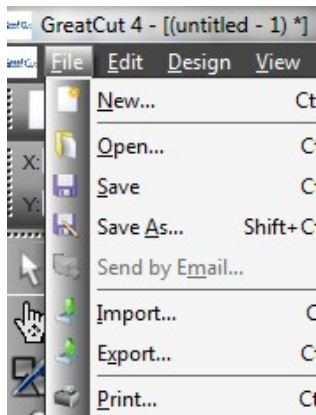


Step 6 Select Mode as “Cut with AAS” and input the Number of outputs in X-direction and Y-direction and Distance between copies, please don't press output button.

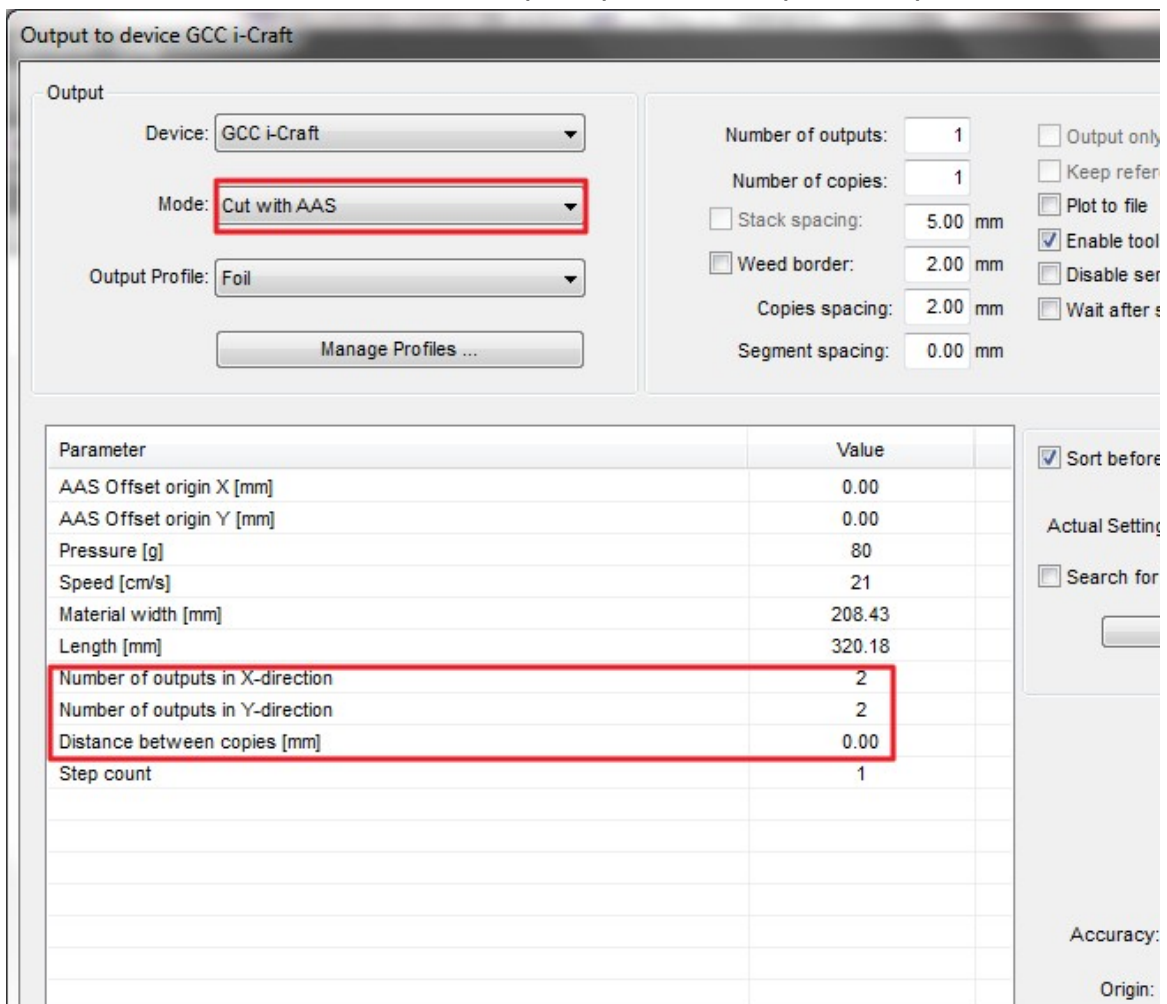

Step 7 Back to CorelDRAW, Click Multi-Copy on GreatCut under File.

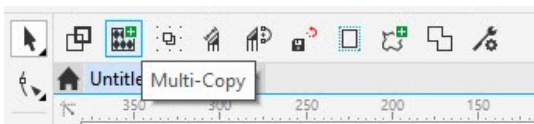


Step 8 Complete the Number in X/Y (the number of copies desired on the X/Y axis) and Distance in X/Y (distance between each copy) settings then click OK. Confirm that the value of Distance in X/Y must be the same with step 6.

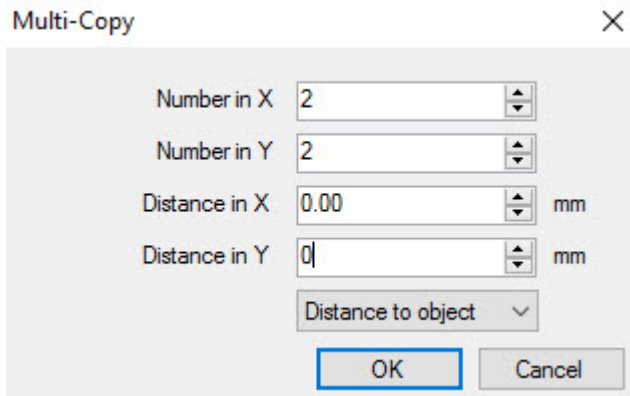


Note: The spacing of vertical & horizontal (Offset X & Y) should be $\geq 20\text{mm}$ or $= 0\text{mm}$; users are advised to set the Distance in X/Y as 0 mm to remove the space between each copy to avoid the waste of materials.


Step 9 The system will create several copies of the object with registration marks as shown in the picture below.

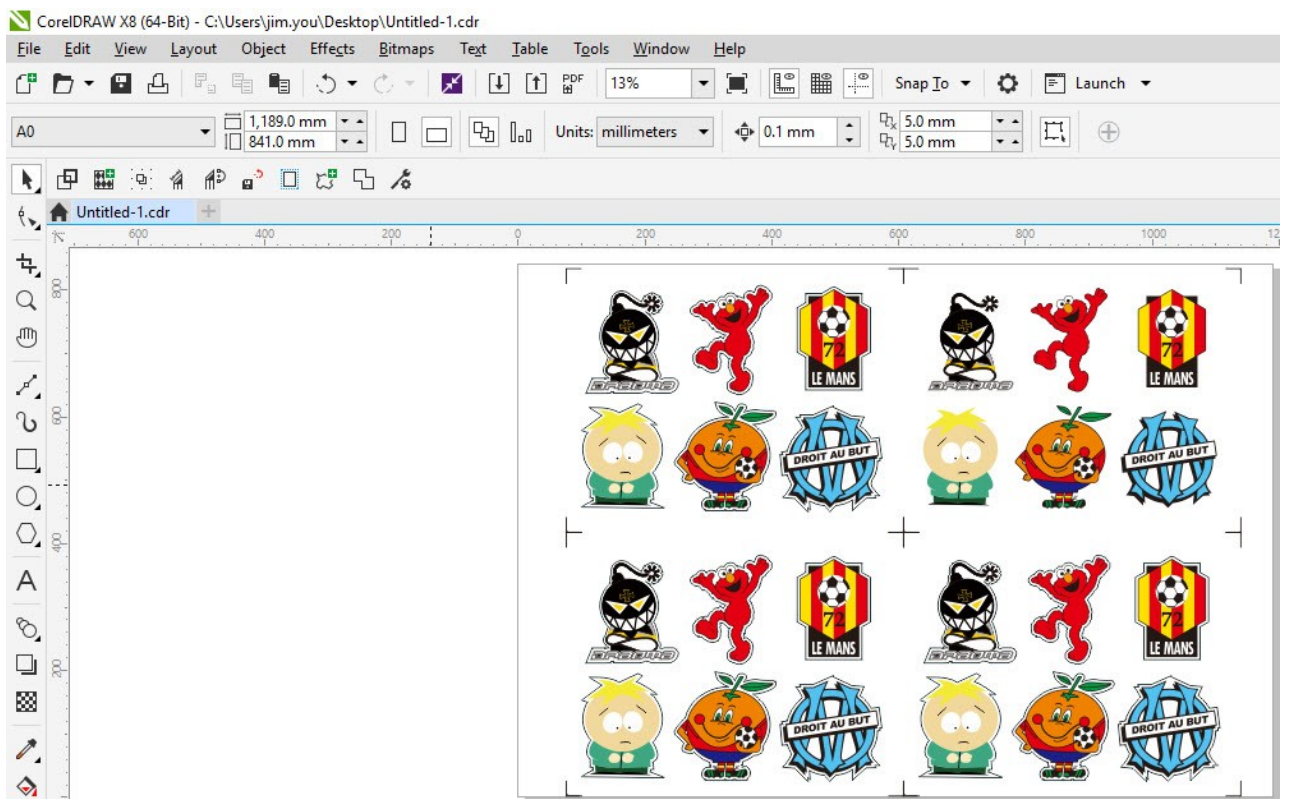

Step 10 Print the Multi-Copy images out, and put the printed media on the GCC cutting plotter.

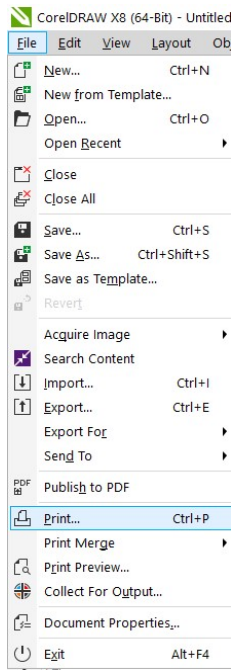

Step 11 Go to GreatCut window, press Output button.

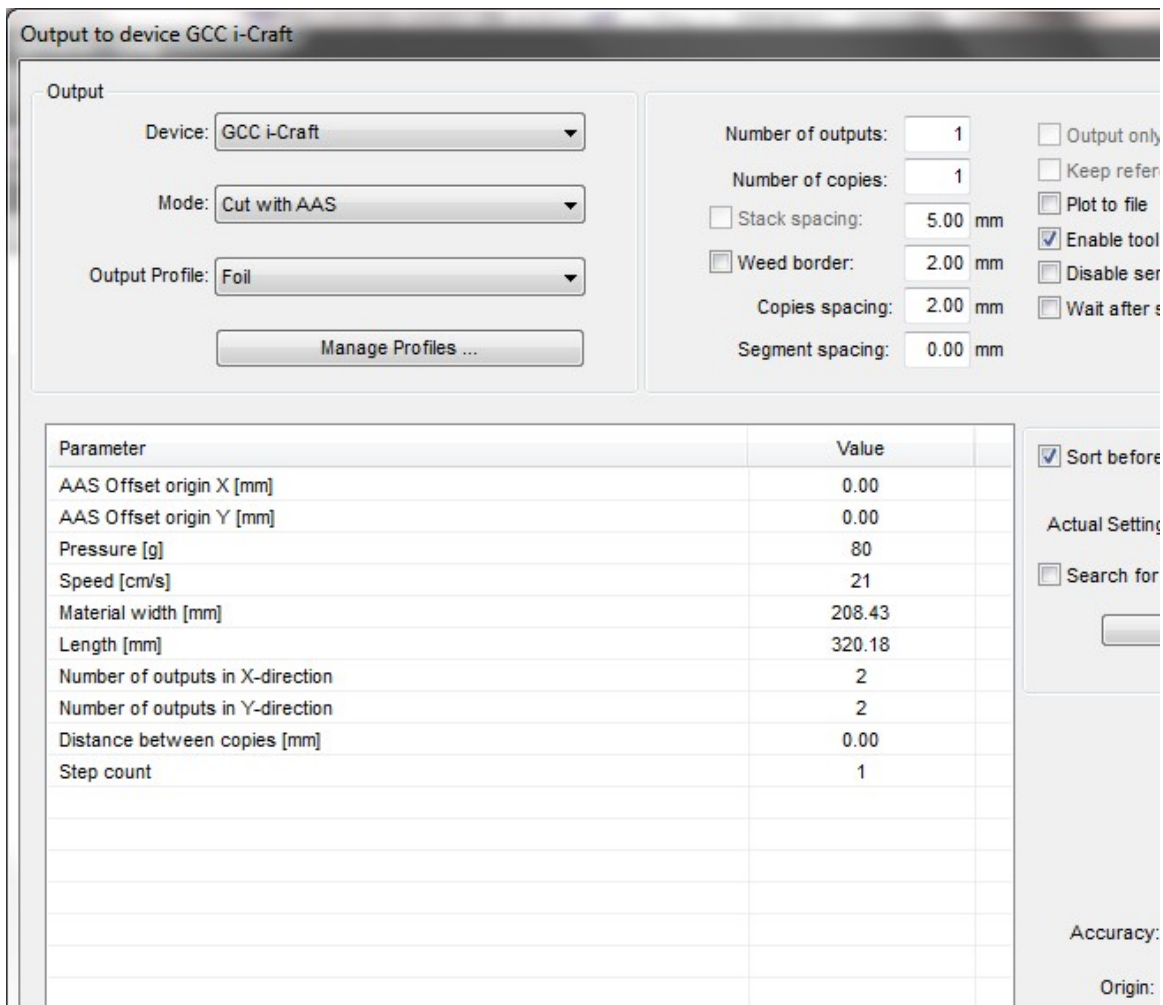


Edit your image in Adobe Illustrator

4-Point Positioning


Step 1 Create a new file in Adobe Illustrator.



Step 2 Select the image and go to Contour in GreatCu in File.

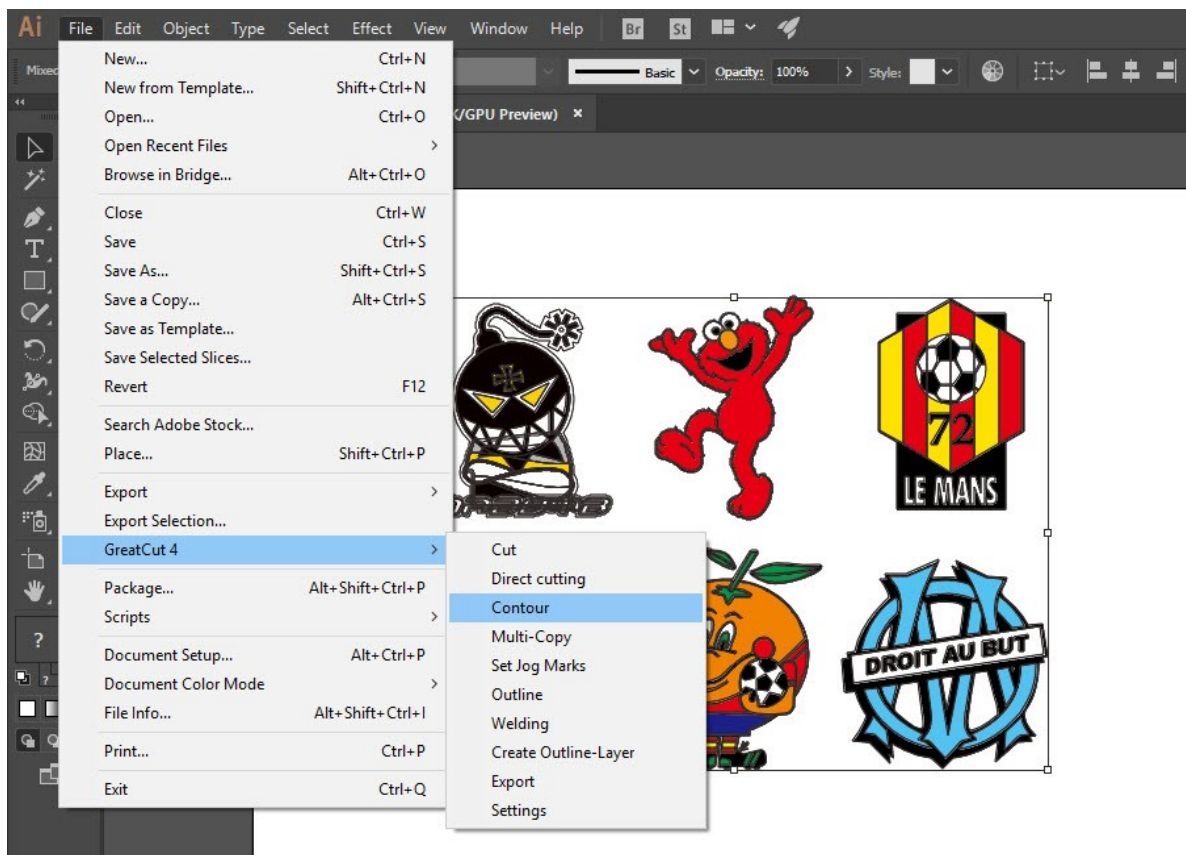

Step 3 Complete contour line settings (including contour offset value) and press Calculate to confirm.

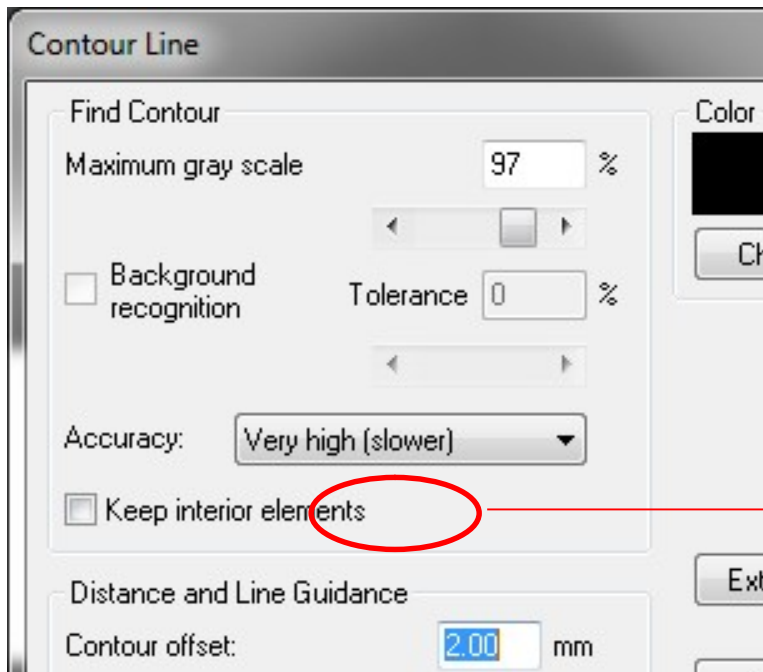


Contour offset is the distance between the object and the contour line.

Contour line is now added to the object.



Tips: Vector object to create round outline


In general for vector objects you will get better results with the outline function. You will see the difference between "Normal" and "Round" in sharp corners. The picture is shown as below:

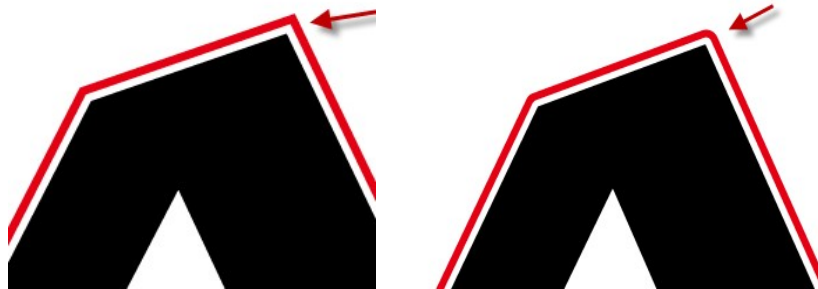

Normal

Round


1. Select the "Outline" in GreatCut option under File to create contours in a freely definable distance around text objects.

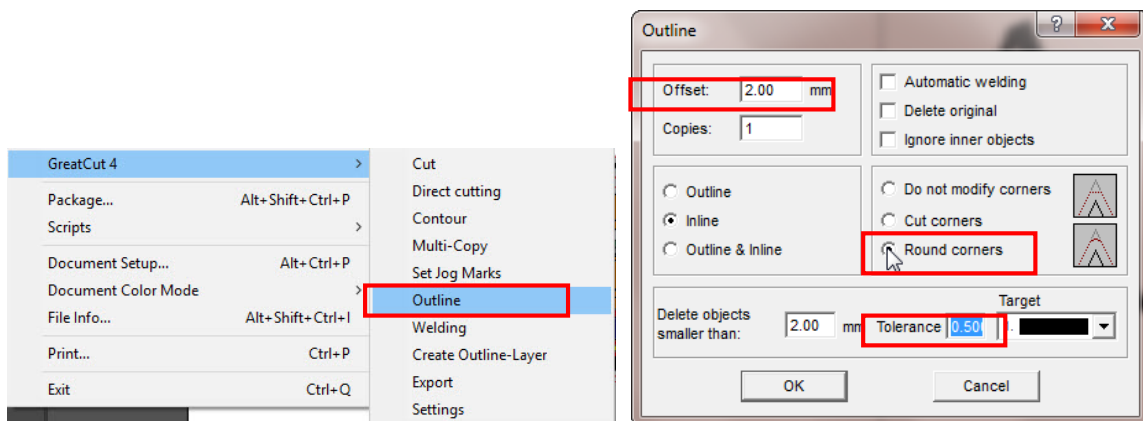


2. Select "Round corners" and set the value of "offset" and "tolerance."

Offset is the value for the distance of the inline and outline from the original object. The field **tolerance** indicates in which offset from the corner dot is cut respectively rounded.

Step 4 Click Settings on GreatCut under File.

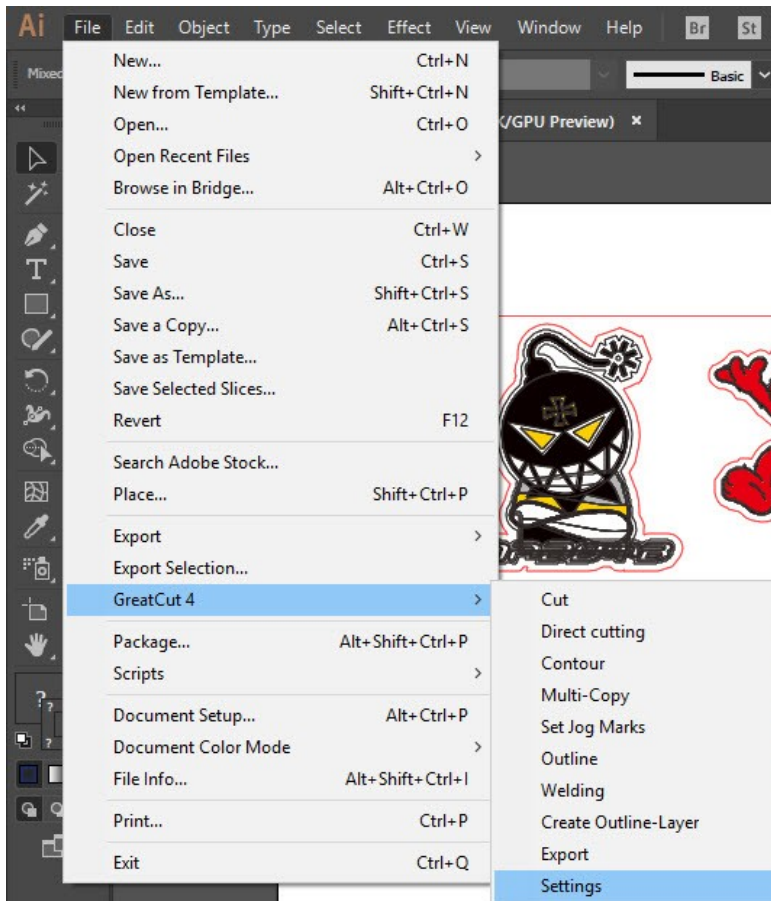

Step 5 Press the button on the right of Jog marks.

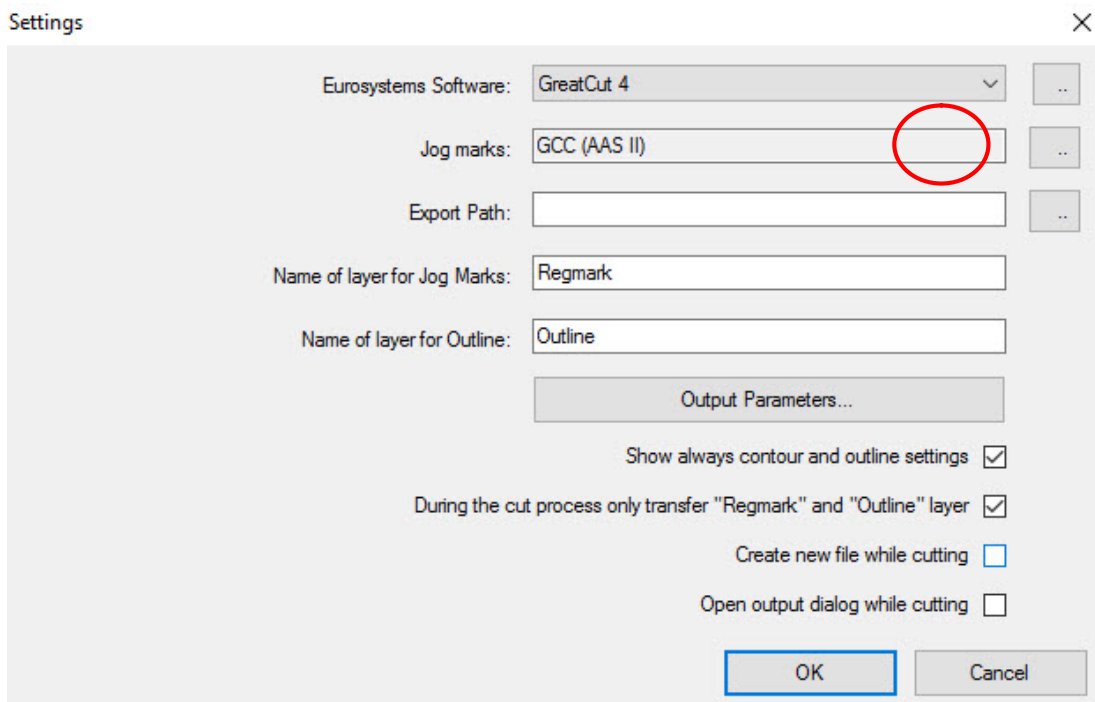

Step 6 Adjust the size, object margin and line thickness of your registration marks and click OK.

Setup - Register Marks

Type: GCC (AAS II)


Align to selection
 Align to working area

Size: 25.00 mm
Object Margin: 5.00 mm
Line thickness: 1.00 mm
Max. X distance: 600.00 mm
Max. Y distance: 600.00 mm

Outside corners
 Output marks (or by pressing Ctrl)

Target layer: 1.

OK Cancel



4-Point Positioning

- **Size:** The length of marks
→ Range: 5mm~50mm
→ Optimized Setting: 25mm
- **Object margin:** The distance between marks and images
→ Range: 0mm~50mm
→ Optimized Setting: 5mm
- **Line thickness:** the line thickness of marks
→ Range: 1mm~2mm
→ Optimized Setting: 1mm

Step 7 Ensure the three items below are selected and click OK.

Settings

Eurosystems Software: GreatCut 4

Jog marks: GCC (AAS II)

Export Path:

Name of layer for Jog Marks: Regmark

Name of layer for Outline: Outline

Output Parameters...

Show always contour and outline settings


During the cut process only transfer "Regmark" and "Outline" layer

Create new file while cutting


Open output dialog while cutting

OK Cancel

Step 8 Click Set Jog Marks on GreatCut under File.

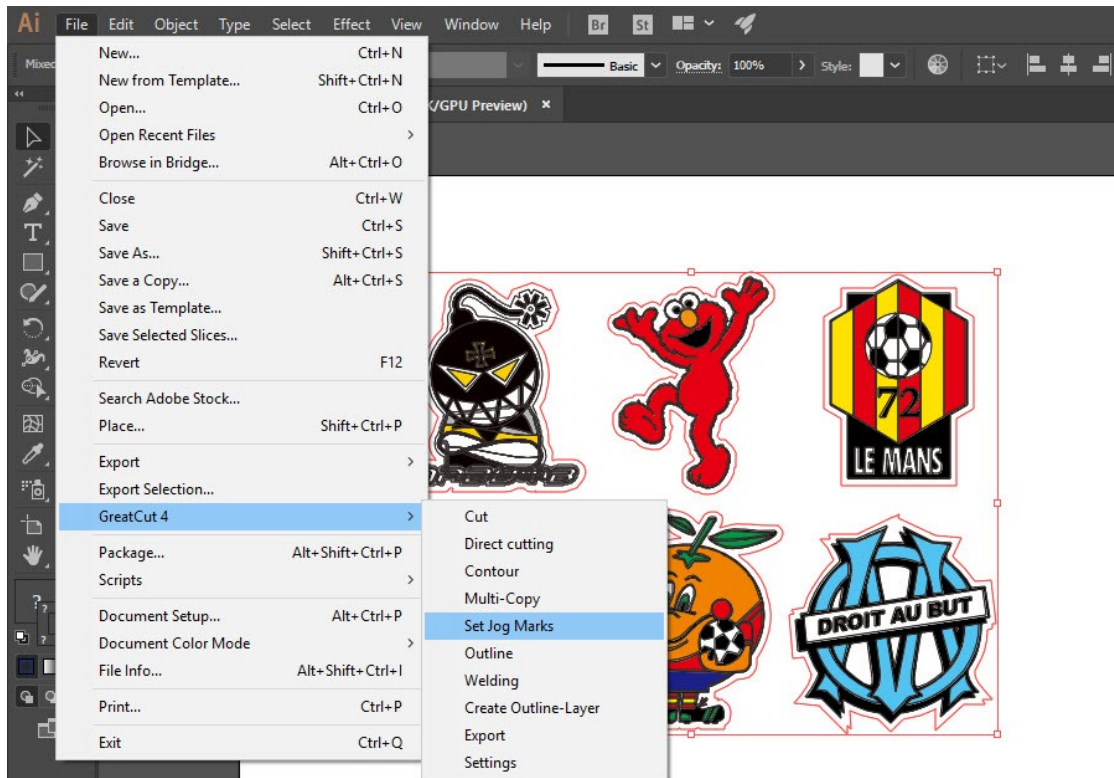


The system will create the 4 marks as shown in the picture below.

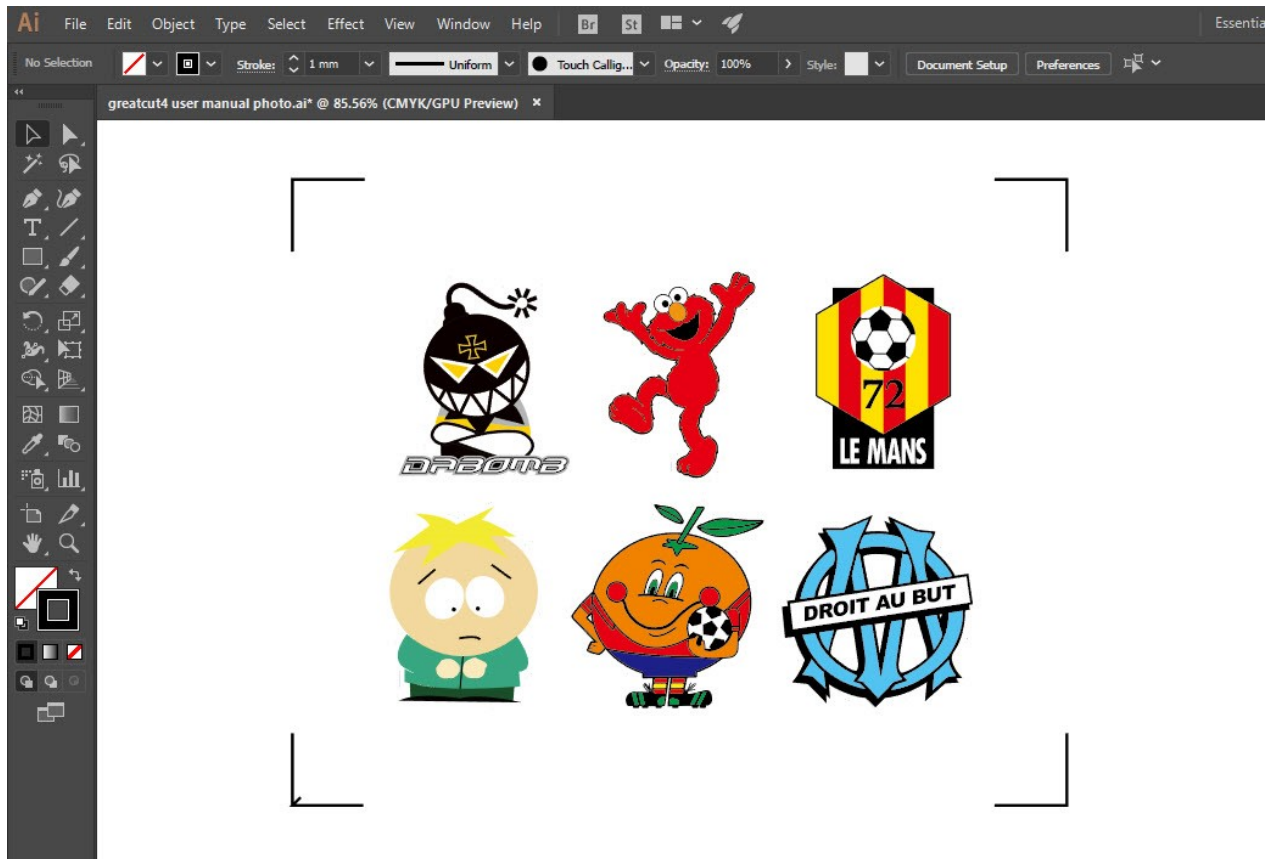


Output


Step 1 Select both the entire object (including registration marks and the contour line) then click Cut on GreatCut under File.

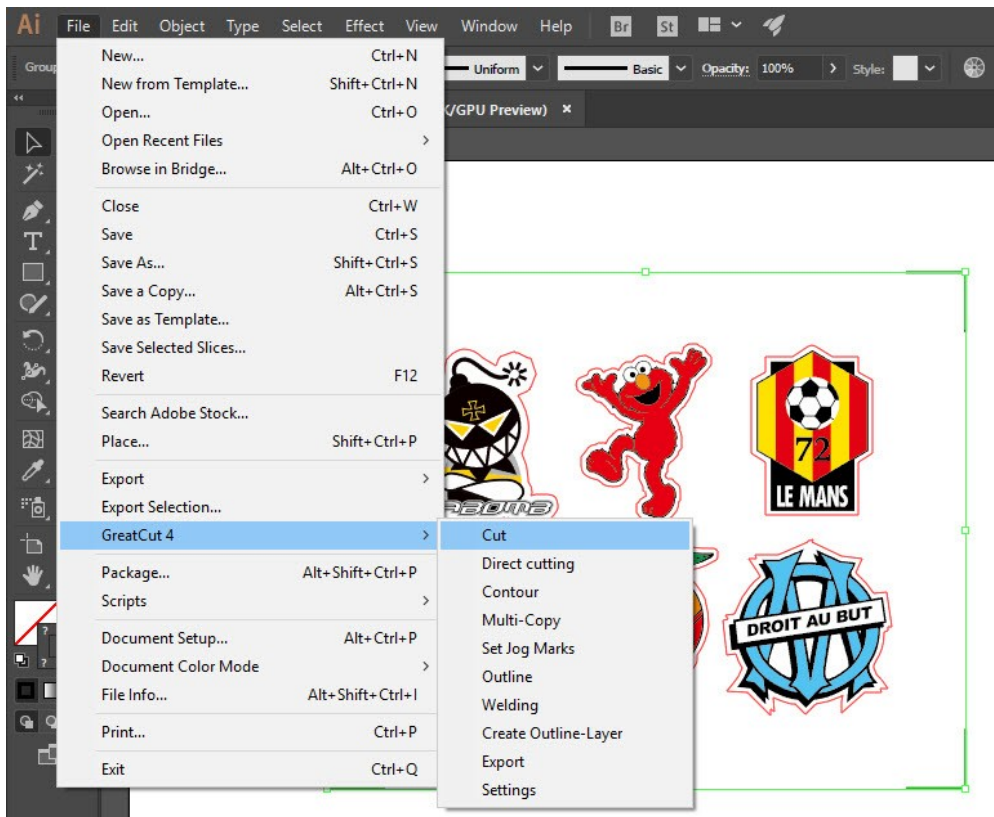


Step 2 The system will activate GreatCut automatically and import the registration marks and contour line to GreatCut.

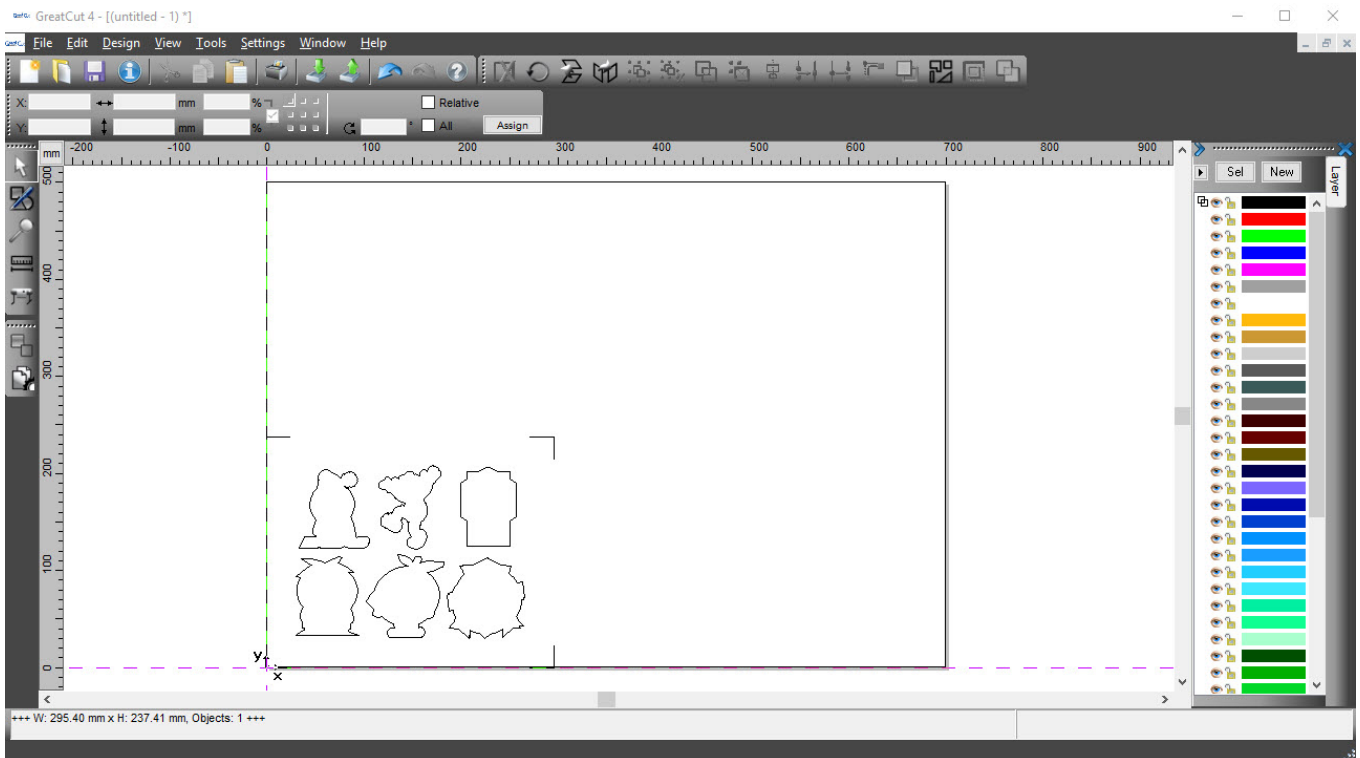

Step 3 Select Output under File.

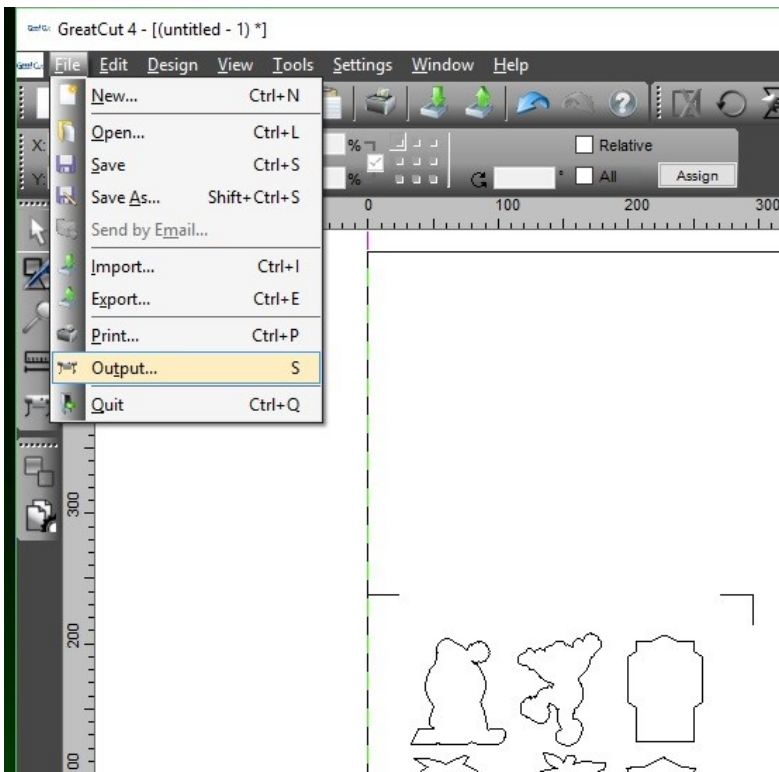

Step 4 Select Cut with AAS in Mode/Tool in the Output to device window.

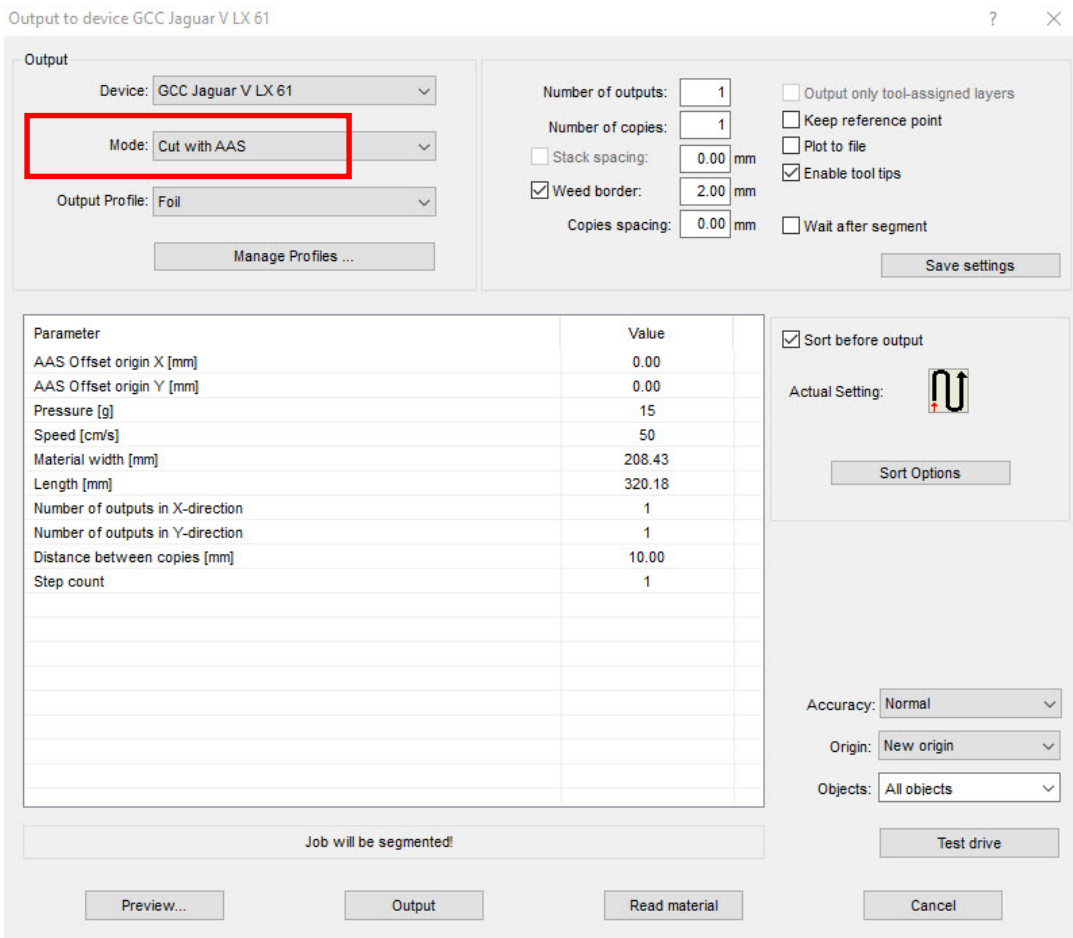

Step 5 Click output and the object will be sent to GCC Cutting Plotter

Output to device GCC Jaguar V LX 61 ? X

Output

Device: GCC Jaguar V LX 61 ▾

Mode: Cut with AAS ▾

Output Profile: Foil ▾

Manage Profiles ...

Number of outputs: 1

Number of copies: 1

Stack spacing: 0.00 mm

Weed border: 2.00 mm

Copies spacing: 0.00 mm

Output only tool-assigned layers

Keep reference point

Plot to file

Enable tool tips

Wait after segment

Save settings

Parameter	Value
AAS Offset origin X [mm]	0.00
AAS Offset origin Y [mm]	0.00
Pressure [g]	15
Speed [cm/s]	50
Material width [mm]	208.43
Length [mm]	320.18
Number of outputs in X-direction	1
Number of outputs in Y-direction	1
Distance between copies [mm]	10.00
Step count	1

Sort before output

Actual Setting:

Sort Options

Accuracy: Normal ▾

Origin: New origin ▾

Objects: All objects ▾

Test drive

Job will be segmented!

Preview...

Output

Read material

Cancel

Note: The difference amount Number of outputs, Number of copies, and Step count in the Output window.

Output to device GCC Jaguar V LX 61

Output

Device: GCC Jaguar V LX 61

Mode: Cut with AAS

Output Profile: Foil

Manage Profiles ...

Number of outputs: 1

Number of copies: 1

Stack spacing: 0.00 mm

Weed border: 2.00 mm

Copies spacing: 0.00 mm

Output only tool-assigned layers

Keep reference point

Plot to file


Enable tool tips

Wait after segment

Save settings

Parameter	Value
AAS Offset origin X [mm]	0.00
AAS Offset origin Y [mm]	0.00
Pressure [g]	15
Speed [cm/s]	50
Material width [mm]	208.43
Length [mm]	320.18
Number of outputs in X-direction	1
Number of outputs in Y-direction	1
Distance between copies [mm]	10.00
Step count	1

Sort before output

Actual Setting: 

Sort Options

Accuracy: Normal

Origin: New origin

Objects: All objects

Test drive

Job will be segmented!

Preview... Output Read material Cancel



1. When **Number of outputs** is set as 2, the square and the triangle will be cut 1 time and then the square and the triangle will be cut 1 time at next position.
2. When **Number of copies** is set as 2, the square and the triangle will be cut 2 times at the same position.
3. When **Step count** is set as 2, the square will be cut 2 times at the same position and then the triangle will be cut will be cut 2 times at the same position.


Advanced Settings

Segmental Positioning


For precise cutting quality, it is suggested to apply “Segmental Positioning” by adjusting the x and y distance when you are working on an extra long or large-size image to increase cutting quality.

Follow the same steps in the **4-Point Positioning** section to complete the contour line setting and registration mark creation procedures. Adjust the size, object margin and line thickness of your registration marks and the space between registration marks by changing X, Y distance in the Setup-Jog Marks window and click OK.


Step 1 Click Settings on GreatCut under File.

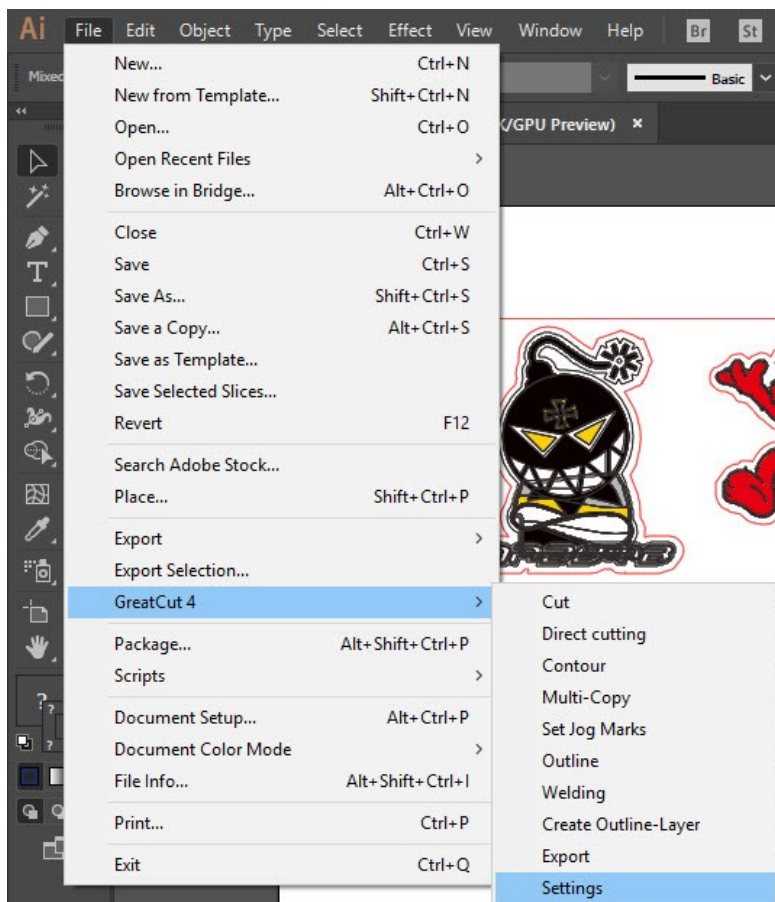

Step 2 Press the button on the right of Jog marks.

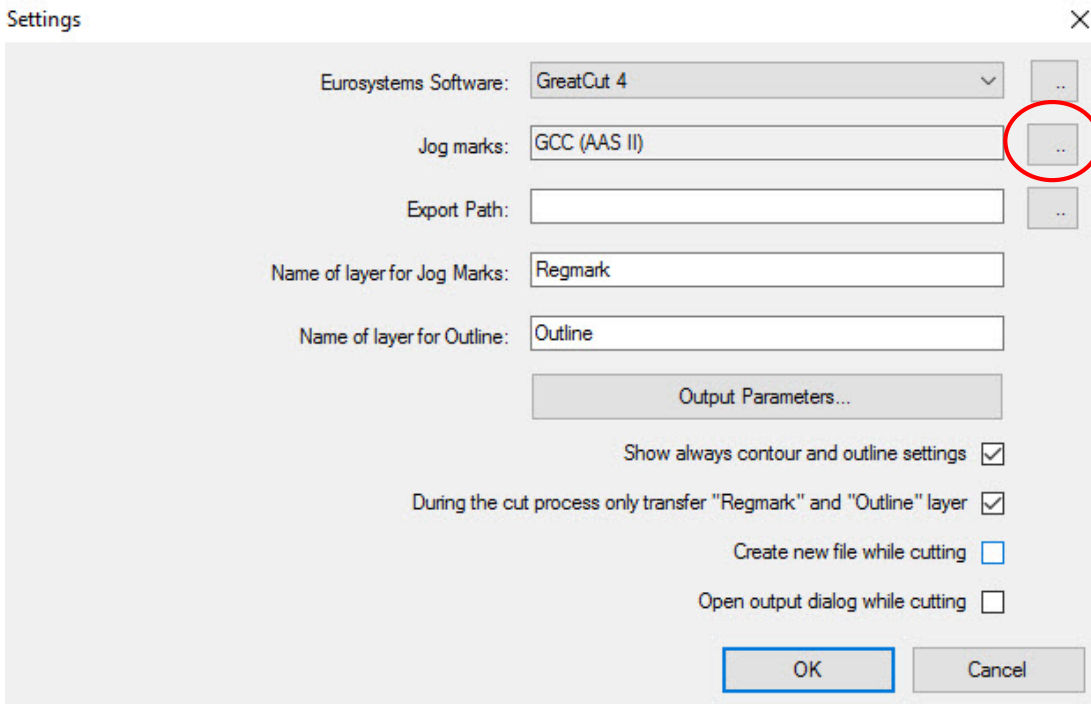



Step 3 Adjust the size, object margin and line thickness of your registration marks and click OK.

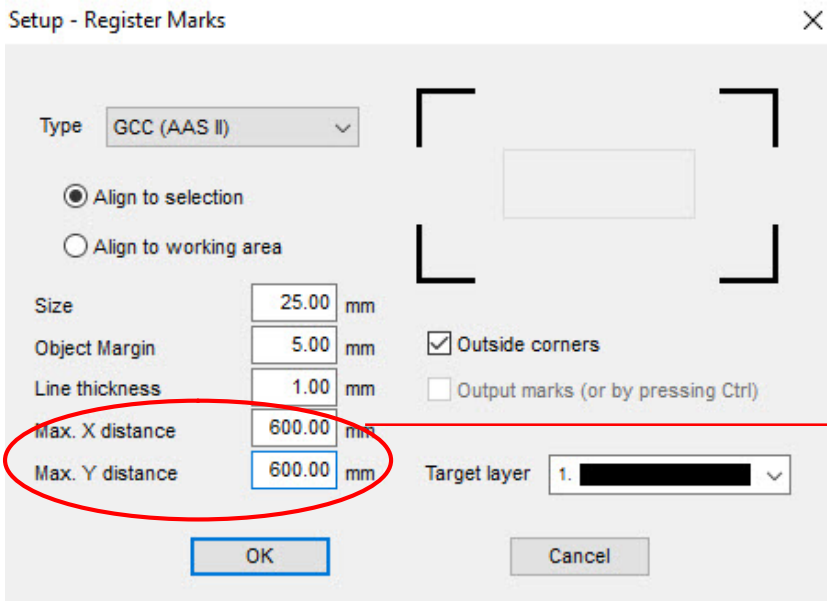

Segmental Positioning


- **Max. x Distance:** The distance of intermediate position on the X axis
→ Range: 200-500 mm
- **Max. y Distance:** The distance of intermediate position on the Y axis
→ Range: 200-500 mm

Step 4 Select the Set Jog Marks on GreatCut under File and 4 marks will be created as shown in the picture below.

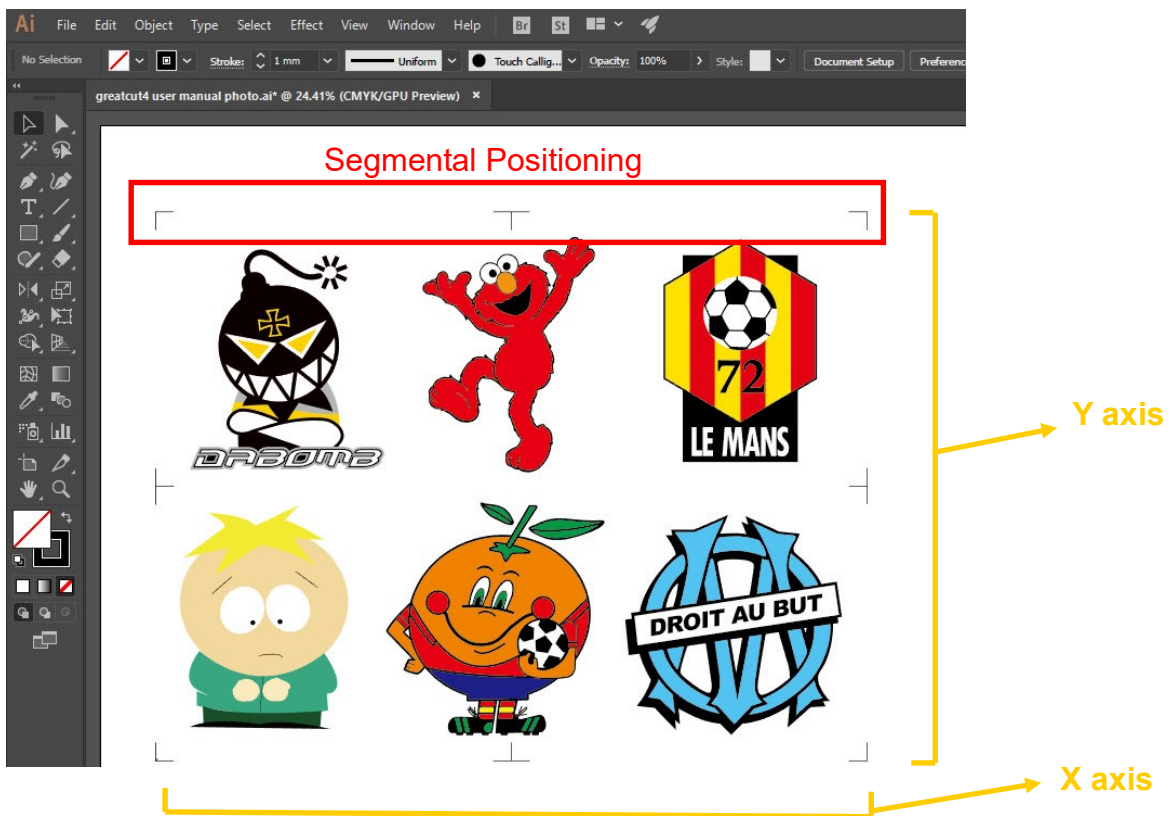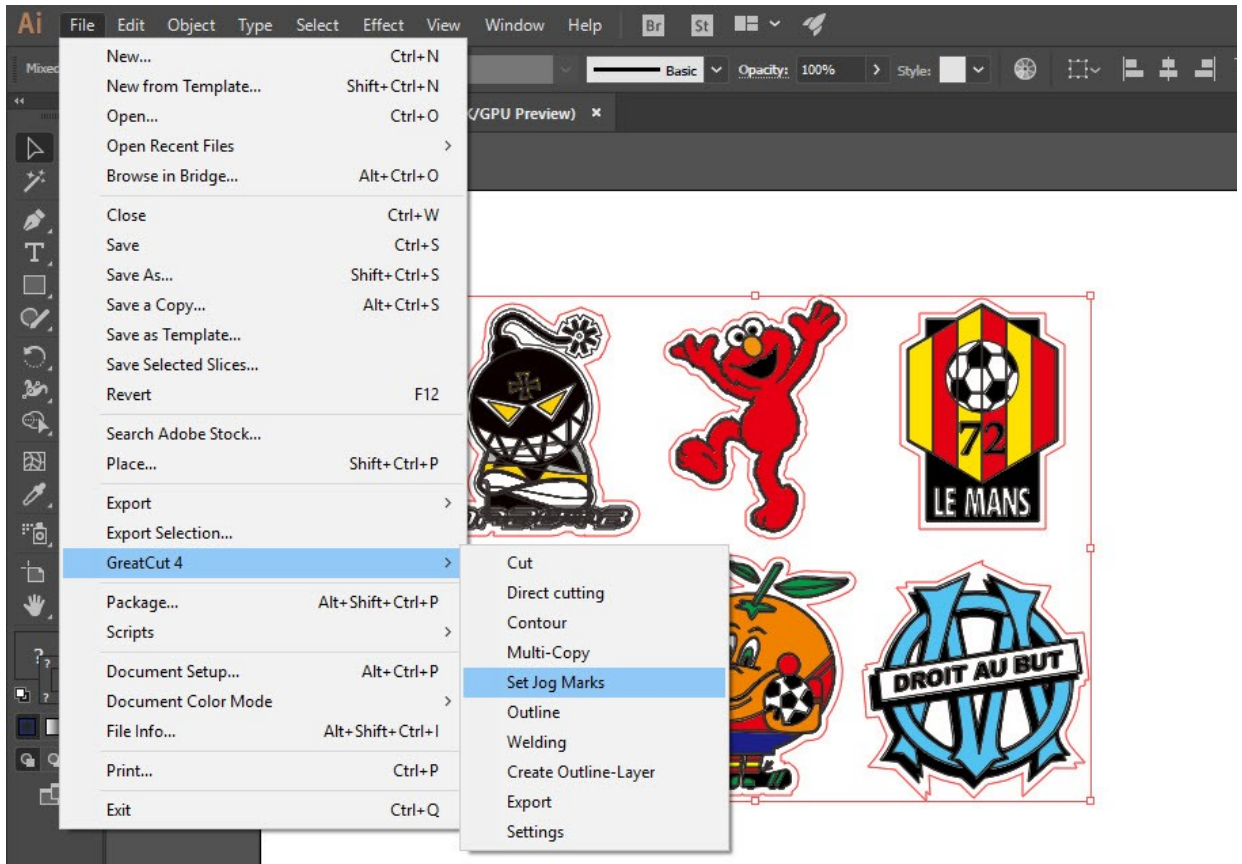


Multi-Copy

Step 1 Follow the same steps in the **4-Point Positioning** section to complete the contour line setting and registration mark creation procedures.

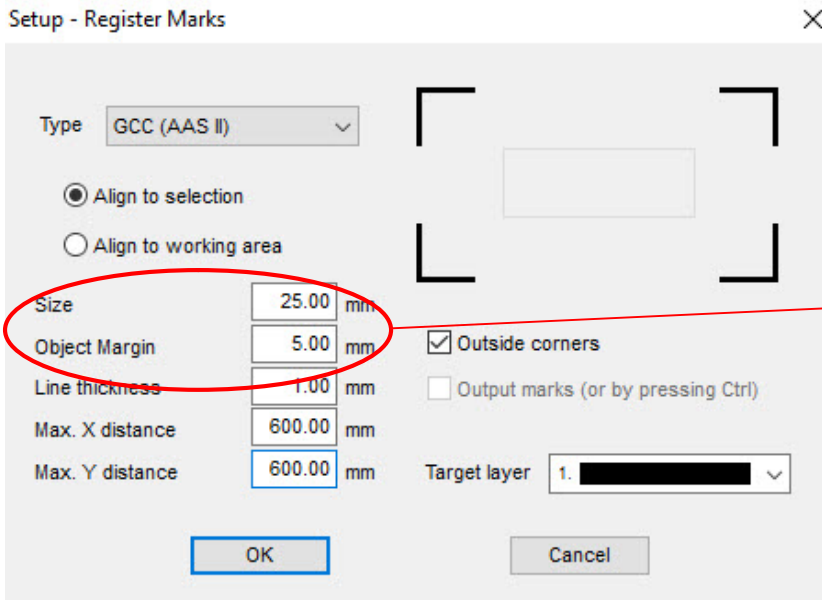

When you apply the “Multiple Copies” function, the value that has been set in this section will still be applied.


Step 2 Select the Set Jog Marks on GreatCut under File and 4 marks will be created as shown in the picture below.

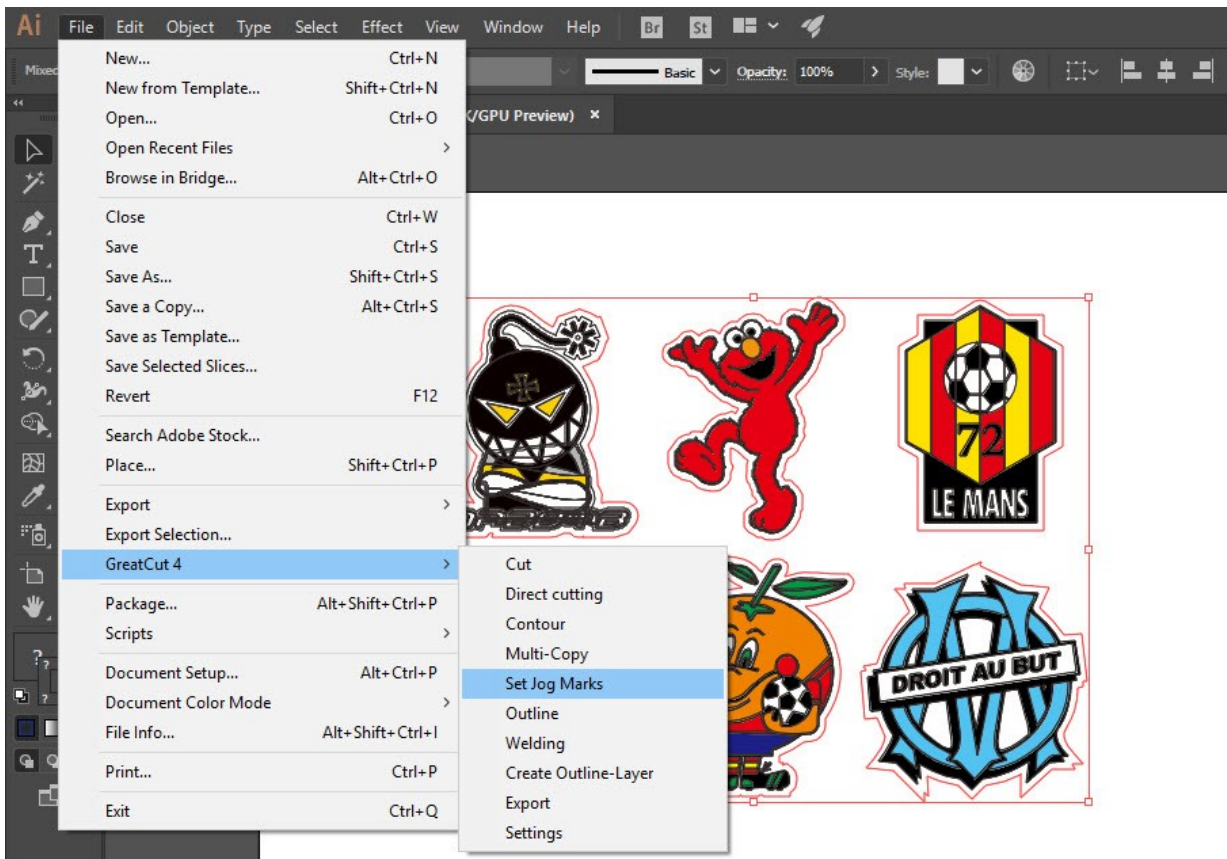




Step 3 Select both the entire object (including registration marks and the contour line) then click Cut on GreatCut under File.




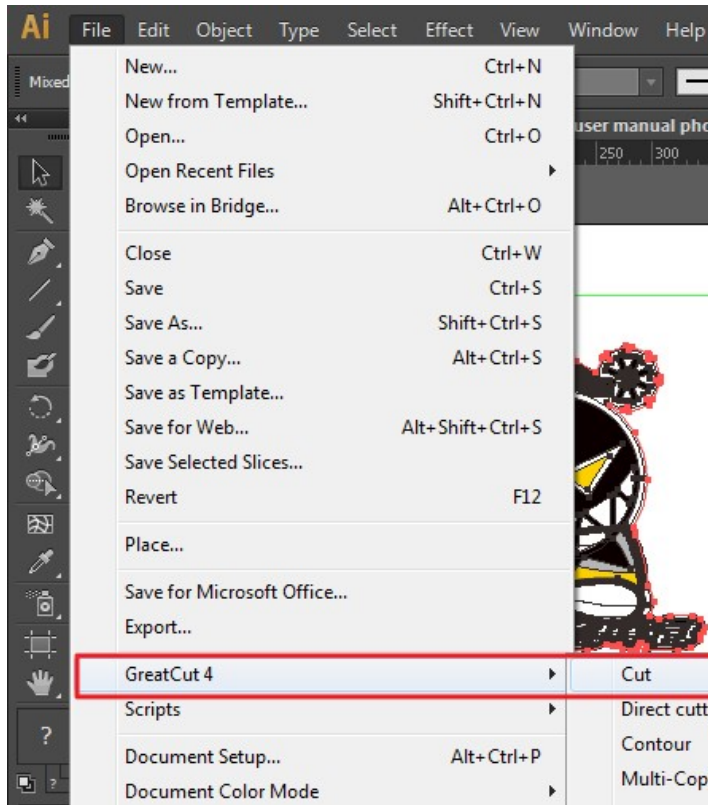


Step 4 The system will activate GreatCut automatically and import the registration marks and contour line to GreatCut.

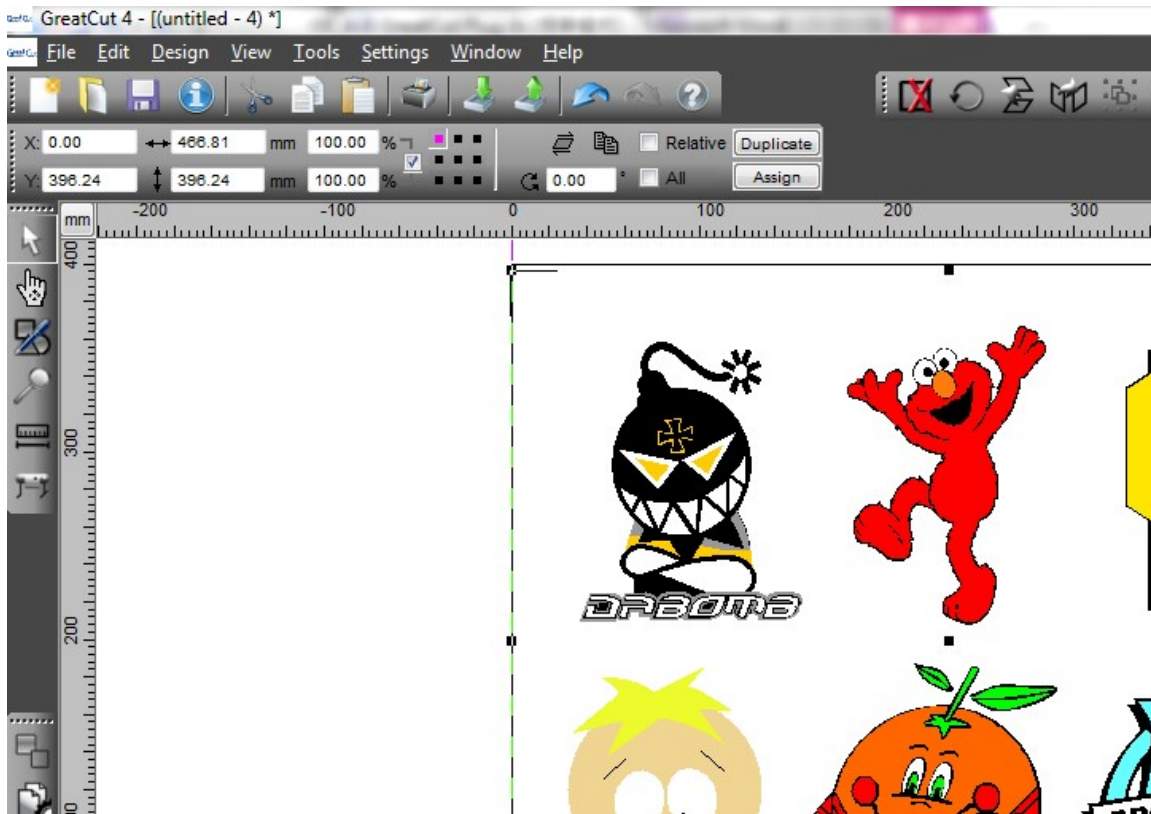


Step 5 Select Output under File.

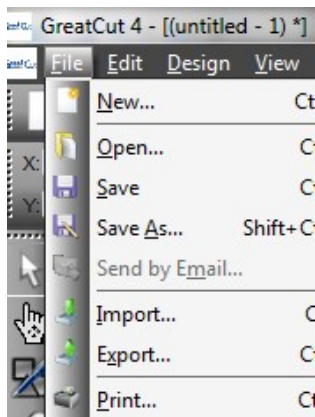


Step 6 Select Mode as “Cut with AAS” and input the Number of outputs in X-direction and Y-direction and Distance between copies, please don’t press output button.

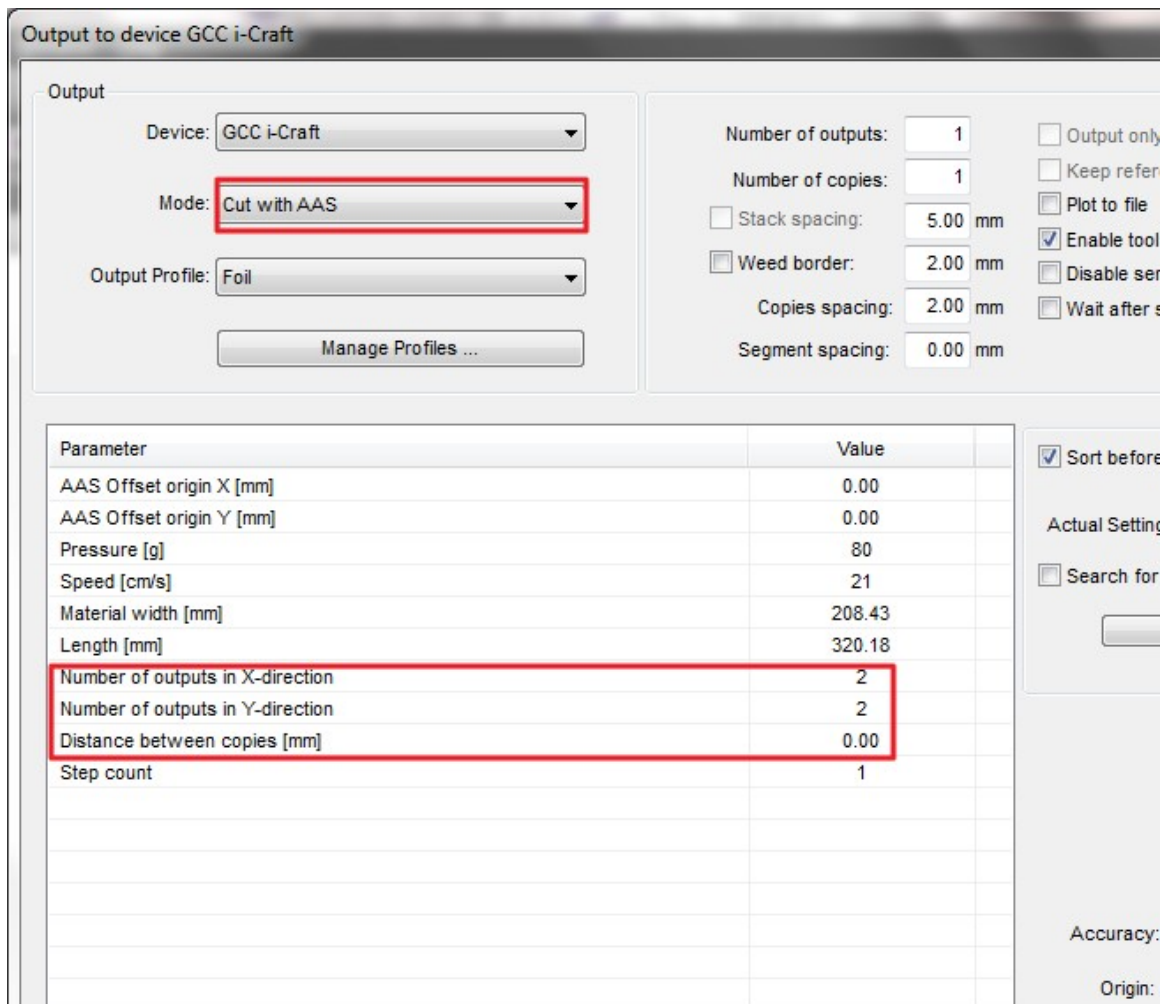

Step 7 Back to Adobe Illustrator, Click Multi-Copy on GreatCut under File.

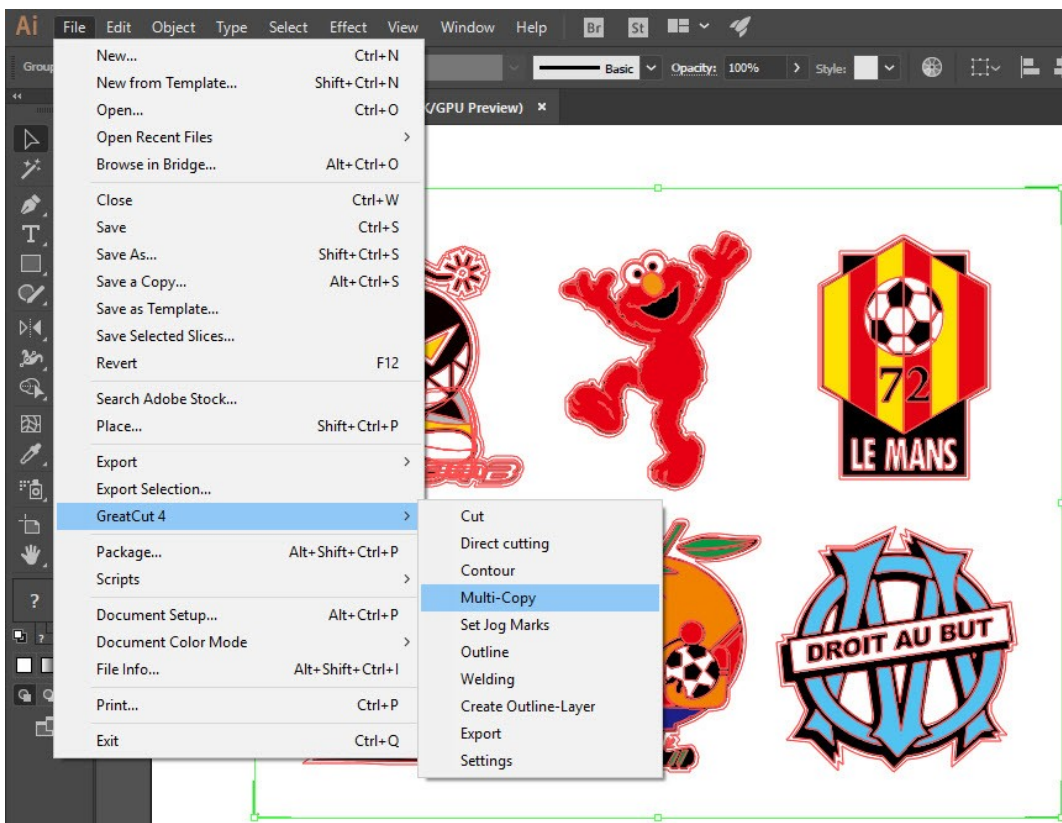


Step 8 Complete the Number in X/Y (the number of copies desired on the X/Y axis) and Distance in X/Y (distance between each copy) settings then click OK. Confirm that the value of Distance in X/Y must be the same with step 6.

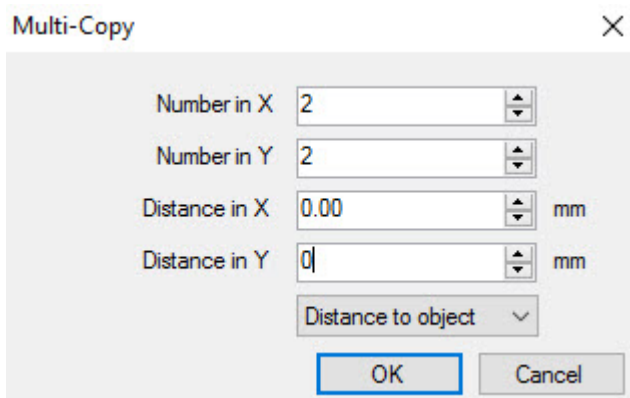


Note: The spacing of vertical & horizontal (Offset X & Y) should be $\geq 20\text{mm}$ or $= 0\text{mm}$; users are advised to set the Distance in X/Y as 0 mm to remove the space between each copy to avoid the waste of materials.

Step 9 The system will create several copies of the object with registration marks as shown in the picture below.

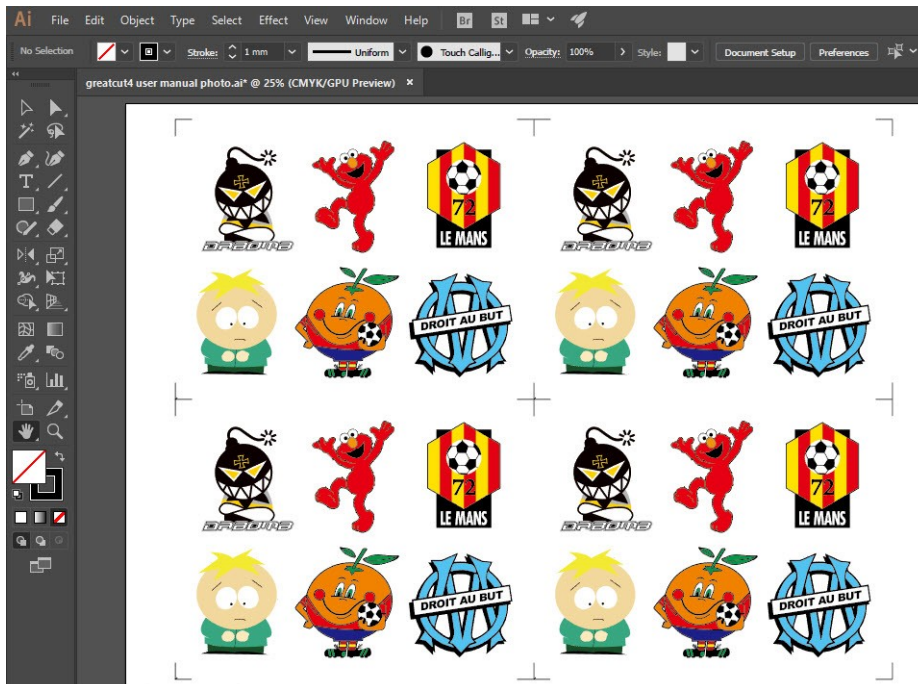

Step 10 Print the Multi-Copy images out, and put the printed media on the GCC cutting plotter.

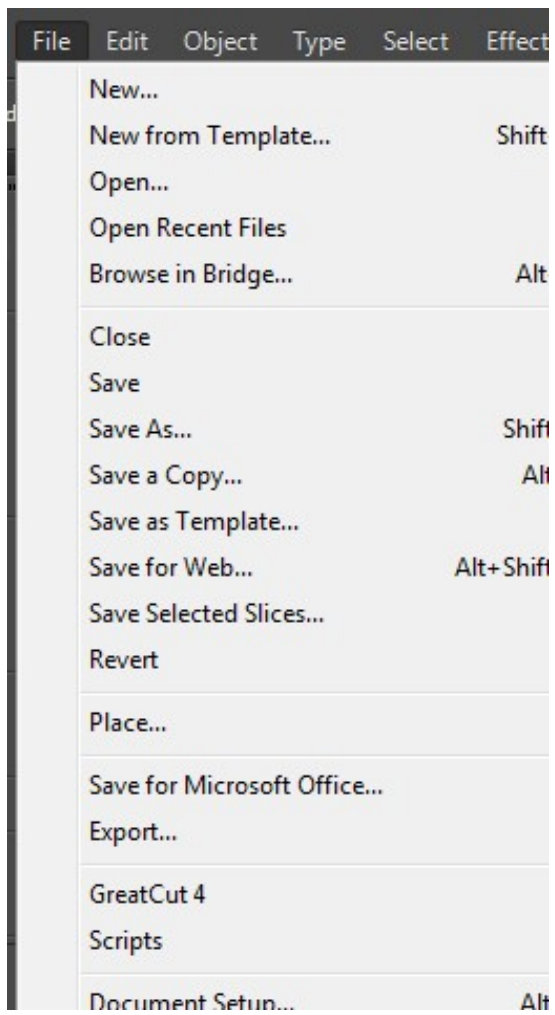

Step 11 Go to GreatCut window, press Output button.

Output to device GCC i-Craft

Output

Device: GCC i-Craft

Mode: Cut with AAS

Output Profile: Foil

Manage Profiles ...

Number of outputs: 1 Output only

Number of copies: 1 Keep refer

Stack spacing: 5.00 mm Plot to file

Weed border: 2.00 mm Enable tool

Copies spacing: 2.00 mm Disable ser

Segment spacing: 0.00 mm Wait after s

Parameter	Value
AAS Offset origin X [mm]	0.00
AAS Offset origin Y [mm]	0.00
Pressure [g]	80
Speed [cm/s]	21
Material width [mm]	208.43
Length [mm]	320.18
Number of outputs in X-direction	2
Number of outputs in Y-direction	2
Distance between copies [mm]	0.00
Step count	1

Sort before

Actual Setting

Search for

Accuracy:

Origin:

SignPal Instruction

The SignPal Software is Windows System compatible and all versions support the AAS II contour cutting function.


SignPal Instruction Index:

- [1] Installing the SignPal software
- [2] Set up your GCC Cutter on Production Manager
- [3] SignPal AAS II Quick Start
- [4] SignPal Features List

[1] Installing the SignPal software

To install the software, you must have Administrator privileges. To use the software, you must have Administrator or Power User privileges. See your Windows user guide for more information.

1. Uninstall any previous version of the software.
2. Visit GCC website (<https://www.gccworld.com/download.php?act=view&id=20>) to download the WinRAR file.

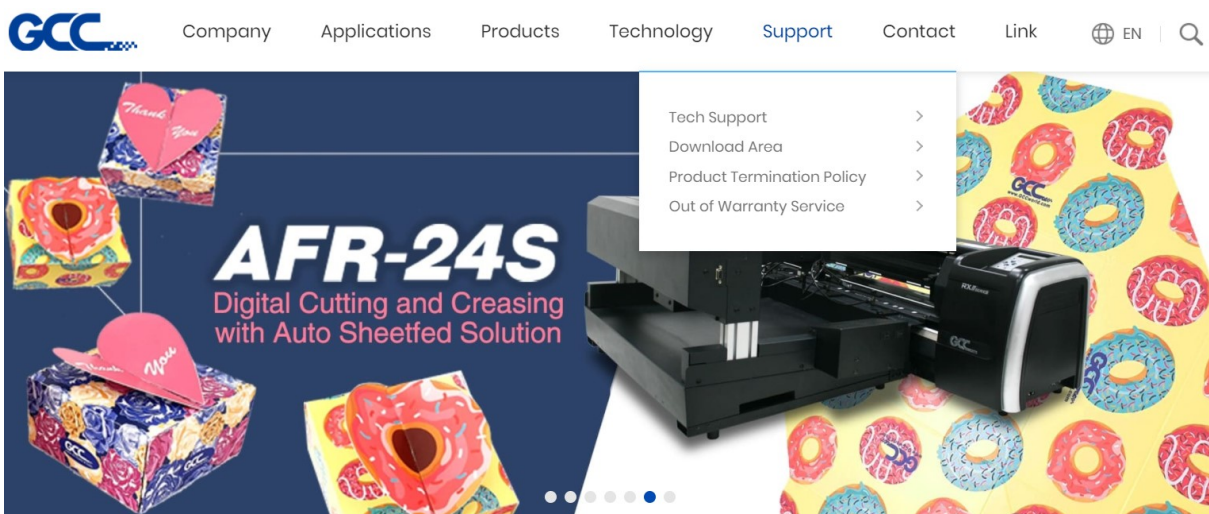

Download Area

Download Area

enter keywords to search

SEARCH

Or browse by machine model



Vinyl Cutter



Laser Engraver



Laser Cutter



Download Area

Vinyl Cutter

Vinyl Cutter



Expert II A



i-Craft™ 2.0



AR-24



Expert II



Puma IV



Jaguar V / Jaguar V (PPF)



RX II / RX II (Creasing)



Software		
Title	Size	Download
SignPal V19	817 MB	Download
GreatCut 4 for Windows (V.17.0.20.21868)	294MB	Download

3. Follow the installation and activation instruction for SignPal below.

(1) Install and activate software on an online computer

1. Launch your browser and type <https://www.saicloud.com> in address bar and press enter, then input your activation code, then click **Activate**, activation code can be found in the code label in software package.




Activation Code

Please enter the activation code that accompanied your software purchase.

Activation Code

[Activate](#)

2. In login section, click **I am new to the SAi Cloud** and input your email address, then click **Create Account**, an email will be sent to your mailbox.

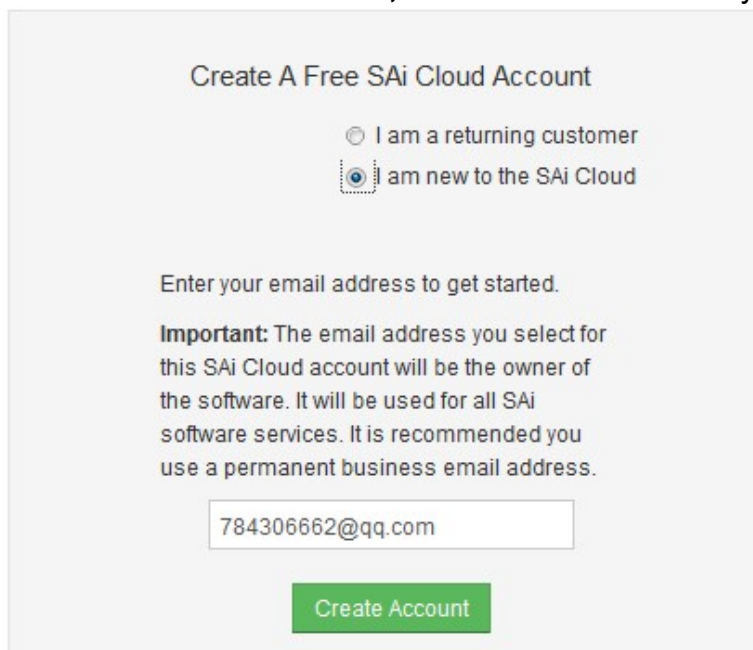

Create A Free SAi Cloud Account

I am a returning customer

I am new to the SAi Cloud

Enter your email address to get started.

Important: The email address you select for this SAi Cloud account will be the owner of the software. It will be used for all SAi software services. It is recommended you use a permanent business email address.

[Create Account](#)

3. Check your mailbox and click website link in the email then complete the information fields.

Create Account

* Email

* Password
Password must be at least 5 characters

* Retype Password

* Name

* Company Name

* Country

* Time Zone

Address Line 1

Address Line 2

City

State/Province

Zip/Postal

Terms And Conditions

Terms and Conditions

User Agreement

IMPORTANT—READ CAREFULLY:

This Account User's Agreement is a legal contract between You (defined below) and SA International Inc.

BY USING YOUR SAI CLOUD ACCOUNT, YOU (AS THIS TERM IS DEFINED BELOW) AGREE BY CLICKING ON THE "ACCEPT" BUTTON TO BE BOUND BY THE TERMS OF THIS AGREEMENT (AS THIS TERM IS DEFINED BELOW), INCLUDING, BUT NOT LIMITED TO, ANY WARRANTY DISCLAIMERS, LIMITATIONS OF LIABILITY, JURISDICTION, AND TERMINATION PROVISIONS. IF YOU DO NOT AGREE TO THE TERMS OF THIS AGREEMENT, DO NOT OPEN AN SAI CLOUD ACCOUNT AND EXIT NOW

Article I. Defined Terms:

1. Account means your account on the SAI Cloud
2. Agreement means this End-User Account Agreement.
3. Entity means any individual, partnership, joint venture, corporation, limited




Step 2. Add Software to your SAi Cloud Account


Add To SAi Cloud Account

This software license will be added to your SAi Cloud Account.


4. Open **Autorun** in the WinRAR file. Then install software step by step by following the wizard.

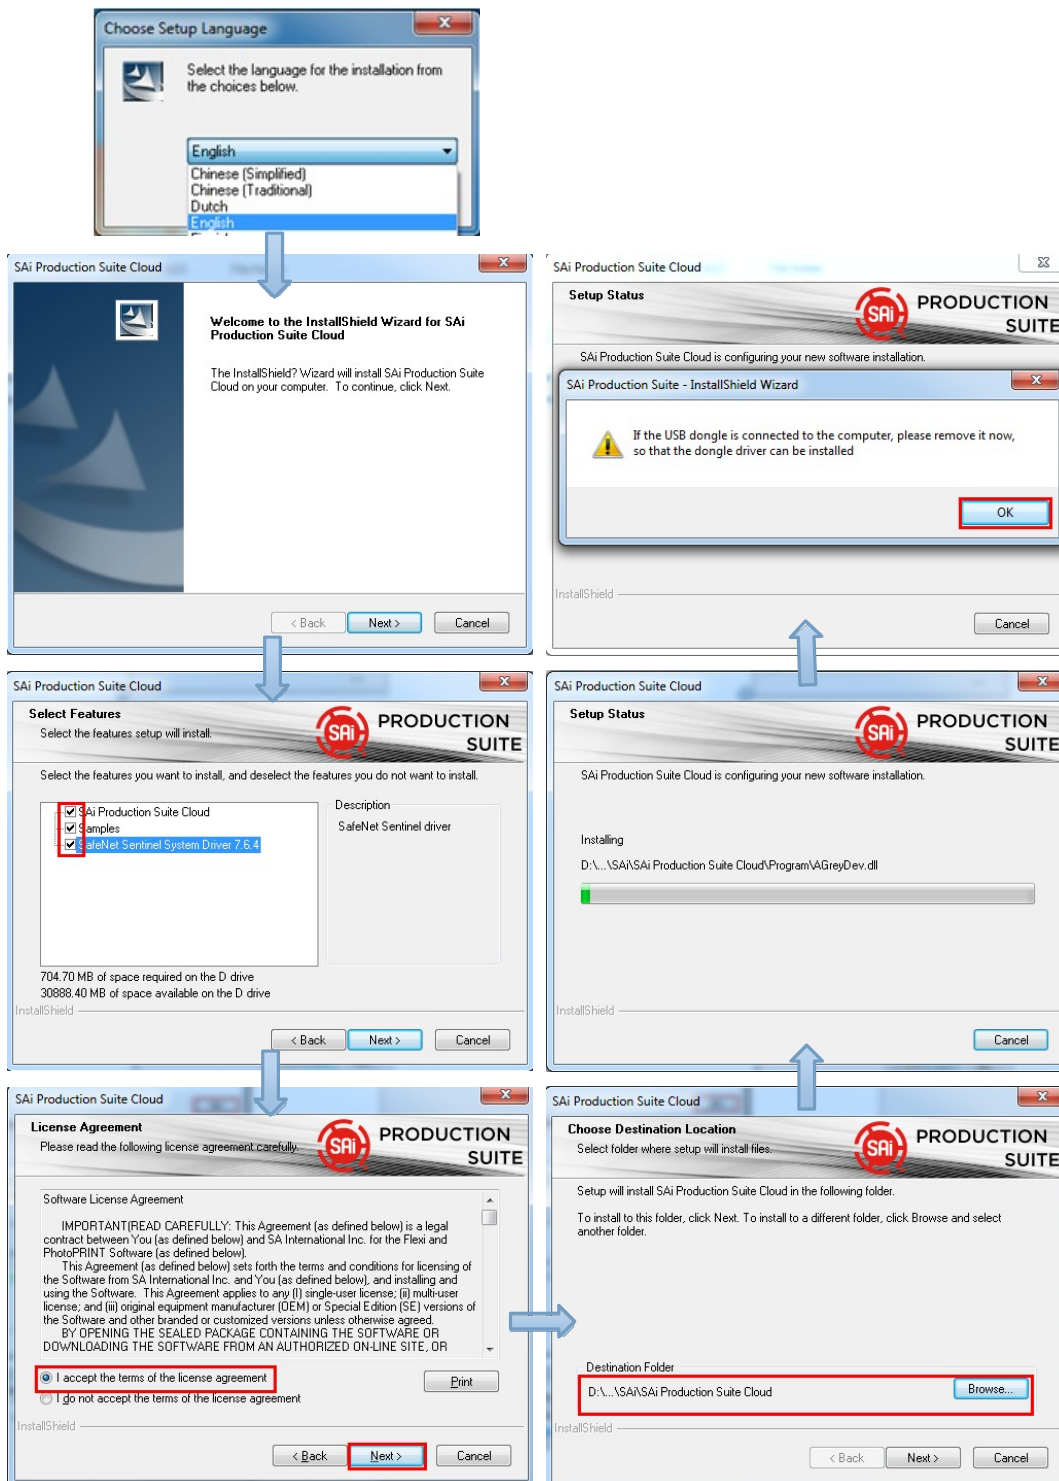

5. Paste your code into activation code field.

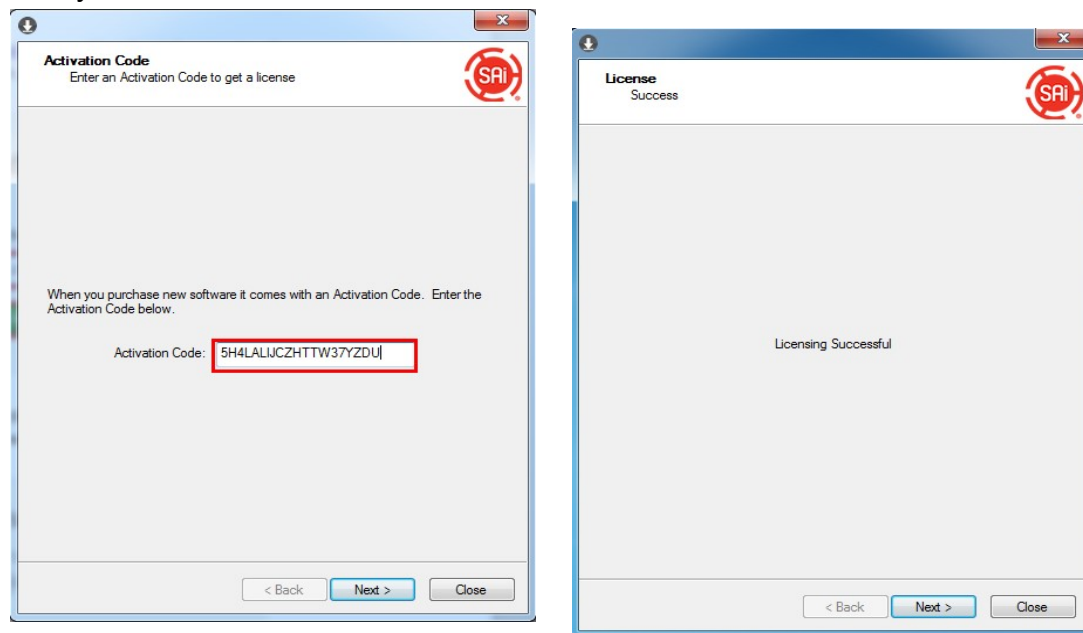


6. Select language you need, click **OK** and finish installation.


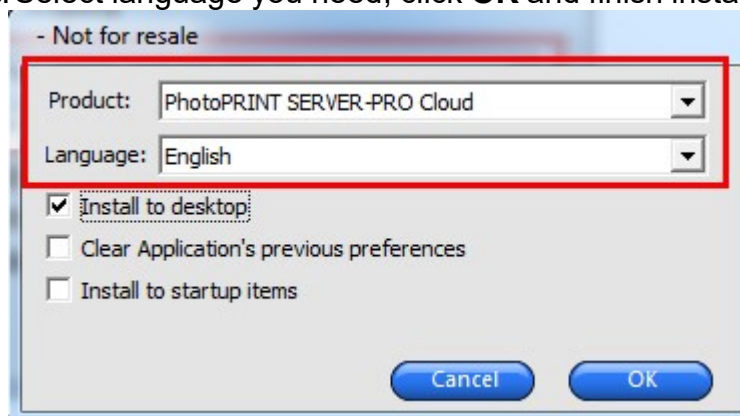


(2) Install and activate software on an offline computer

1. Open **Autorun** in the WinRAR file. Then install software step by step by following the wizard.

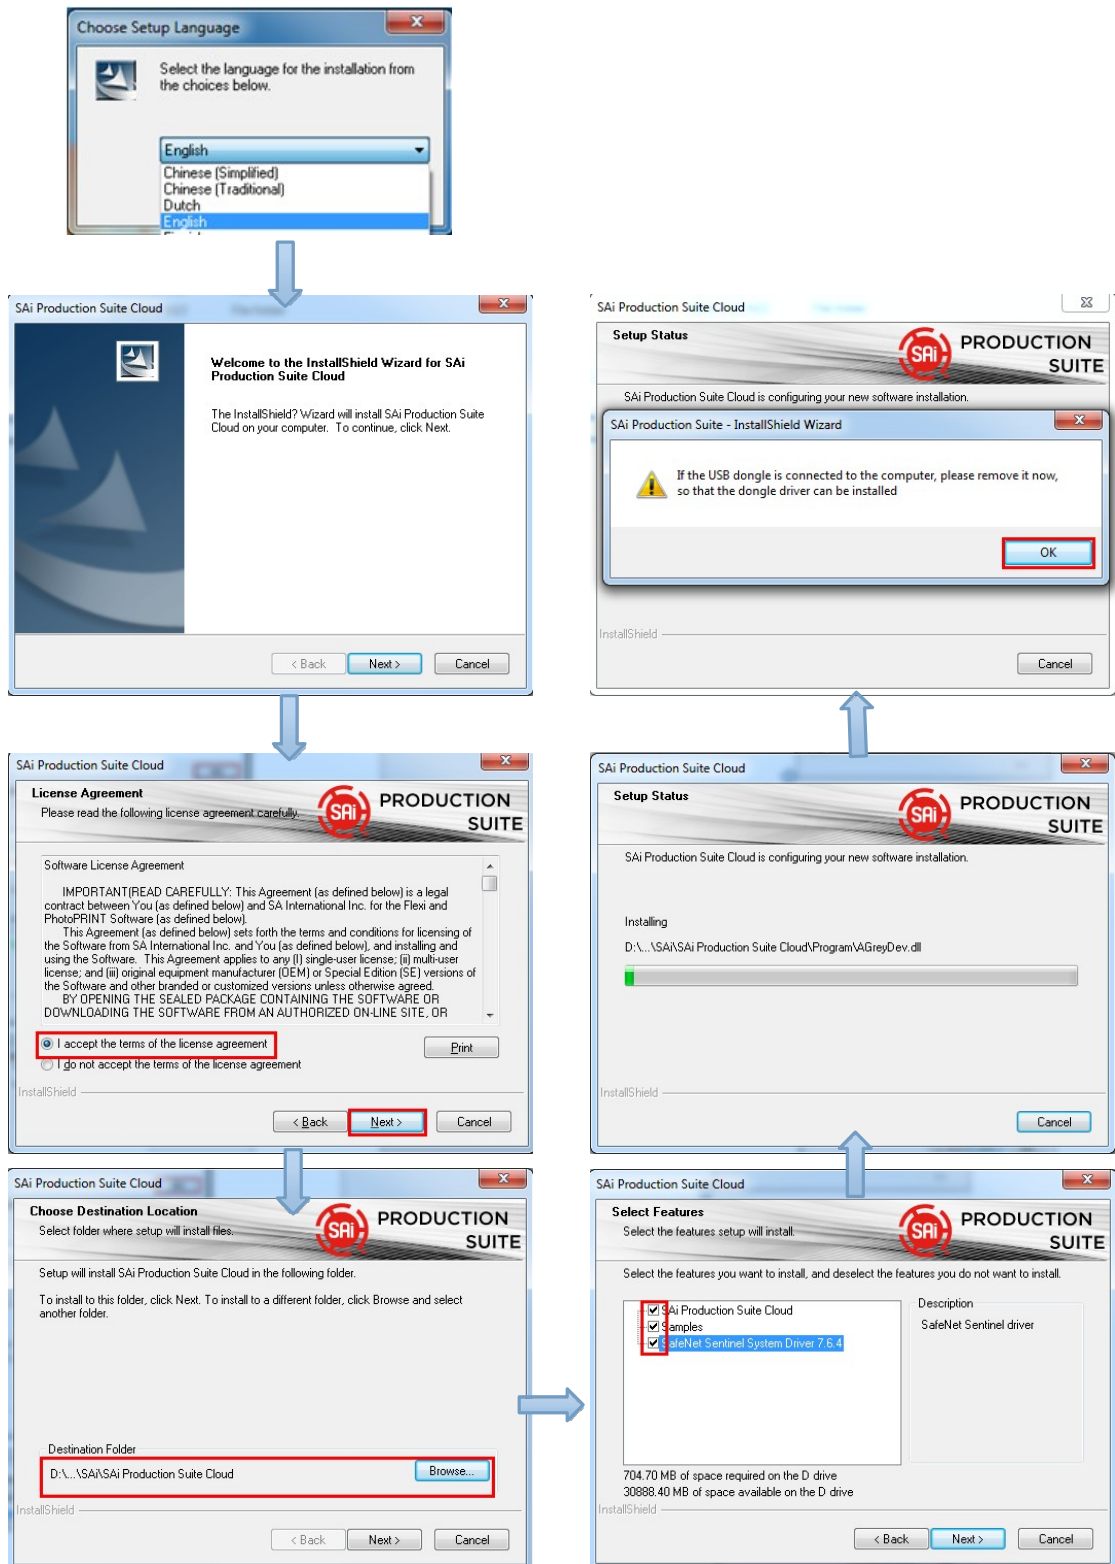

- Record your computer ID in the dialog box below and look up your computer name, You can find your computer name by right-click on **My Computer** and choose **Properties**.

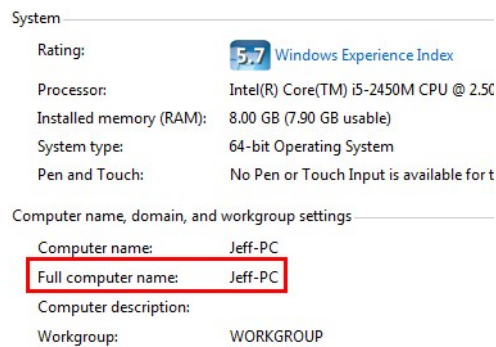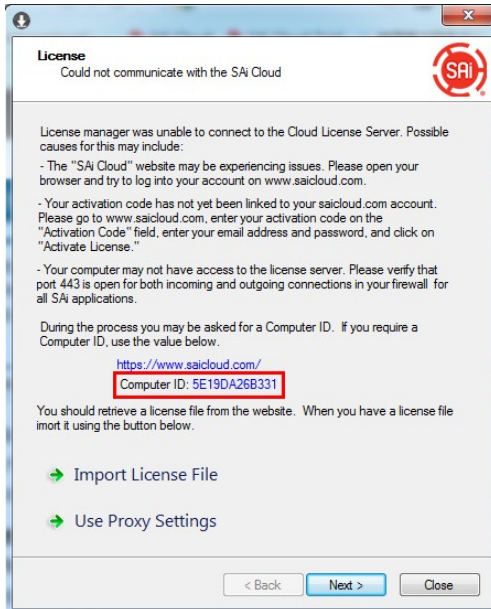

- Launch your browser on another online computer and type <https://www.saicloud.com> in the address bar and press enter, then input your activation code and click **Activate**. The **Activation code** can be found in the software package certificate.



4. In login section, click **I am new to the SAi Cloud** and input your email address, then click **Create Account**, an email will be sent to your mailbox.

Create A Free SAi Cloud Account

I am a returning customer
 I am new to the SAi Cloud

Enter your email address to get started.

Important: The email address you select for this SAi Cloud account will be the owner of the software. It will be used for all SAi software services. It is recommended you use a permanent business email address.

5. Check your mailbox and click website link in the email then complete the information fields.

Step 2. Add Software to your SAi Cloud Account

Add To SAi Cloud Account

This software license will be added to your SAi Cloud Account.

6. Click **“License Manager” can’t connect** and input your computer ID and computer name that you recorded for the offline computer before, then click **Create license Now** and **Download License**, save license file to local.

Step 1 - Download

Clicking on the download button below will download a small application. Run the application to do

[Download Now](#)

Step 2 - Install

Once the download is complete, run the installer. The final step in the install process will run a "Lic application.

Step 3 - License

The "License Manager" application will ask for an activation code. Use the activation code below to

QTP5NDB8FXUYUXGXHLTA6

"License Manager" can't connect?

Create License

[Go Back](#)

Your software will be licensed to be used on the computer wit

Computer ID

Computer Name

[Create License Now](#)

Current Install


Computer ID: 5E19DA26B331
Computer Name: JEFF-PC
User Name: Administrator
Mar 21, 2014

[Download License](#)


[License Removed?](#)

[Download Now](#)

7. Copy license file to offline computer via a removable disk device, then import it.

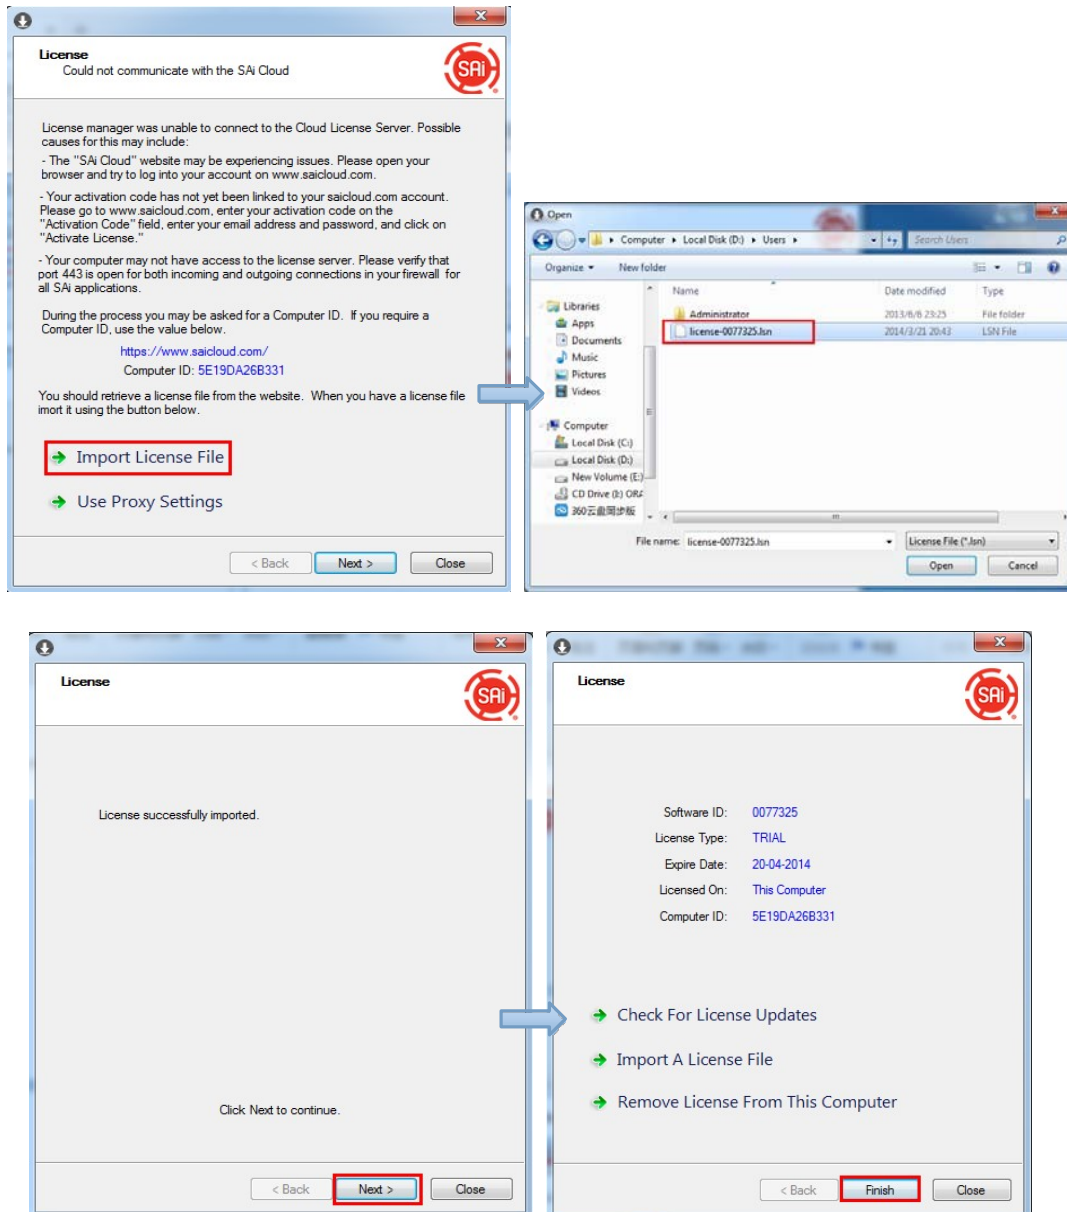


8. Select language you need, then click **OK** and finish installation.

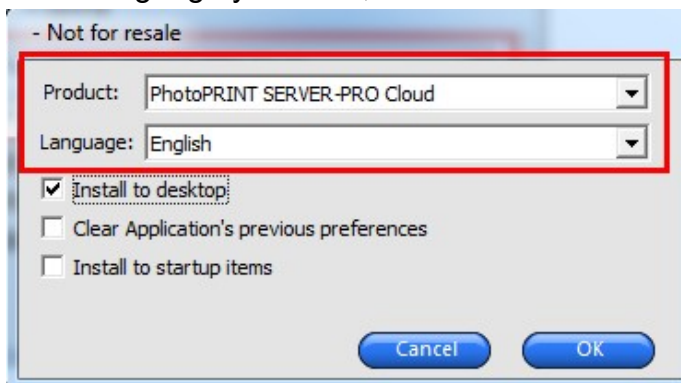


(3) Transfer license on an online computer

1. Open **License Manager** from **Start** menu.

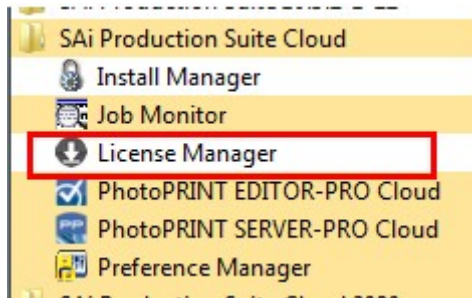


2. Click **Remove License From This computer**, Now you can install the software on another computer.

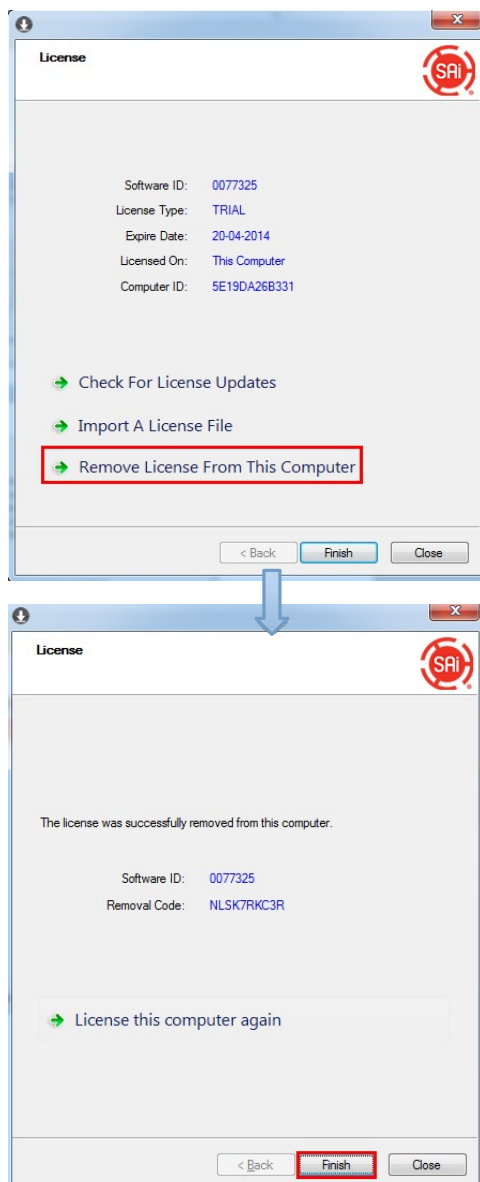


(4) Transfer license on an offline computer


1. Open **License Manager** from **Start** menu.

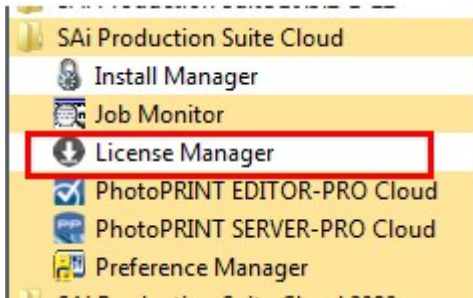

2. Click **Remove License From This computer**, then record removal code in license dialog box.

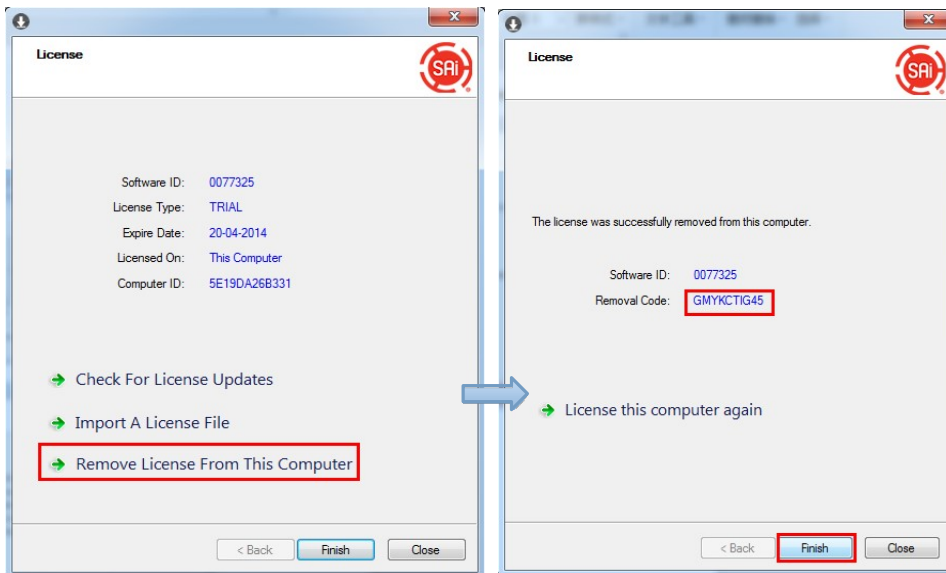


3. Launch your browser on another online computer, access <https://www.saicloud.com> and login with your account. Click **License Removed** then input removal code and click **Remove**. After this you can install software on another computer.


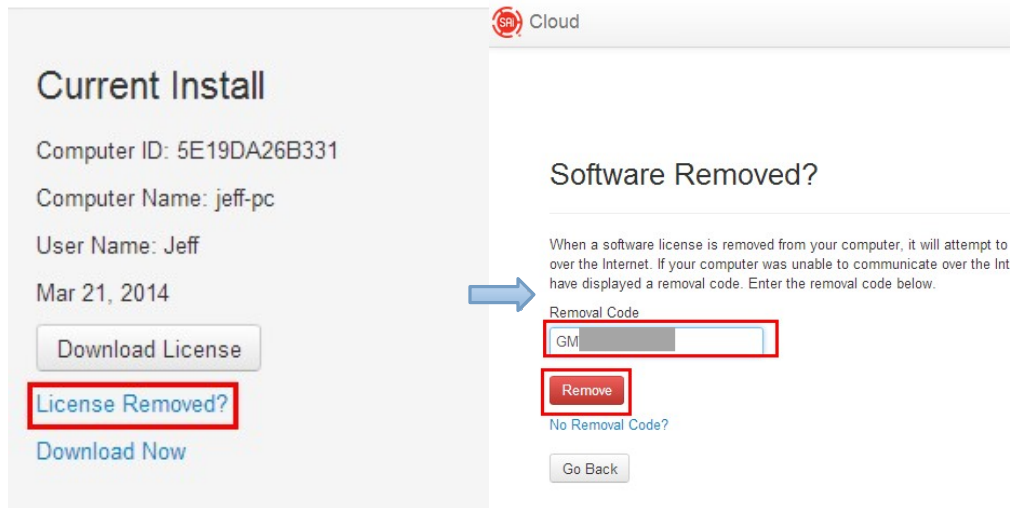


[\[2\] Set up your GCC Cutter on Production Manager](#)



1. Open Production Manager 12
2. Choose and set up your GCC cutter.

(Note that AAS II System only works on RX II, Jaguar V LX, Puma III, Expert II LX models.)


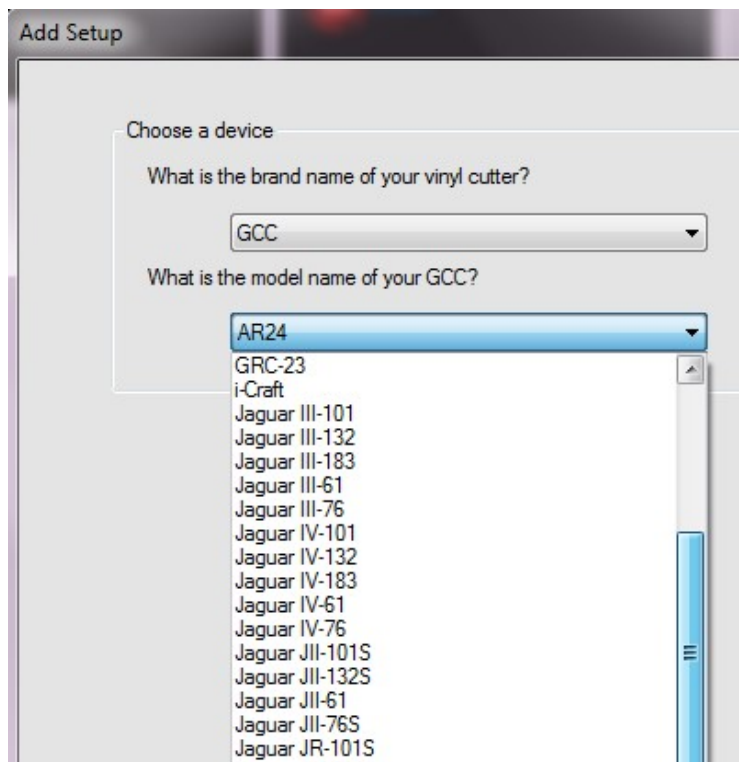


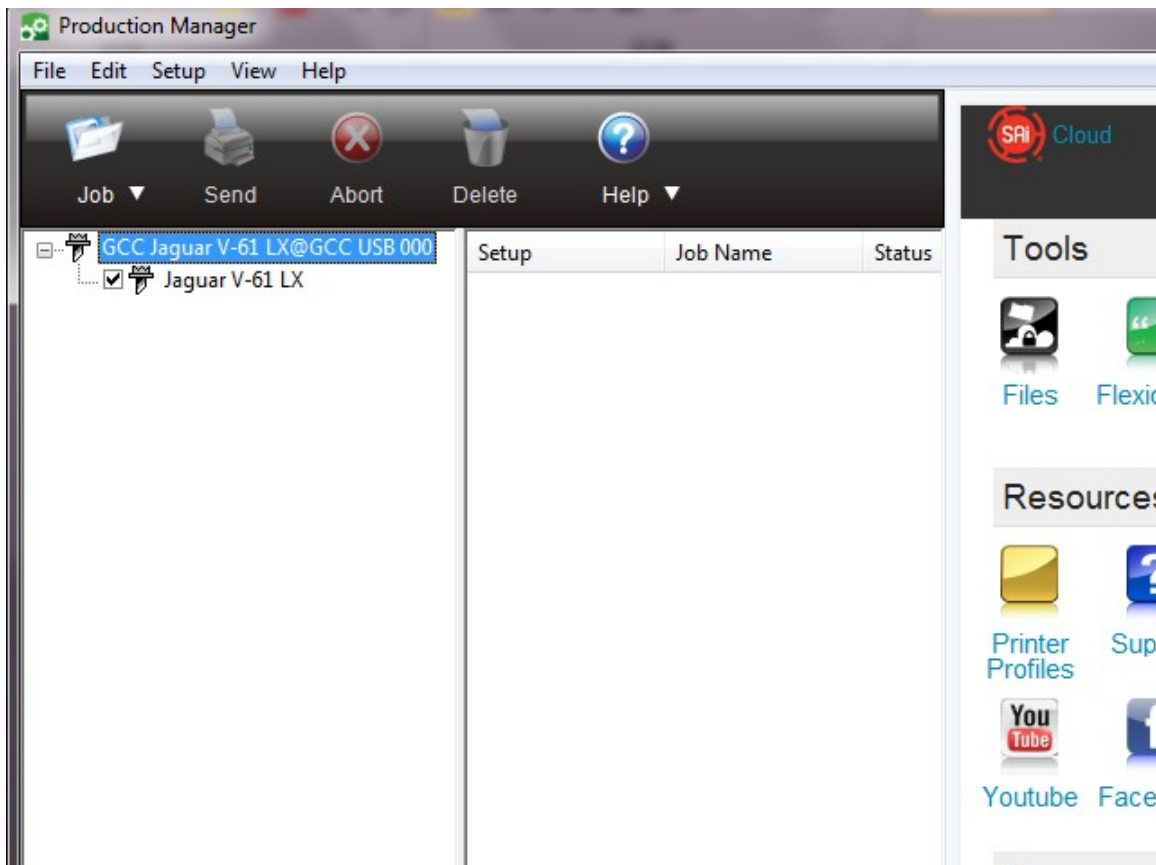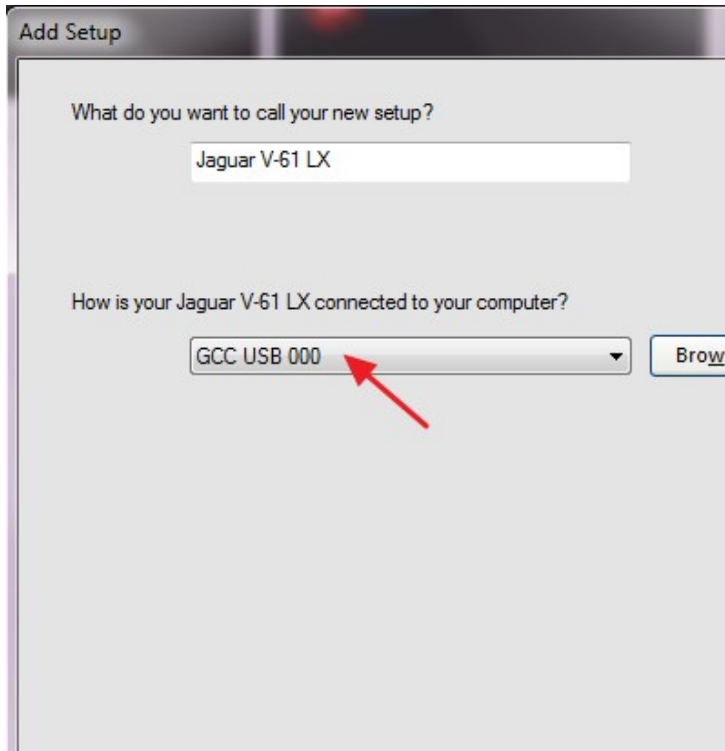

3. Select **File > Print Setup** in SignPal Software and select the printer.

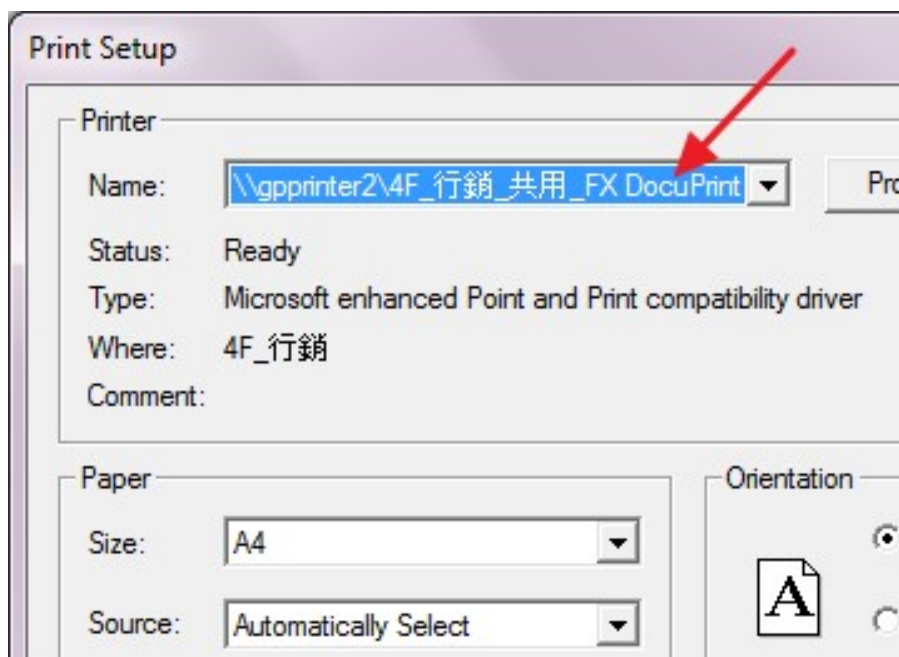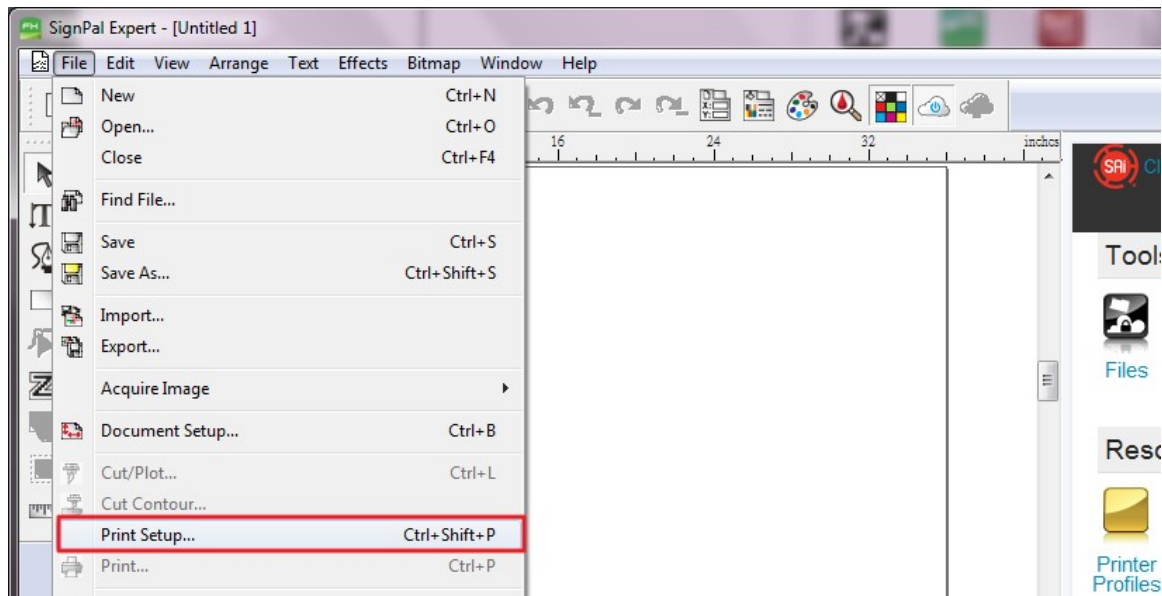


4. Select **File > Document Setup** in SignPal and select paper size .

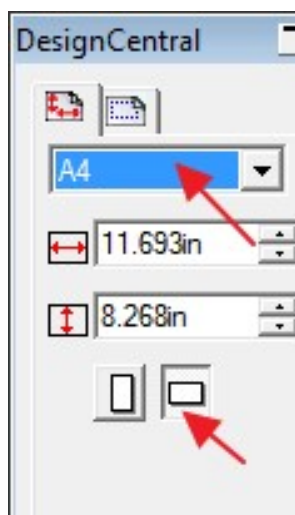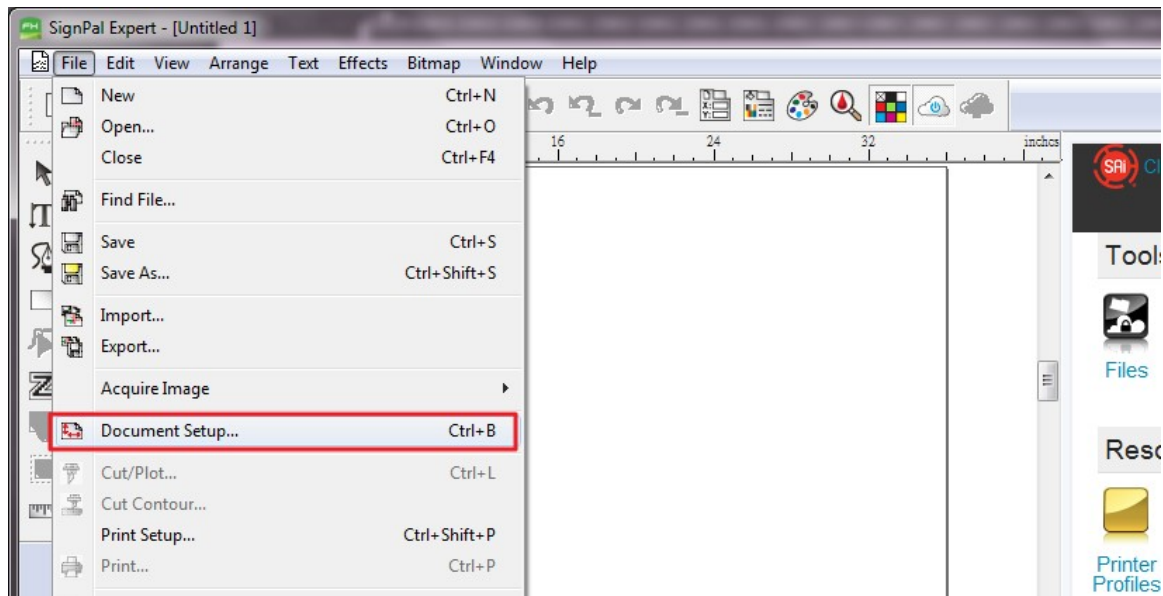


[3] SignPal AASII Quick Start


1. Use the **Rectangle Tool** to create a rectangle.

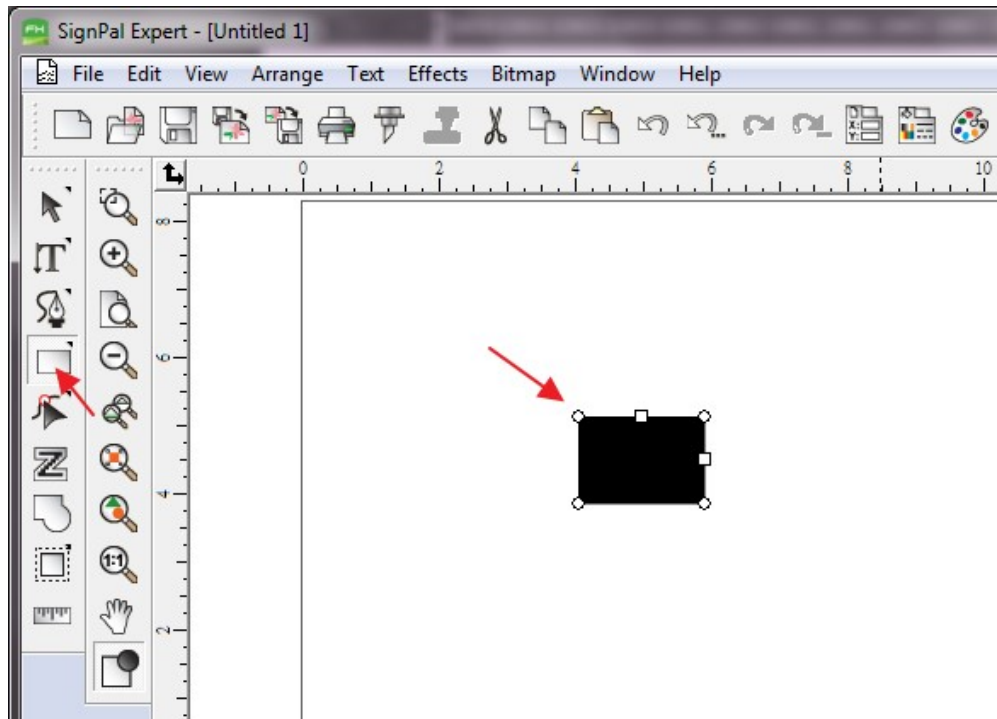


2. Select **Effect > Contour Cut**. Then click 'Apply' in DesignCentral window.

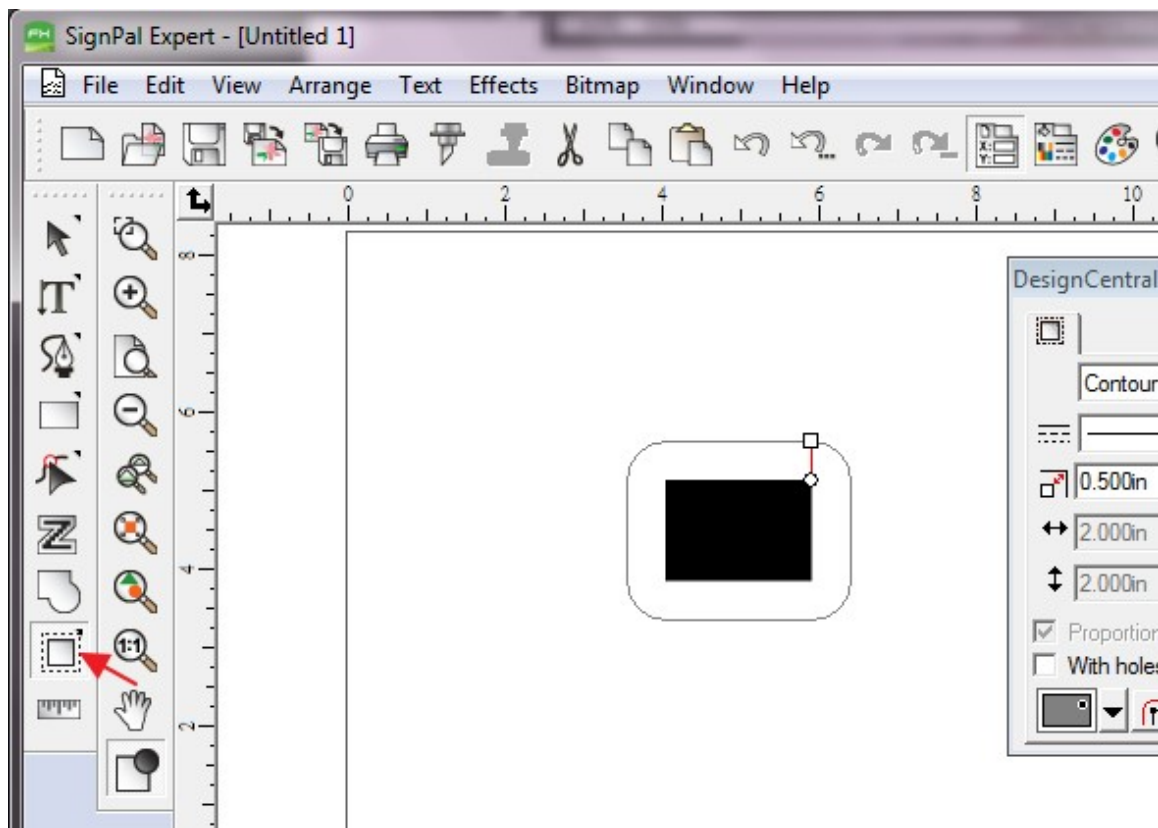


3. Apply the contour cut mark of GCC AASII by selecting **Effect > Contour Cut Mark**.

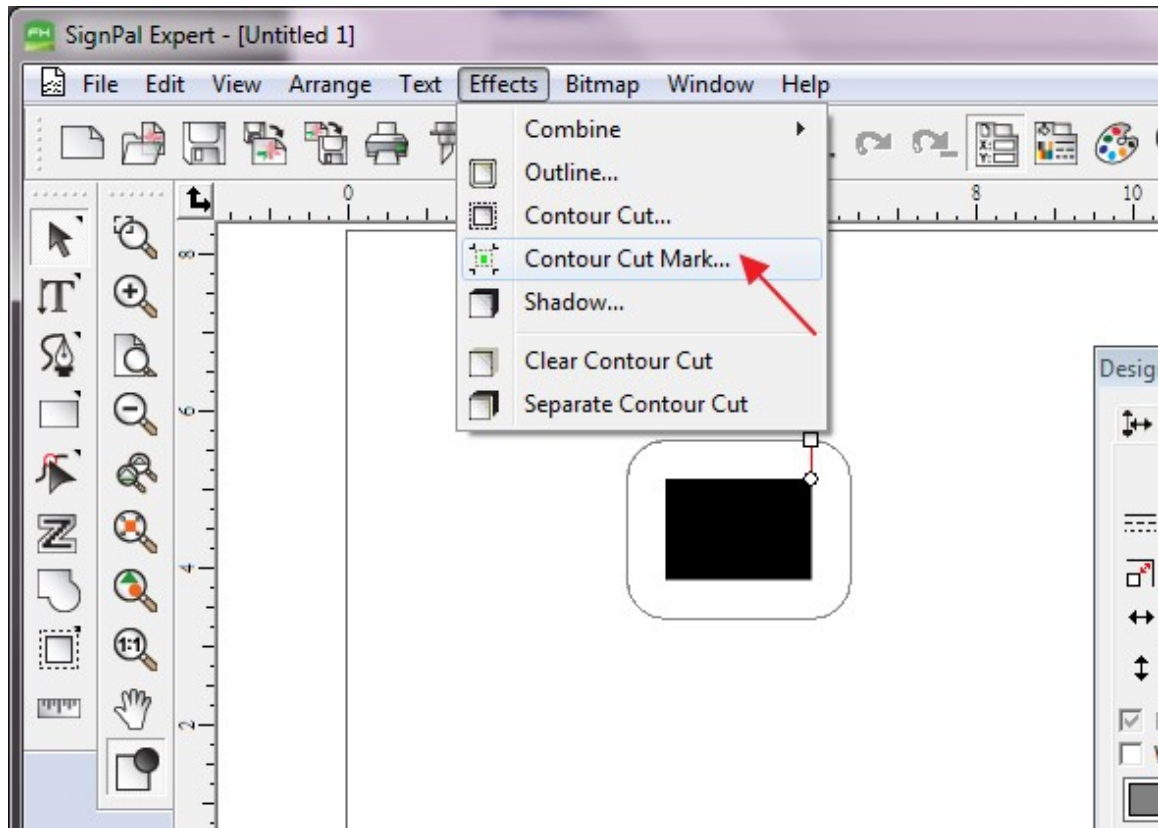

4. Select "**GCC AASII**" in SignPal DesignCentral window to create the AAS II registration marks (4-Point Positioning) and click '**Apply**' in DesignCentral window.

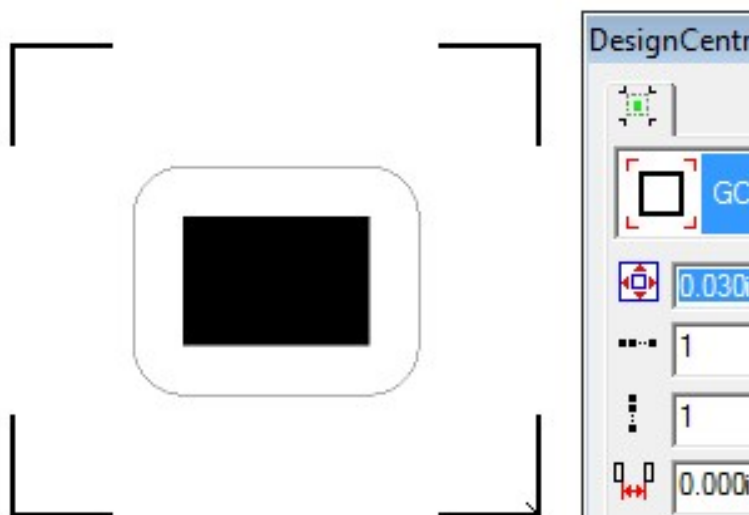



5. There are three types of GCC AASII registration marks: 4-Point Positioning, Segmental Positioning, and Multiple Copies. To make 'Segmental Positioning' marks, please select "**GCC Segmentation**" in DesignCentral window and then click '**Apply**'.

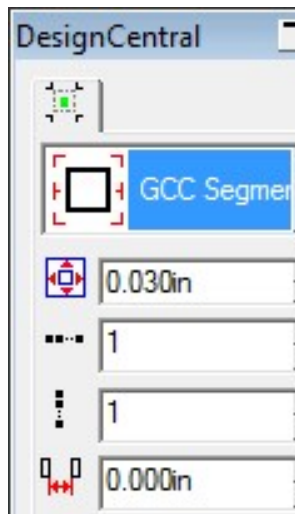


6. For 'Multiple Copies', this function is not available in SignPal. Currently the 'Multiple Copies' function is only available under CorelDraw plug-in.

7. Select **File > Print** to print out the image.


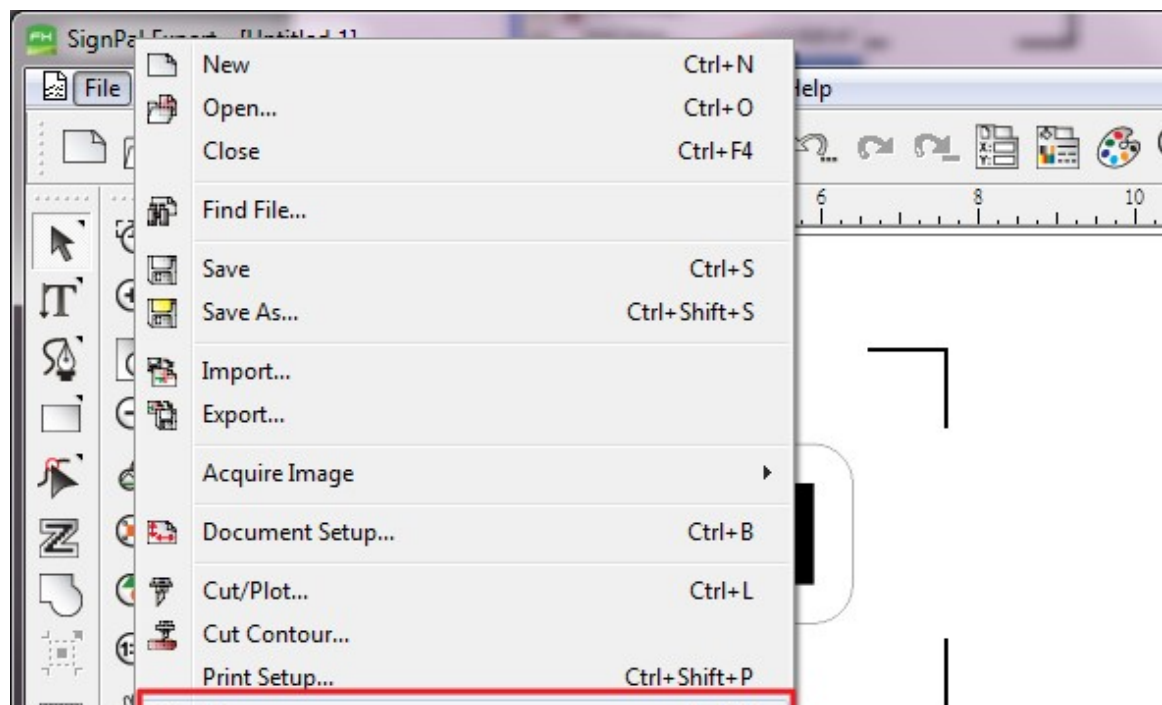


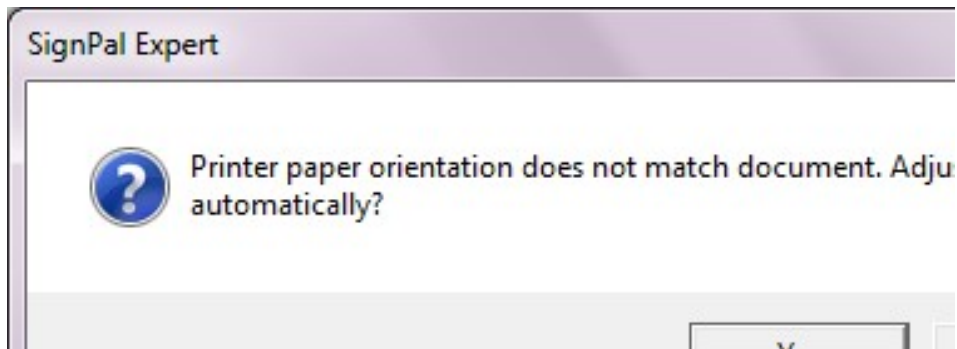

8. Set the Scale as 100% in Print page.

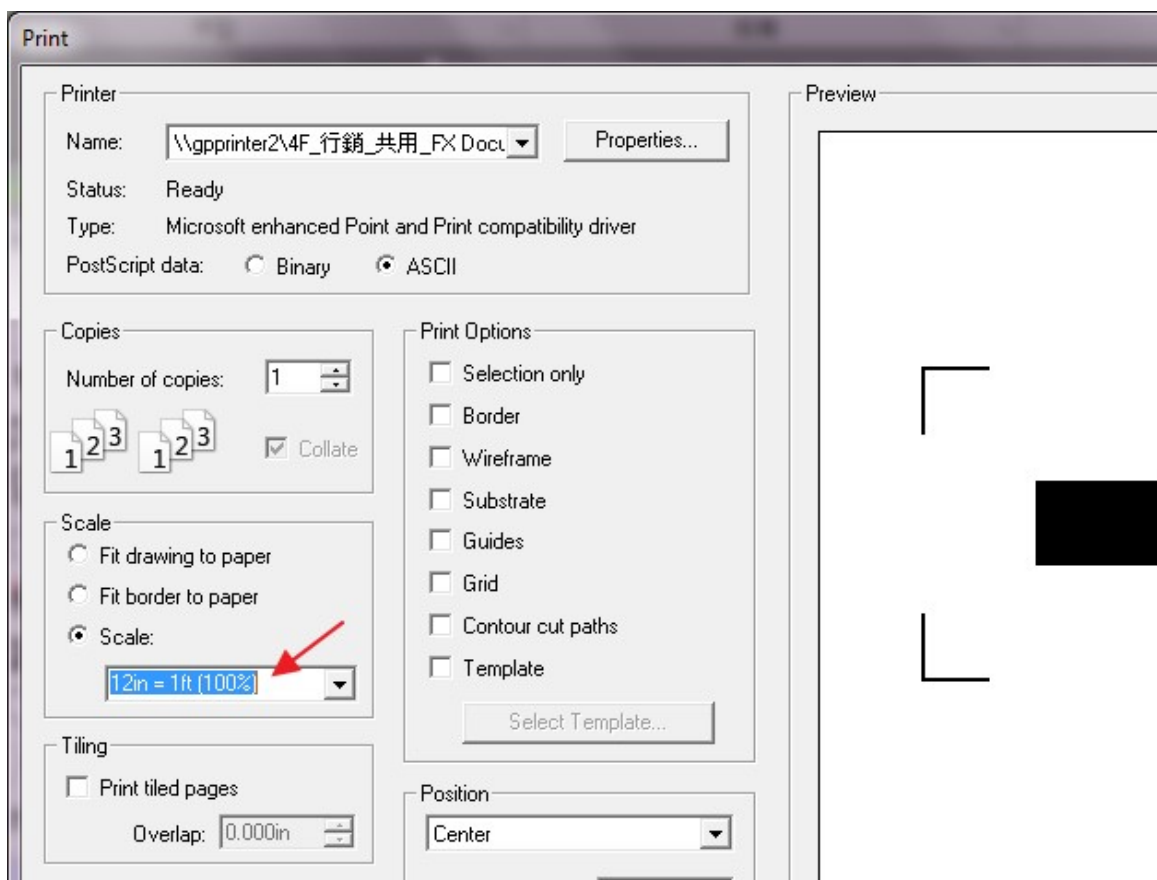

9. Load the printout vinyl on the plotter and select **File > Cut Contour** to send data. You can preview the job and change cutter's parameter settings in 'Properties' tab of Cut Contour window. The Production Manager will be automatic activated to complete the job.

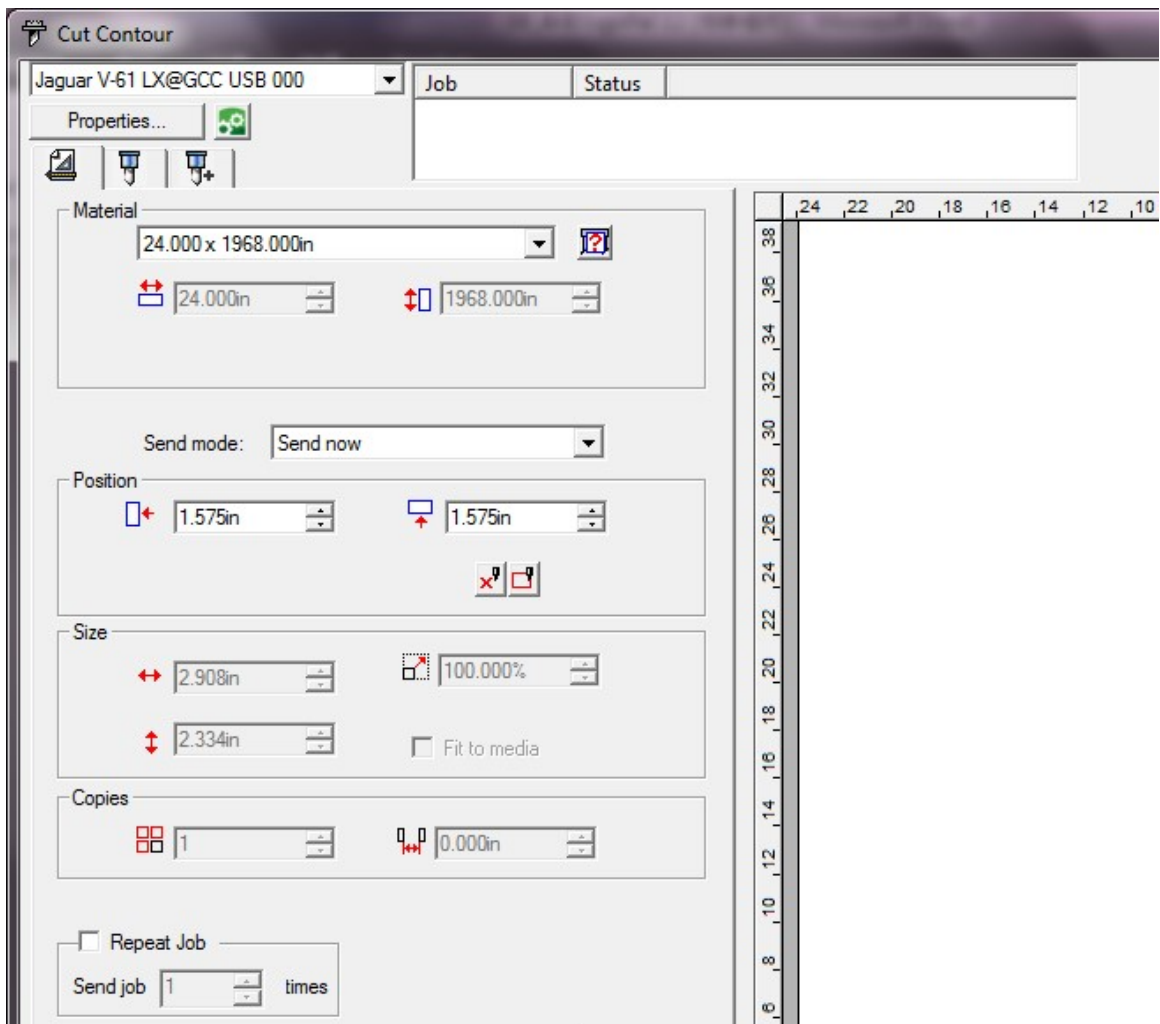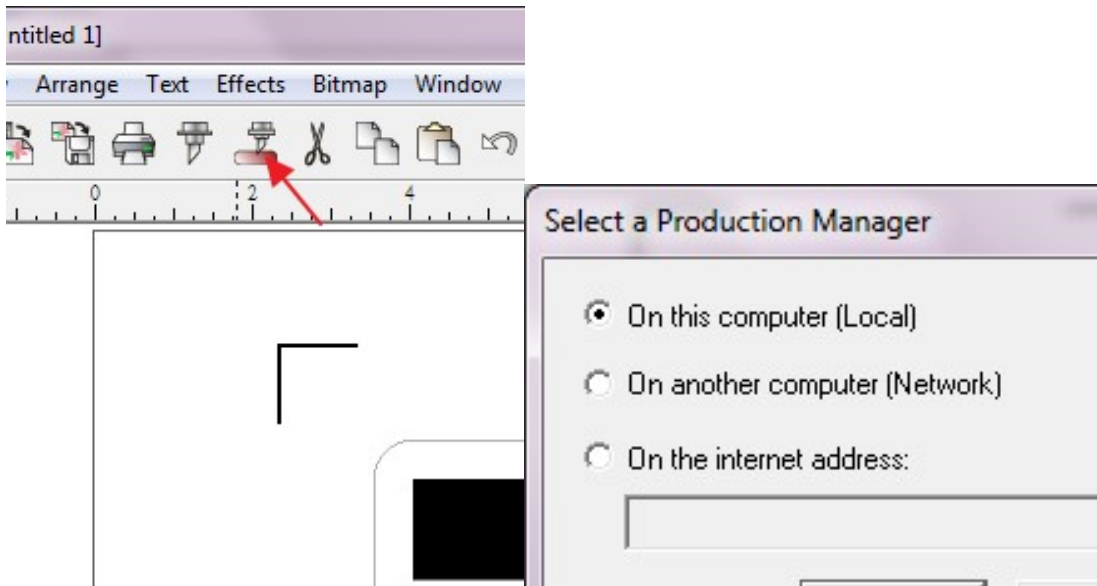

[4] SignPal Features List

	Expert	Apprentice
Text		
Text Tool	•	•
Arc Text	•	
Path Text	•	
Vertical Text	•	•
Vertical Path Text	•	
Kerning	•	
Break Apart/ Join	•	•
Drawing		
Bezier	•	•
Freehand Drawing	•	•
Shapes		
Rectangle	•	•
Oval	•	•
Registration Mark Tool	•	•
Measure Tool	•	•
Path Editing		
Select Point Tool	•	•
Remove Point	•	
Add Point	•	
Straighten Path	•	
Round Corner	•	
Sharpen Corner	•	
Optimize by Curve	•	
Optimize by Smooth		
Arc	•	
Optimize by 3point Arc	•	
Make Arc	•	
Reduce Points	•	
Close Path	•	
Change Start Point	•	
Cleaver	•	

Scissors	•	
Make Right Angle	•	
Break Path	•	
Join Paths	•	
Align Horizontal	•	
Align Vertical	•	
Align Points	•	
Apply Length and Angle	•	
Remove Tiny Objects	•	
Vector Eraser	•	
Cleaver by Path	•	

Working with Files

Job Info	•	
Scanning	•	
Achieve to Cloud	•	•
Workspaces	•	•

View

DesignCentral	•	•
Color Mixer	•	•
Snap	•	•

Arrange

Group	•	•
Compound	•	•
Mask	•	•
Guides	•	•
Contour Cut	•	•
Convert to Outlines	•	•
Convert Stroke to Outlines	•	•
Convert Linked to Native	•	•
Path Direction	•	•
Order	•	•
Cut Order	•	•

Align	•	•
Spacing	•	•
Rotate	•	•
Resize	•	•
Deskew	•	•
Mirror	•	•
Step and Repeat	•	

Effects

Combine	•	
Outline	•	
Contour Cut	•	•
Contour Cut Mark	•	•
Shadow	•	

Bitmap

Autotrace	•	
Color Mode	•	

Production



Cut/Plot	•	•
Manual Split Lines	•	•
Tile All Copies	•	•
Panel to Border	•	•
Auto-weld	•	•
Auto-trap	•	•
Overcut	•	•
Optimize Cutting Order	•	•

Sure Cuts A Lot


There are basic instructions of Sure Cut A Lot below. If you need detailed instruction, please refer to Sure Cut A Lot Help.

1. Select the cutter you want to output and change the work area.


Step 1 Run Sure Cuts A Lot software.

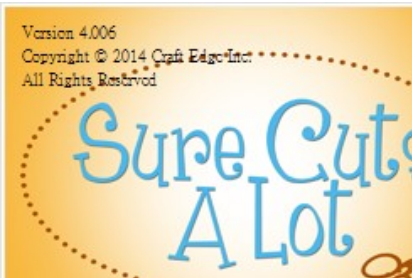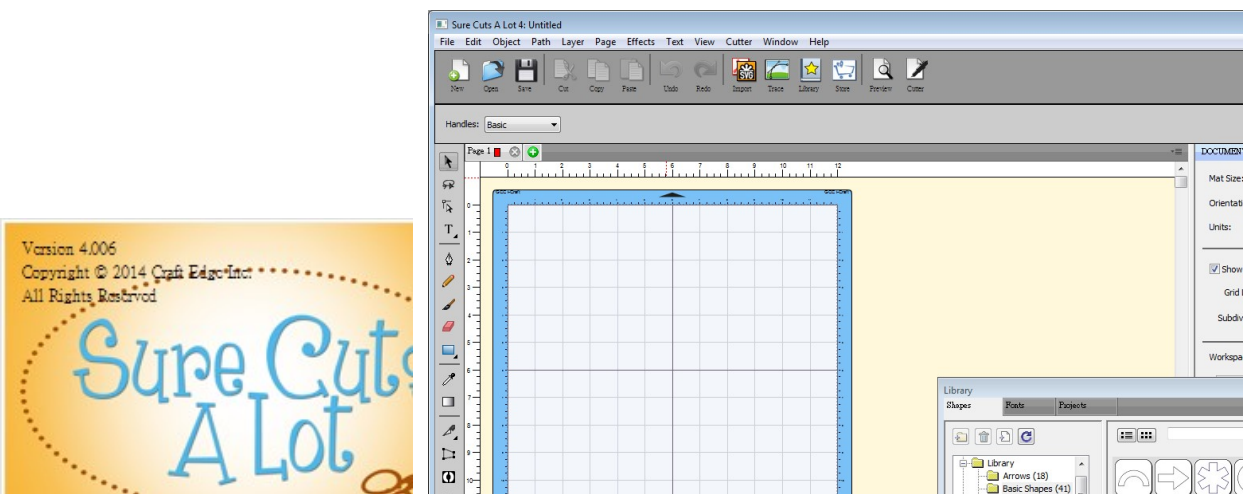


Step 2 Select "Cutter" and select "Manage Cutters" under My Cutter to change the work area.

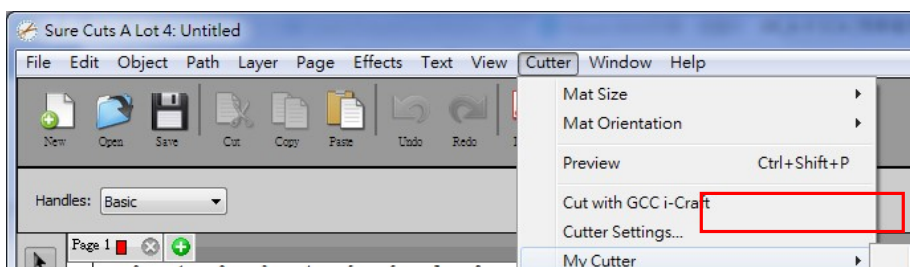


Step 3 Select company / brand as GCC and select model you want to output and then click the “<--Add to list” button.

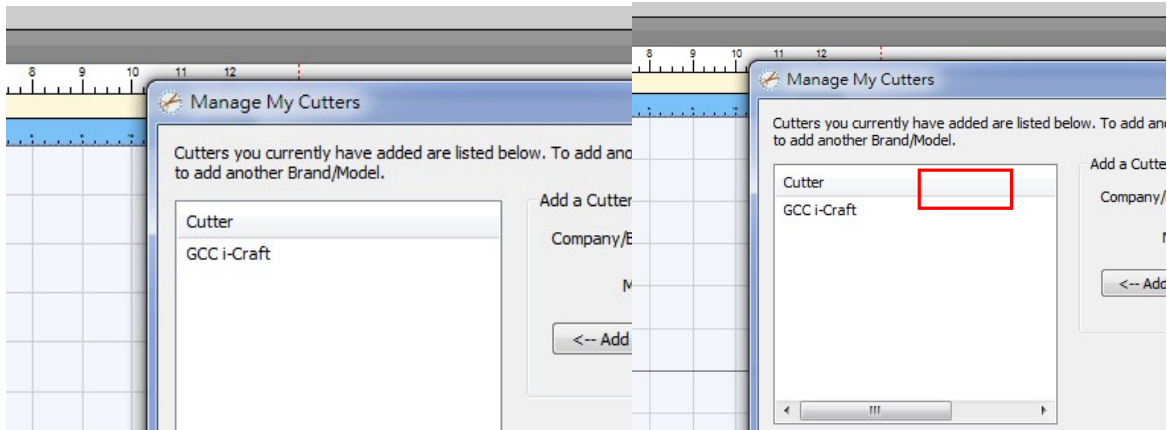

Step 4 Select GCC on the left and click “Done.”

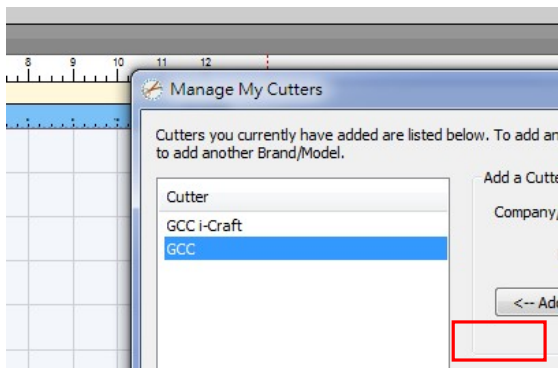


Step 5 If you want to change the material size and orientation, you can fill a proper value in the Document window.

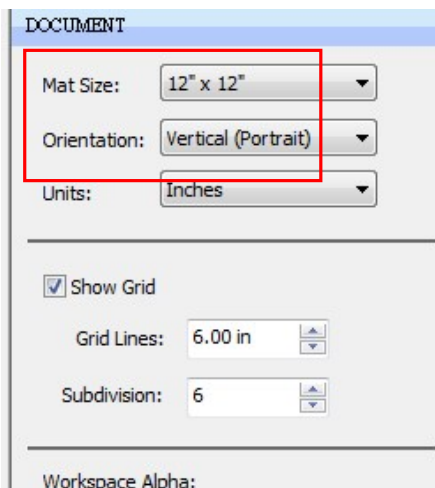


2. Insert Graphics from Library

Step 1 Select graphics from library to insert a selected design.

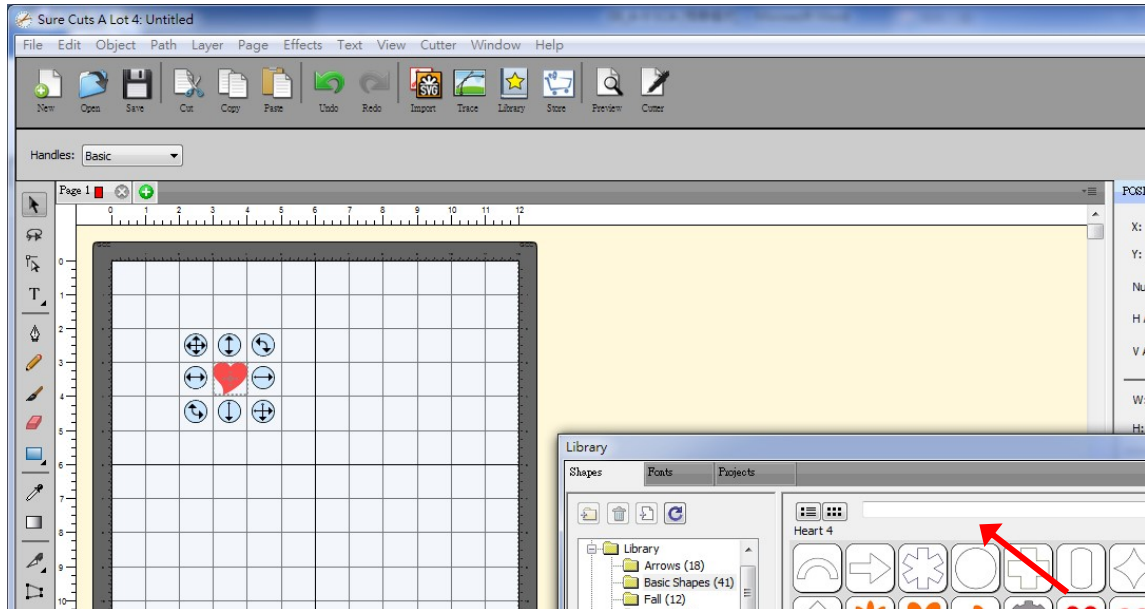


3. Draw Text

Click on the T icon at left side to create the text and select the font you like at text window.

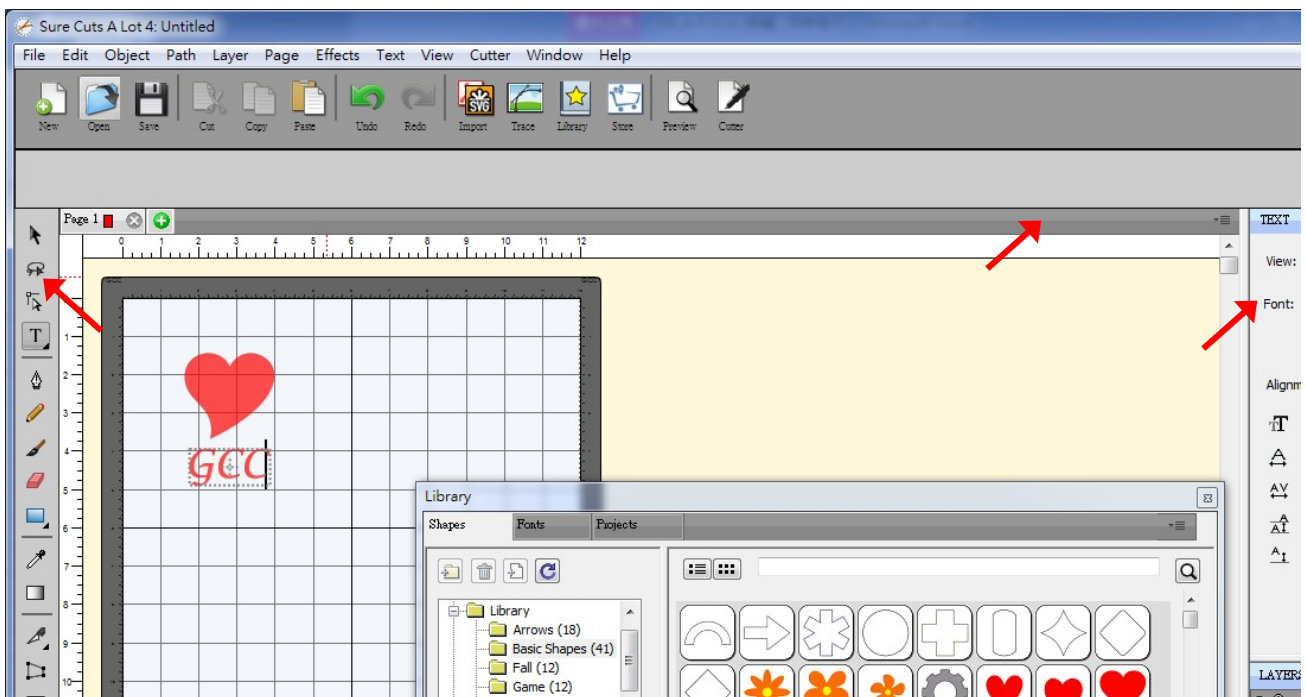

4. Import Design

If you have created your design in other design software, go to “import” or “place image” under file to import it, SCA supports svg, scut, scal, pdf, ai. wpc eps, bmp, gif, jpg and png files.

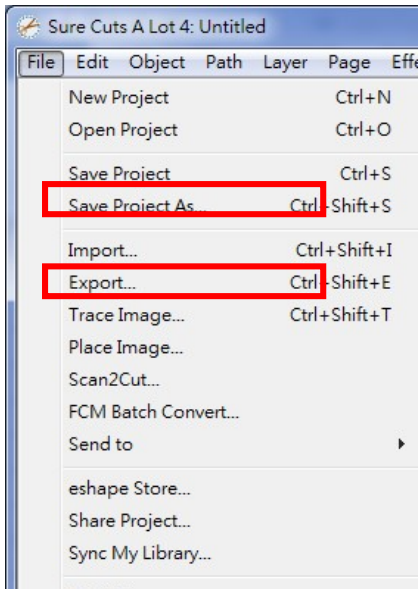


Tips Thousands of SVG files designed specifically for Sure Cuts A Lot!


- ✓ <http://SVGCuts.com> is the top of source for designer SVG files for Sure Cuts A Lot. Thousands of high quality elements including: shapes for card-making, scrapbooking, as well as gift bags, boxes and 3D flowers.

5. Convert Image to Cutting File

Step 1 Go to Trace Image under File, or select Trace Image button on the toolbar to open the setting window.

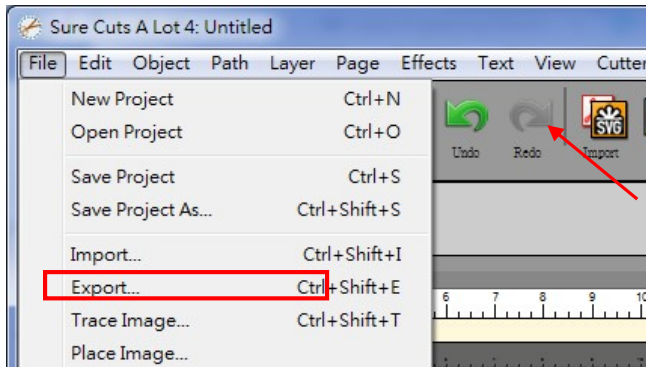

Step 2 Click on “Choose an image” to input the image, adjust Image Settings and Output Settings, and click OK. Then the outline of the image will be outputted automatically.

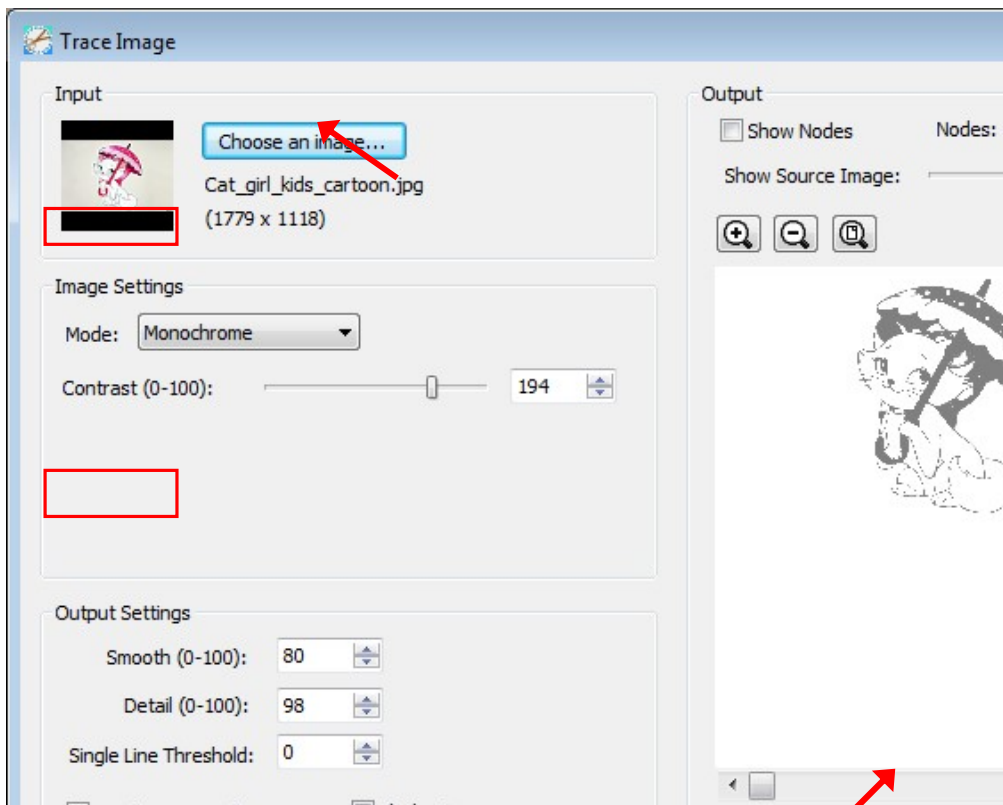


Note


- ✓ The **contrast** and **pixels** of import images will affect the trace image result. High contrast graphics are recommended.

6. Cut the Design

Step 1 Click on the “Cutter” button on the toolbar and Cut Settings window will appear.

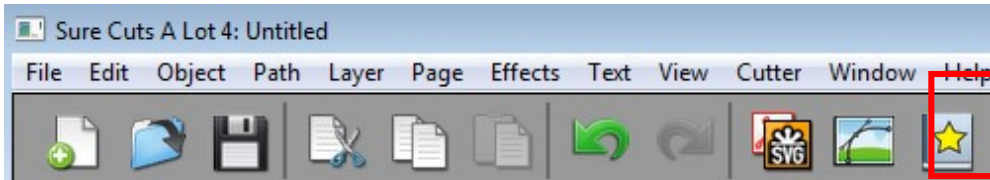


Step 2 Click on “Settings...” to open GCC Cutter Settings window.

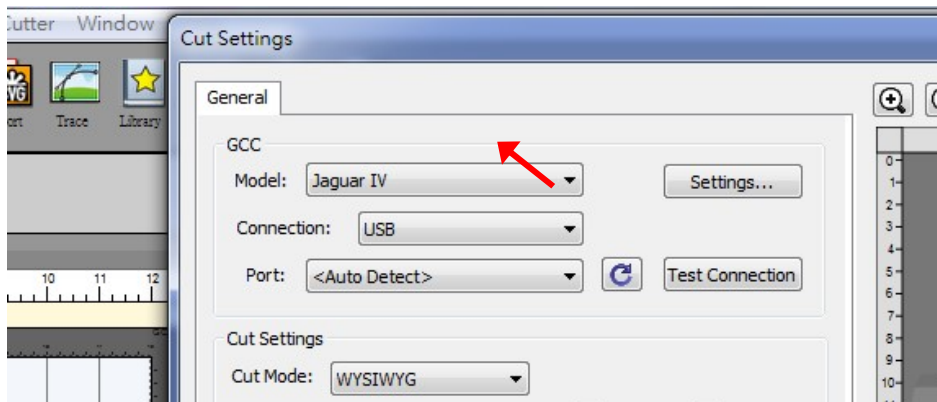

Note

- ✓ The origin point is on the bottom right.

Step 3 Adjust Registration Marks setting under GCC Cutter Settings window if needed.

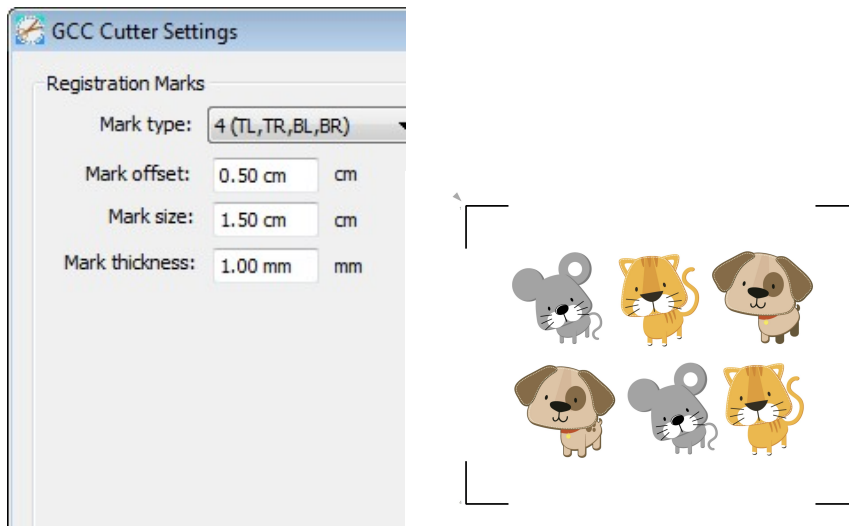

***Registration Marks:** set the distance between the edge of the material and the registration marks in Mark Offset; set the size of marks in Mark Size; set the line thickness of marks in Mark Thickness.

Step 4 Adjust Blade Offset, Overcut Value, Multi-Cut and Quality under Cut Settings window if needed.




***Blade Offset:** set the offset value according to different blade, for a standard blade, set the offset value at 0.25mm, 0.5mm for an optional advanced blade and 0mm for an optional plotting pen.


***Quality:** associated with the cutting result; please note the better cutting quality, the slower cutting speed.

***Multi-Cut:** to repeat the cutting job at same position which is suitable for cutting thick material.

***Overcut:** allows for easier weeding and makes up for incomplete cut lines.

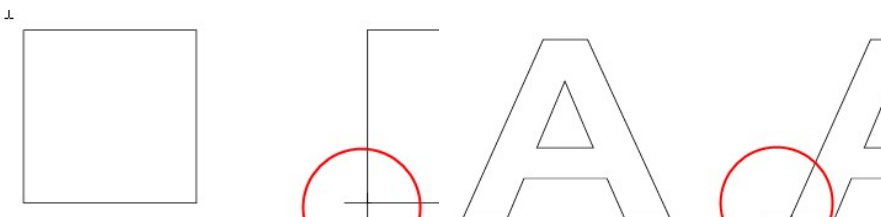

Step 5 Under “Cut Settings” section, there are some useful functions. After setting the parameters, click on “Cut” to send the data to the GCC cutter and the GCC cutter will start the cutting job.

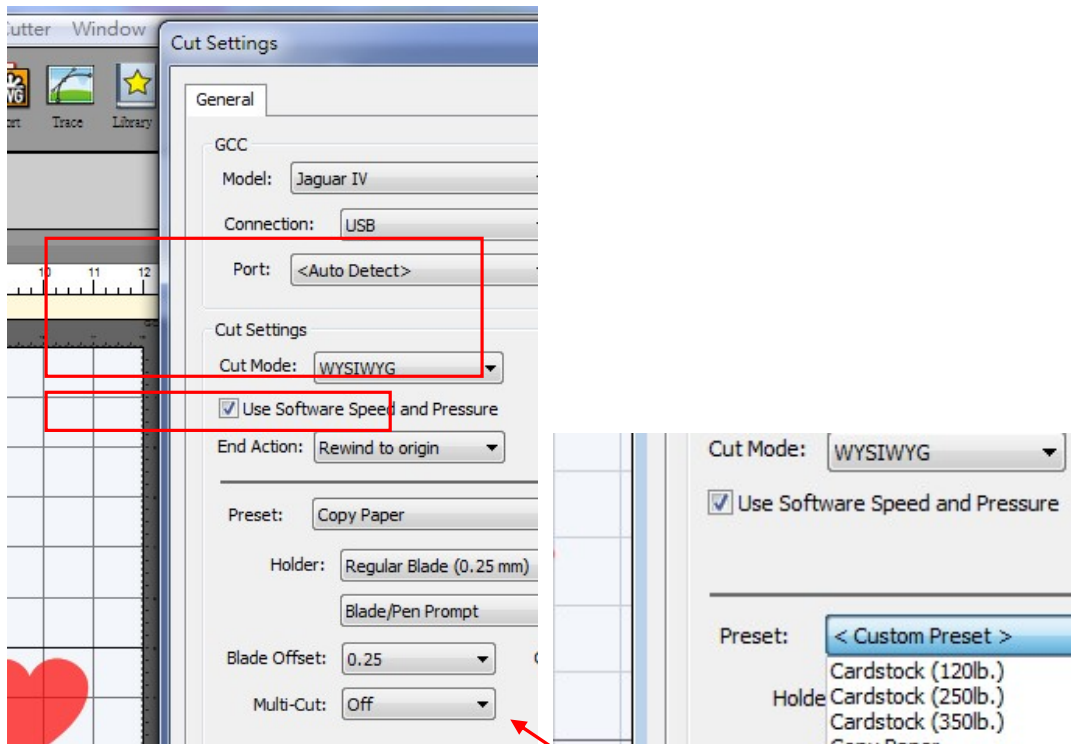

***Cut Mode:** there are “WSIWYG” and “Origin Point” options, WSIWYG means what you see is what you get, the cutter will output the graphic at same position in preview window. While with Origin Point mode, the cutter will cut the graphic from bottom right origin point of the material.

***Use Software Speed and Pressure:** tick this section, and you can set the values of speed and pressure manually.


***Preset:** select a proper material to apply the preset speed and pressure parameter automatically.

***Speed & Pressure:** you may adjust values of speed and pressure manually to get quality results.


7. Print and Cut Your Design

The Print and Cut function allows you to print the graphics from Sure Cuts A Lot to printer, and then put the printed materials on the GCC cutter to cut out the contour of printed jobs from Sure Cuts A Lot.


Step 1 Open an image file in Sure Cuts A Lot.

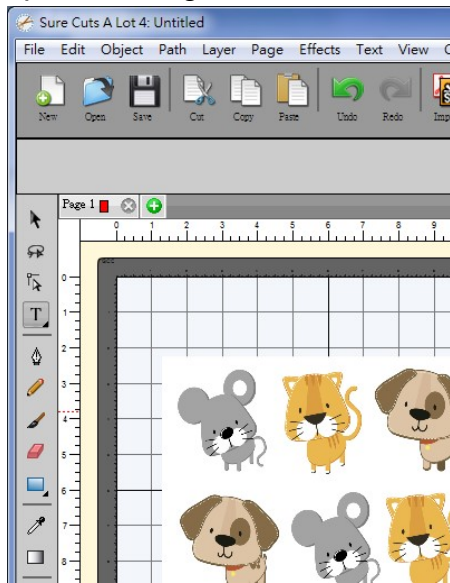


Step 2 Click on the Cutter icon on the toolbar, set the parameters and click on “Print+Cut” to add the registration marks and print out the image.

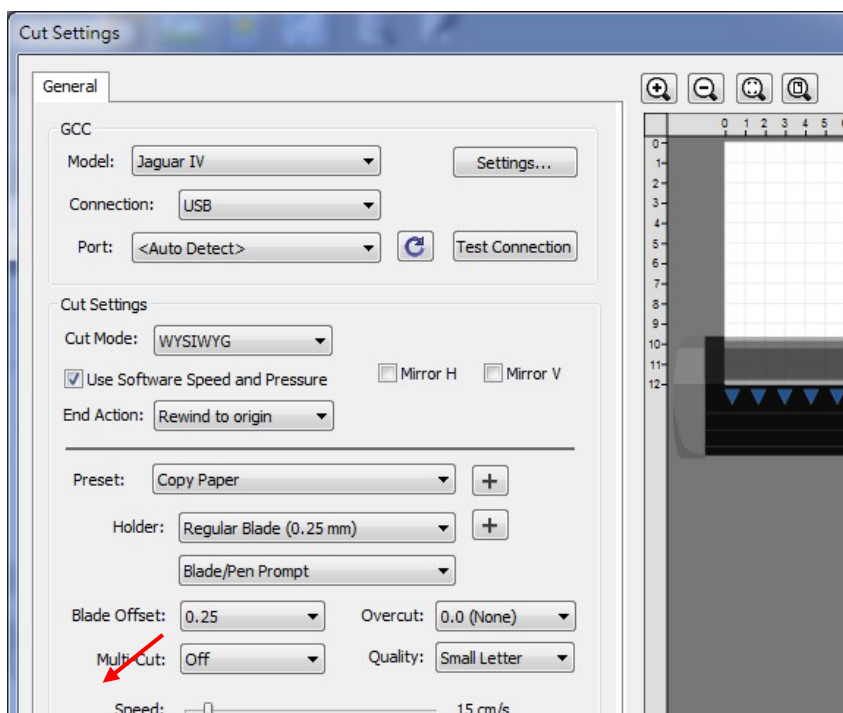

Step 3 Click on “Print...” to open printer setting window and click OK.


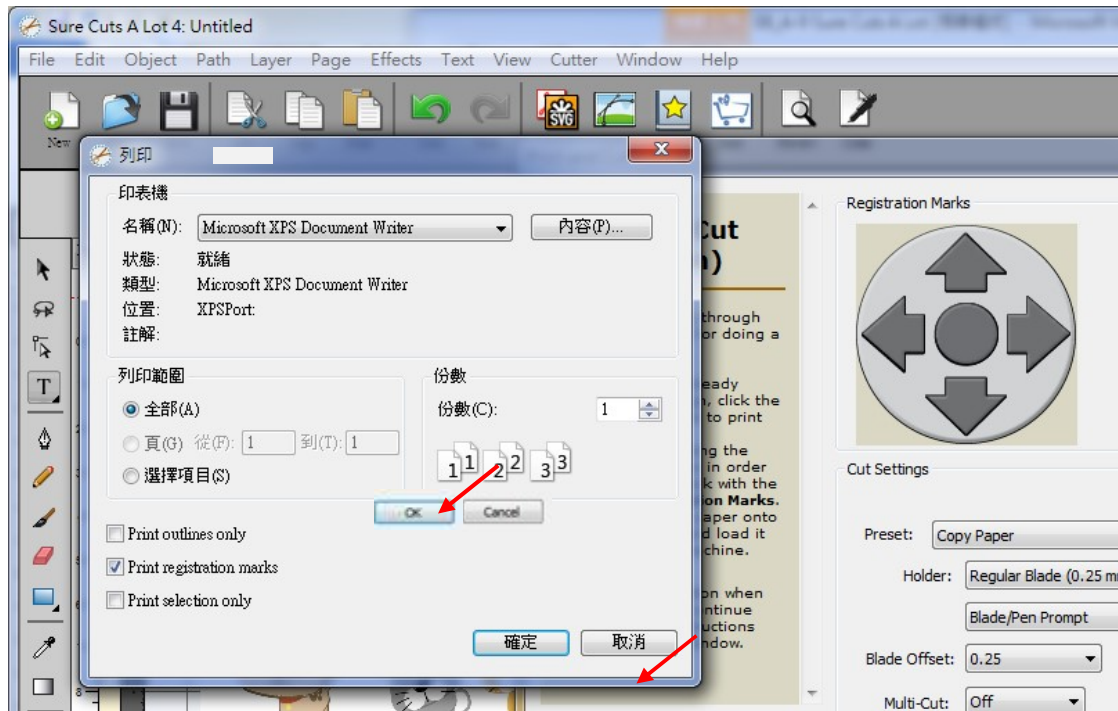


Step 4 Print your design with registration marks out.

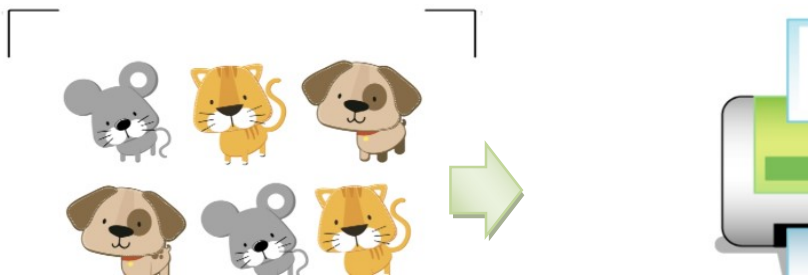


Step 5 Load the printed media to the GCC cutter.

Step 6 Press “Next” and then press “Scan+Cut”, and then the GCC cutter will detect the registration marks and cut the contour lines automatically.

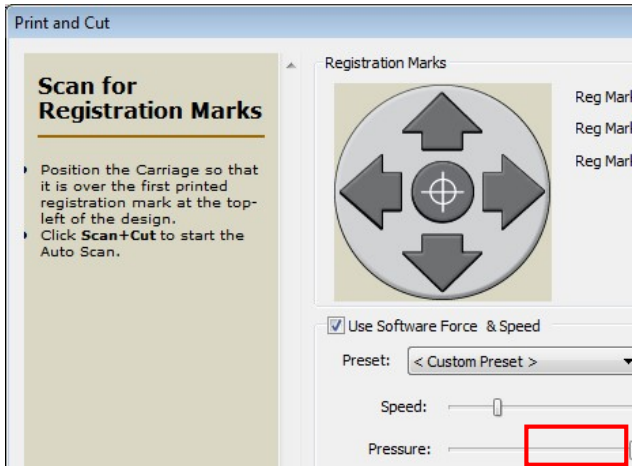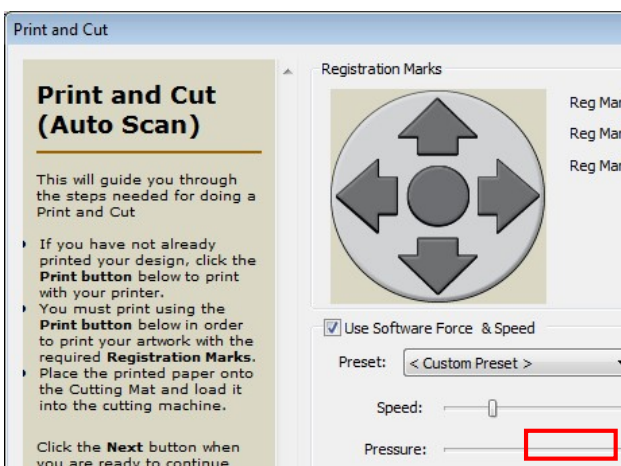

Tips Test Connection function can save your materials.
✓ Click on “Test Connection” to exam if set the connection properly.

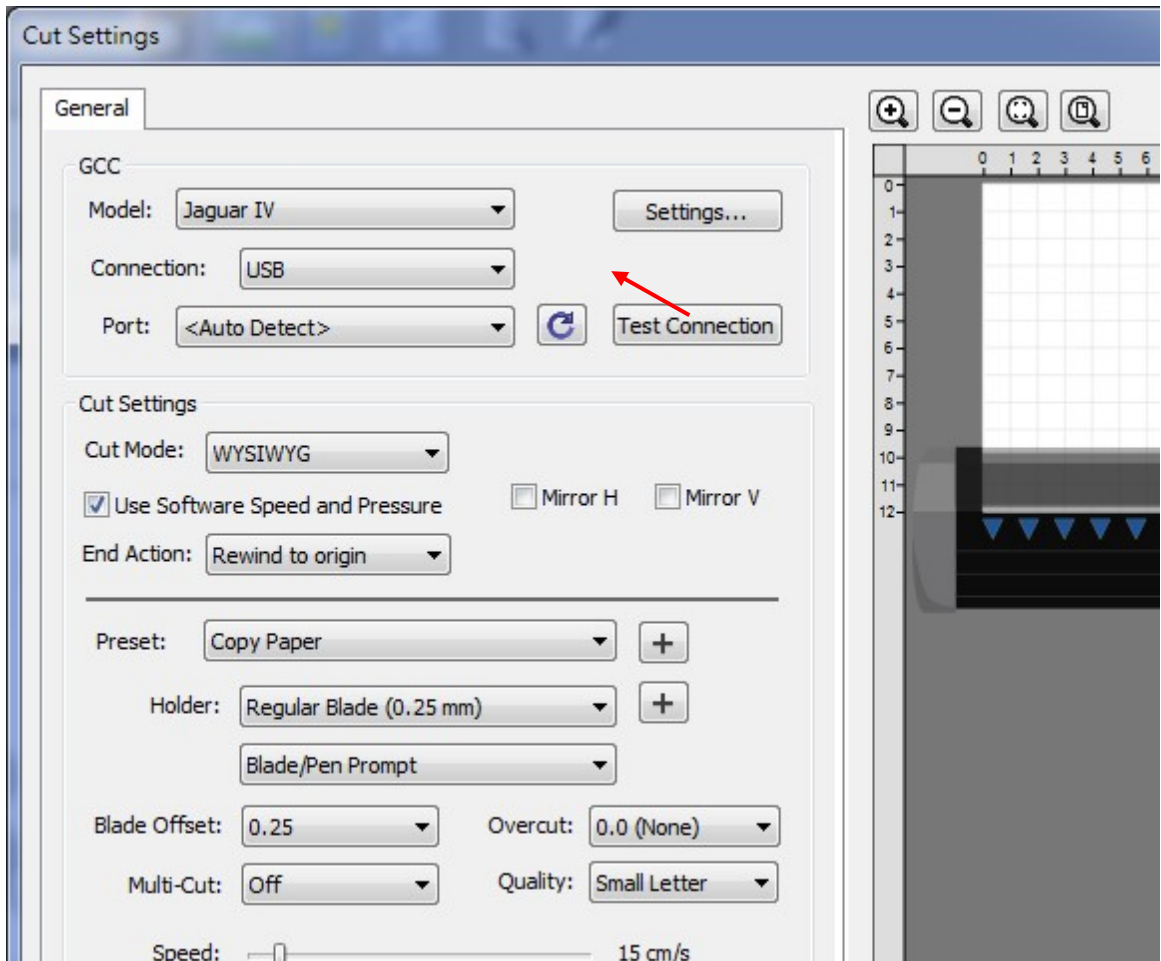

Test Connection

This will attempt to move the rollers or blade a short distance back.

If you do not see the rollers or blade move, double check the connection. Make sure the cable is not loose and the power is turned on.

This test will not lower the blade and will not cut anything.