



LFC Desktop Workstation User Manual



Version: 2.0
Release 2021

TABLE OF CONTENTS

Chapter 1	Safety.....	1
1.1	Principles of CO2 Laser	2
1.2	Principles of Fiber Laser	2
1.3	Safety Rating	2
1.4	The Safety Interlock System	3
1.5	Safety Label	3
1.6	Safety Measures	7
1.7	Operating.....	8
Chapter 2	Unpacking & Content	9
2.1	Contents & Accessories Checklist.....	10
2.2	Contents & Accessories Checklist.....	13
Chapter 3	Mechanical Overview.....	16
3.1	Front View	17
3.2	Right View	18
3.3	Left View	18
3.4	Rear View	19
Chapter 4	Machine Installation.....	20
4.1	Laser Marker Installation	21
Chapter 5	Software Setup.....	33
5.1	Recommended Computer Configuration.....	34
5.2	Software Installation for Windows System.....	34
5.3	Software Installation for MAC System	39
5.4	Setting User Level.....	47
Chapter 6	Operating the LFC Desktop Workstation	54
6.1	Hardware Introduction	55
6.2	LFC Desktop Workstation Service Mode Operation.....	57
6.3	LFC Desktop Workstation OP Mode Operation	59
Chapter 7	External Control.....	62
7.1	I/O Pin Assignments.....	63
7.2	Laser Working Flow Chart	65
7.3	Laser Reaction Timing Diagram.....	66
Chapter 8	Basic Maintenance	68
8.1	Regular Spot Check.....	69
8.2	Cleaning the Scan Lens	69
Chapter 9	Appendix	71

Chapter **1**

Safety

Safety Ratings

Safety Label

The Safety Interlock System

Safety Measures

Operating Environment

1.1 Principles of CO2 Laser


LASER is the acronym for Light Amplification by Stimulated Emission of Radiation. GCC LaserPro StellarMark C series CO₂ (carbon-dioxide) laser works by electrically stimulating the molecules within a carbon dioxide gas mixture. When focused through a lens, this highly-intense, invisible beam will vaporize many materials. Depending on the speed and intensity of the projected beam, a CO₂ laser may be used to mark or cut through a wide variety of materials.

1.2 Principles of Fiber Laser

LASER is the acronym for Light Amplification by Stimulated Emission of Radiation. GCC LaserPro StellarMark IF-series is equipped with the state-of-art fiber laser technology. A fiber laser is built with “all fiber” technology and uses a telecom grade diode to pump an optical fiber, and the fiber is doped with rare-earth elements as a gain medium to generate 1064nm laser light. Compared to the conventional DPSS technology, fiber laser is immune of misalignment and does not request any adjustment during operation.


1.3 Safety Rating

The GCC LaserPro LFC Series Workstation carries two kinds of laser markers, a sealed CO₂ (carbon-dioxide) laser for StellarMark C series laser marker, or a fiber laser for StellarMark I series laser marker. Both laser markers emit intense and INVISIBLE laser radiation, C series with a wavelength of 10.6 microns for CO₂ laser, while I series with a wavelength of 1064nm (1micron) for fiber laser in the infrared spectrum. The LFC Series Workstation is designed with laser safety rating of **Class 1**, meaning that the system is equipped with key safety features and an enclosed laser head to completely contain the laser under normal use. One of the key safety features found on the LFC Series workstation is **Class 2** red dot safety guidance pointers allowing users to see where the laser beam is travelling and helping find out the precise focus point for laser to do quality job. Even though the LFC Series Workstation is equipped with the most powerful laser, through proper usage and taking necessary hardware safe guards will make it an extremely safe machine. When the side doors (left and right) are open, the laser machine becomes a **Class 4** equipment, users **MUST** wear safety goggles to operate the machine.

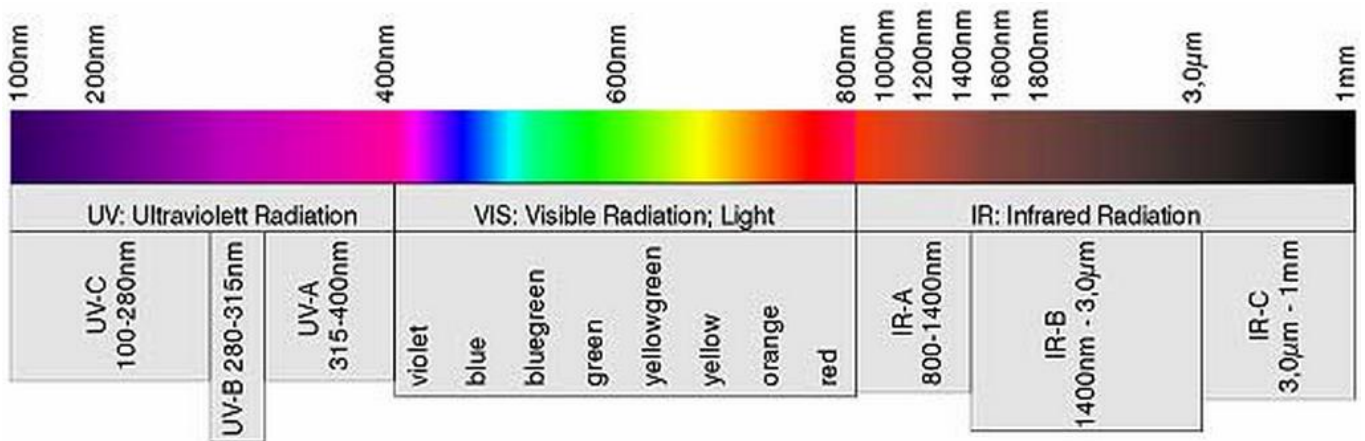

1.4 The Safety Interlock System

The LFC Series Workstation is equipped with a safety interlock system utilizing limit switch sensors on the electronically controlled front door. The limit switch sensor will shut the laser off when detecting front door open. Do not attempt to remove or modify these limit switches or any other component of the safety interlock system. If any time, the front door is open while the laser keeps firing, unplug the system IMMEDIATELY, and contact GCC local representative for technical support and maintenance instructions.

 **WARNING**

- DO NOT operate the laser system if any component of the safety system is malfunctioning.
- DO NOT attempt to remove or modify any component of the safety interlock system.

1.5 Safety Label

According to CDRH standards, all fixed or removable covers that allow access to a laser beam must have the appropriate laser warning labels attached to them. These warning labels must be clearly visible to the operator prior to removing the cover. Additional labels must be applied inside of the machine and be visible in the event the covers are removed. A label clearly displaying the manufacturer's name, date of manufacture, description of product, model number, serial number, and compliance statement must be attached to the outside of the machine.

In compliance with CDRH standards, the required warning labels are affixed at the time of manufacture to the GCC LFC Series Workstation in the appropriate locations. These labels

are not to be modified in any way or removed for any reason. Please familiarize yourself with the specific labels and their locations on the machine. Below is a list of all the safety labels and their locations on the machine.

Product Label

This label is located at the rear right side of LFC Series Workstation. All the product information such as Serial Number, Model Name, Electric power and Input can be found here. Before requiring any tech support, always provide service person the information on this label.

	
Manufacturer	Great Computer Corporation
Product	Laser Marking Center
Model	LFC D
Input	AC200-240V, 50-60Hz / single phase
Power Consumption	1240W
Manufactured	April 2019
Serial Number	T54116
Class 2 Laser Product This product complies with EN60204-1:2006 Made in Taiwan 4F-1., No.236, Fude 2nd Rd., Xizhi Dist., New Taipei City 22151, Taiwan	
  	

Safety Label

CDRH and CE regulations require that all laser manufacturers add warning label in specific locations throughout the equipment. The following warning labels are placed on the laser system for your safety. Do not removed these labels for any reason. If the labels become damaged or have been removed for any reason, do not operate the laser system and immediately contact GCC local representative or e-mail us for a replacement.

CDRH Label

This label indicates the class level of CDRH.



StellarMark C Series
Laser Marker CDRH Label



StellarMark I Series
Laser Marker CDRH Label

CE Label

This label identifies the classification of the Model in accordance with IEC 60825-1. It is located on the rear of the LFC Series Workstation.



Emergency Stop Label

This label indicates the emergency stop button. You can find this label on the right side of LFC Series Workstation front button operation section.




Warning Label

Warning Label is written with all the necessary information to be aware of during machine operation.



Door open warning labels

Labels are located on the machine's cabinet doors, machine becomes Class 4 when doors open.

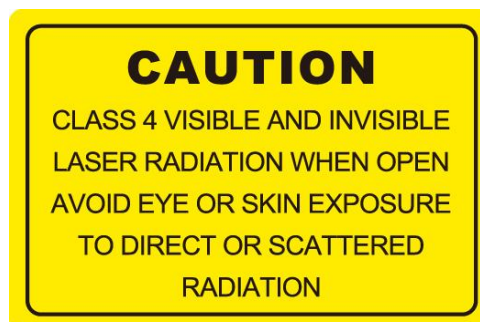

1.6 Safety Measures

- **LASER RADIATION WARNING:** Exposure to laser radiation may result in physical burns and severe eye damage. Proper use and regular maintenance of this machine is important to the safety of all people in the immediate area.
- Prior to operation, carefully read and familiarize yourself with the warning labels located on both your laser system and in this manual.
- Never leave the machine unattended during the laser cutting and marking process. The laser may ignite combustible materials. A well-maintained fire extinguisher and operational smoke or fire detector should be kept in the vicinity of the machine.
- Resulting debris from laser cutting are very dangerous and may cause fire hazard.
- Always wear safety goggles when the GCC LFC Series is in operation. Reflective materials such as mirrors, enameled brass and anodized aluminum may partially-reflect some of the invisible laser radiation. Severe eye damage may occur if appropriate safety goggles are not worn.

NOTE

StellarMark C series laser marker is shipped with a single pair of safety goggles. If additional safety goggles are required, please contact GCC directly or GCC local representative. If you wish to purchase one on your own, please make sure the safety goggles meet these requirements:

190 - 398 nm OD5+

10,600 nm OD5+

Visible Light Transmission: 92.9%

NOTE

StellarMark I series laser marker is shipped with a single pair of safety goggles. If additional safety goggles are required, please contact GCC directly or GCC local representative. If you wish to purchase one on your own, please make sure the safety goggles meet these requirements:

190 - 534 nm OD5+

910 - 1,070nm OD6+

Visible Light Transmission: 23.5%

- Connect the machine to a properly grounded power outlet. Ensure the voltage of the power source is identical to the voltage of the machine.
- Ensure the immediate work area of the machine is well-ventilated. Odors, vapors, and dust are byproducts generated during the laser marking and cutting process. An exhaust system is recommended. Please contact GCC or your local GCC distributor for more information.
- Do not laser heat-sensitive surfaces or materials that may generate toxic fumes, such as PVC and Teflon.
- Regularly clean and maintain your machine according to our cleaning and maintenance instructions. Doing so will ensure a machine that will operate effectively and safely over a long period of time.

1.7 Operating

Please follow the guidelines when considering a suitable location to set the GCC LFC Series. Improper work environments may lead to operational malfunction and/or unsafe working conditions. The GCC LFC Series should be placed and operated in a clean environment, avoid places where the machine is exposed to high temperatures, dust, or high humidity

- Keep the machine where the room temperature is between **15 – 30 degrees Celsius** or 58 – 85 degrees Fahrenheit.
- Avoid small, enclosed areas where a considerable amount of dust is present.
- Avoid areas where the humidity is above 70% or where the temperature is near the dew point.
- Setup the machine to be apart from the wall for at least 40cm (1.5 feet).
- Choose a flat surface that is not exposed to high levels of vibration.
- Be sure that your mounting platform has been securely fastened to the table, stand, or floor.
- Choose a location that is large enough to accommodate the machine, the computer and a work/storage table.
- Have a fire extinguisher close to the working location at all times.
- Make sure your smoke/fire detecting system is functioning.

Chapter 2

Unpacking & Content

Unloading & Unpacking

Contents & Accessories checklist

2.1 Contents & Accessories Checklist

The GCC LaserPro LFC Series Workstation is shipped in one crate that contains machine, software, and all of the necessary accessories. The following section shows detailed step-by-step instructions for unpacking and assembly the accessory to workstation.

WARNING


More than one person may be needed when loading and unloading the shipping crate in order to avoid body injury or damage to the machine.

NOTE

Please keep and store the original shipping crate in case it is needed for future transportation or product servicing.

Step 1. Move the shipping crate to the proximity of the designated work area.


Step 2. Loosen the screws fixed crate top and side panels, and remove all the panels.

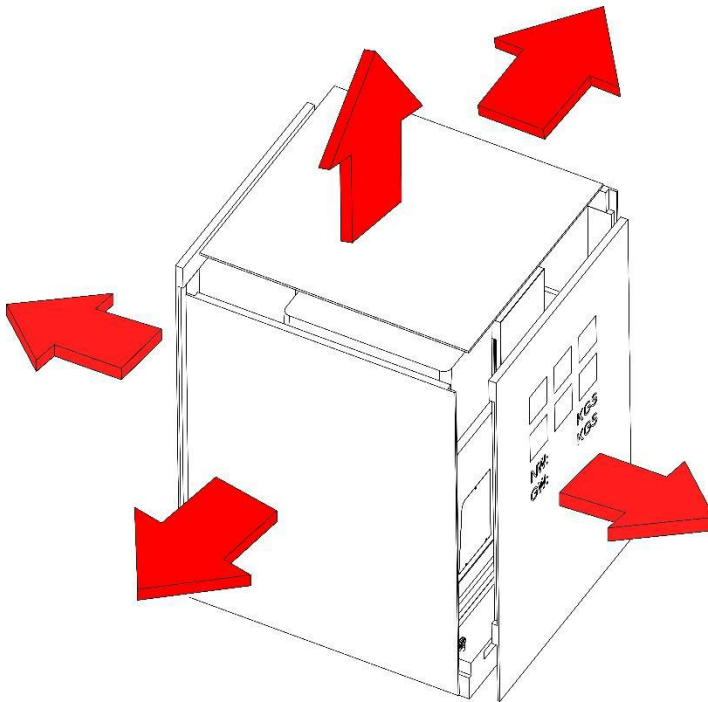


Step 3. Untie the knot.



Step 4. Unbuckle and remove the two safety harnesses that hold the machine in place.

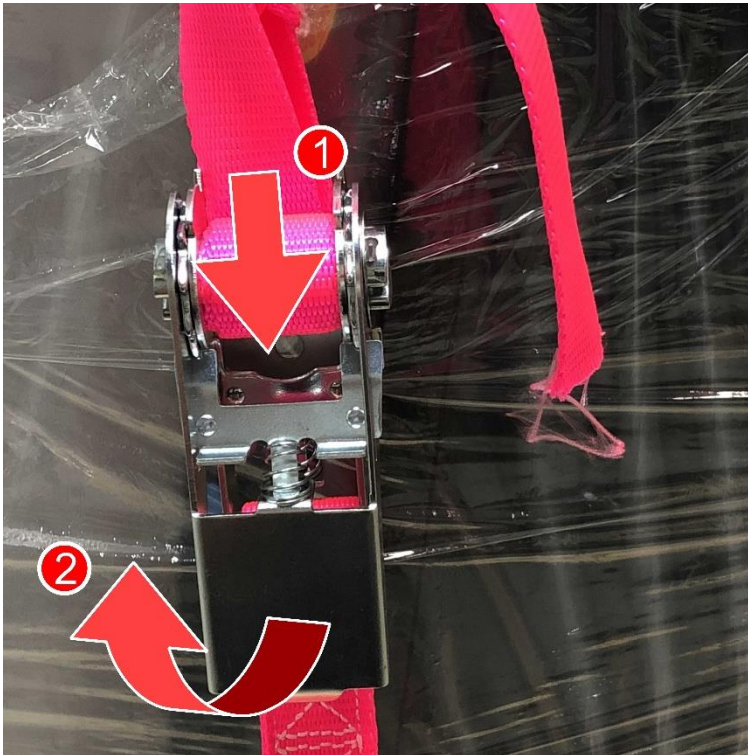

Step 5. Move the machine and placed on a stable desktop.

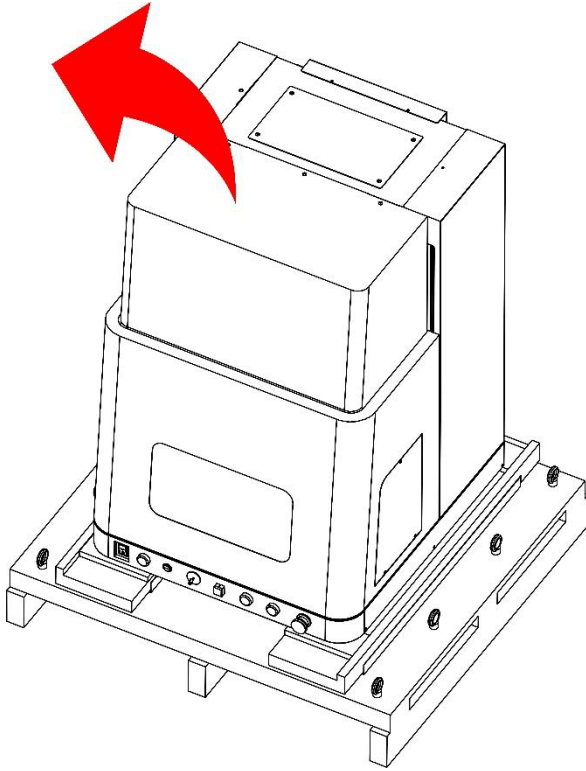

2.2 Contents & Accessories Checklist

Please check to make sure that all the following items are included within the shipping crate. If any of the following items are missing, immediately contact your local GCC representatives.

GCC LaserPro LFC-D Workstation Checklist

Name	Unit
LaserPro CD set (User's Manual)	1
G-Mark CD set (Software)	1
CIIS/CIIP 12/30V Dust Plate	1
CIIP 60Ti/60Ti93 Dust Plate	1
IFII/IFIIS Dust Plate (Installed on machine)	1
C-Series I/O Cable	1
I-Series I/O Cable	1
D-SUB 15pin Rotary Cable 750mm	1
Safety Key	2
External Signal Indicator	1
AC Power Cable (Europe)	1
AC Power Cable (US)	1
AC Power Cable (Australia)	1
Exhaust Pipe 500mm	1
Hose Clamp (ZHCB-110)	2
LFC Port Cable	1



GCC LaserPro StellarMark C Series Checklist (CO2 laser marker)

Item	Quantity
Hex head screws driver	1
LaserPro CD set (User's Manual)	1
G-Mark Advance CD set (Software)	1
G-Mark Advance Keypro	1
Lens cleaner	1
Lens cleaning paper	1
Cotton Bud (100 units/ package)	1
CO2#900 Goggles	1
Lens parameter list	1
M6 screw plastic foot	4
Nut (M6x5xS10).	4
I/O Terminal Platform(5ESDVM-12P)	2
I/O Terminal Platform(5ESDVM-10P)	1
Laser Head Power Cable (2.5M)	1
SCSI Cable 50pin (2.5M)	1
AC Power Cable(Europe)	1
AC Power Cable (US)	1
AC Power cable (Australian)	1
USB Cable 1.8M	1
GCC Promise Card Set	1
4 Port PCI USB 2.0 card	1
StellarMark Accessories checklist	1

GCC LaserPro StellarMark IF Series Checklist (Fiber Laser Marker)

Item	Quantity
SCSI Cable 50pin length 2.5m	1
System Key	1
Laser Marker Power Cable (48V/20A/7Pin 2.5m)	1
G-Mark LibrarySoftware CD set	1
User's Manual CD set	1
USB CABLE	1
AC Power Cable(Europe)	1
Power Cable (US)	1
Power Cable (AUS)	1
Pyramid Ruler Focus Tool	1
Software Keypro for G-Mark Advance	1
Lens Cleaner	1
Lens Cleaning Paper	1
Cotton Bud (100pcs/ pack)	1
1064nm Goggle	1
Lens parameter Card	3
M6 screw plastic foot	4
Nut (M6xt5xS10).	4
I/O Terminal Platform(5ESDVM-10P)	1
I/O Terminal Cable 25 pin	1
Hex head screws driver	1
Warranty Card	1

Chapter **3**

Mechanical Overview



Front View

Right View

Left View

Rear View

3.1 Front View

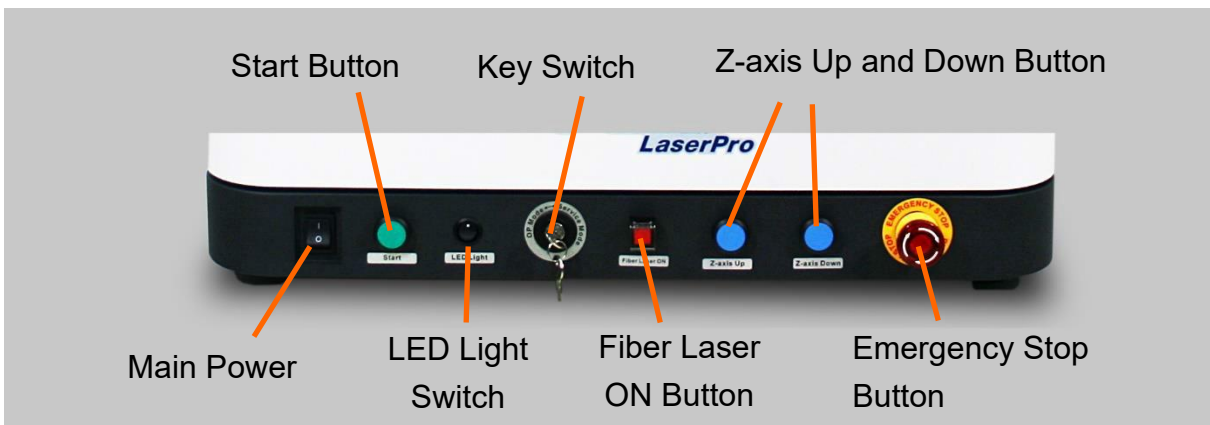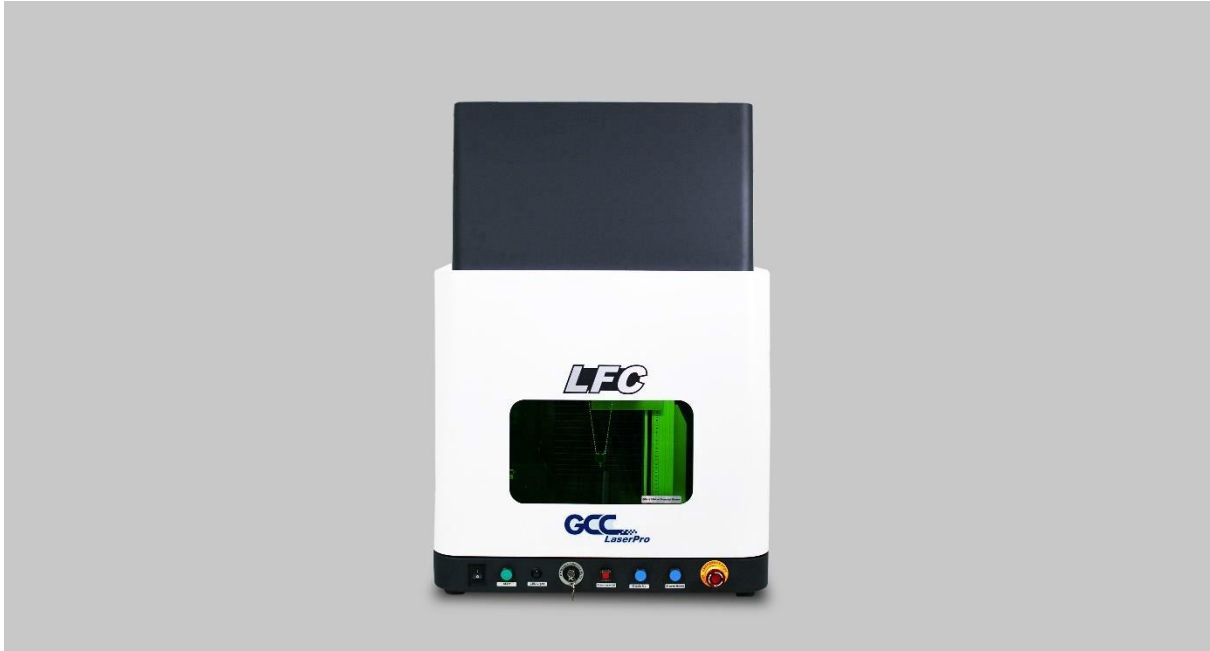


3.2 Right View



3.3 Left View



3.4 Rear View

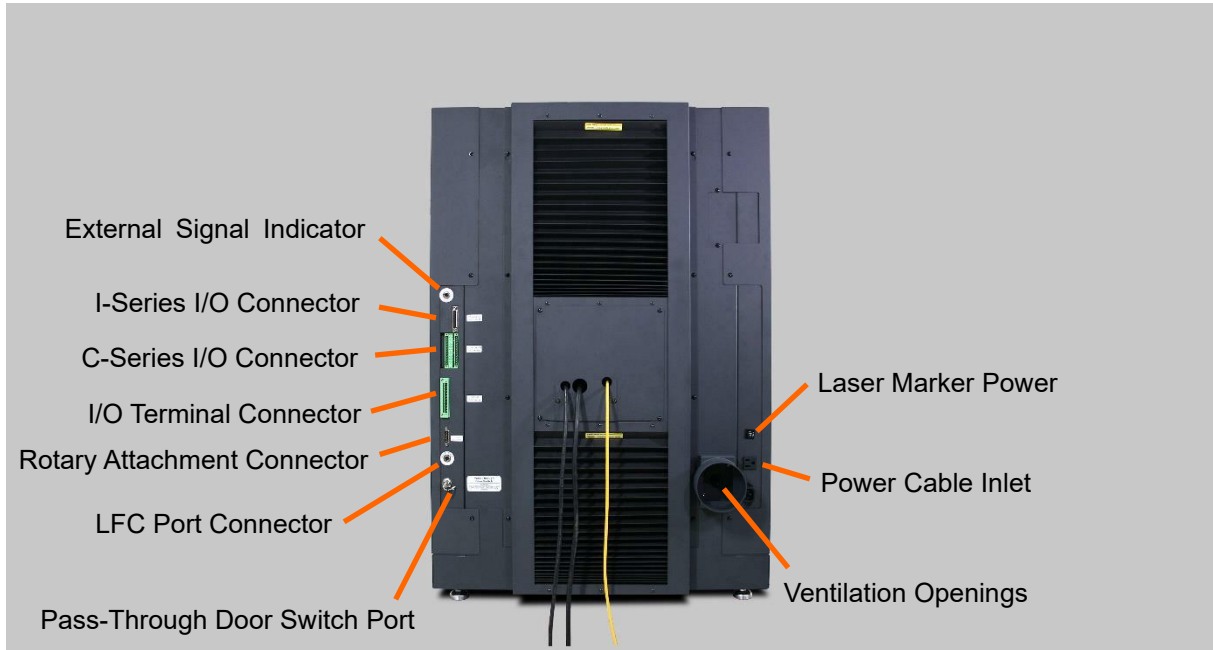

Chapter **4**

Machine Installation

Laser Marker Installation

4.1 Laser Marker Installation

Step 1. Plug in the power cable on the back of the LFC D



Step 2. Turn on the power of the LFC D




Step 3. Turn the key switch to the “Operation” mode



Step 4. Press on “Z-axis Down” button to down the Z-axis to the lowest position



Step 5. Loosen 2 screws to remove the cable cover of LFC Desktop Workstation

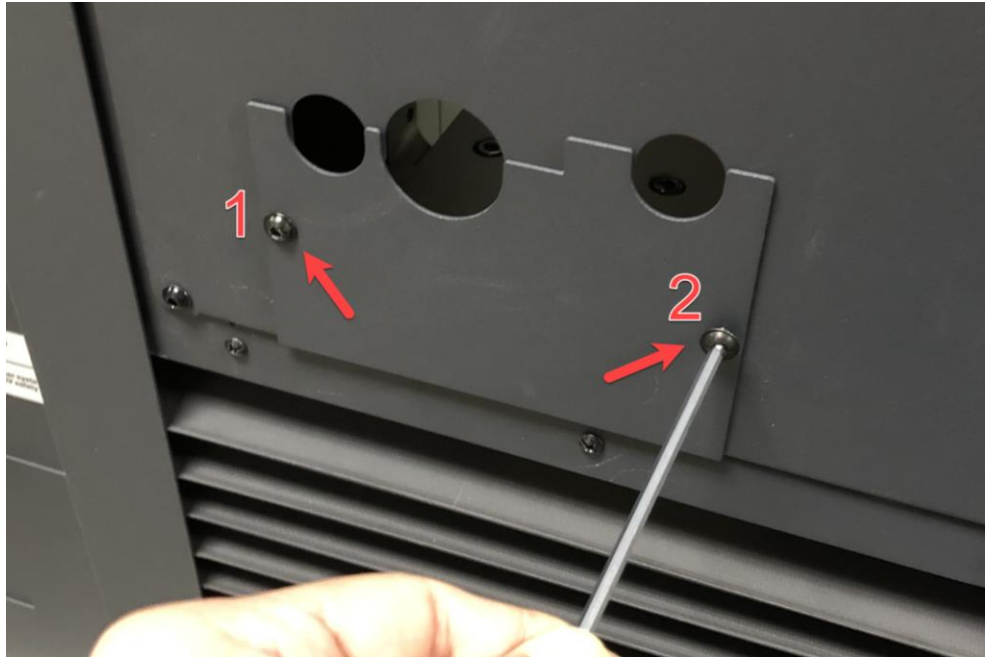

Step 6. Loosen 4 screws to remove the back cover of LFC Desktop Workstation




Step 7. Put the laser marker into the LFC-D from the back side



Step 8. Take out the “Marker Installation Tool” from the accessory kit (The tool is depends on your laser marker model)



Step 9. Put the tool on the Z-axis

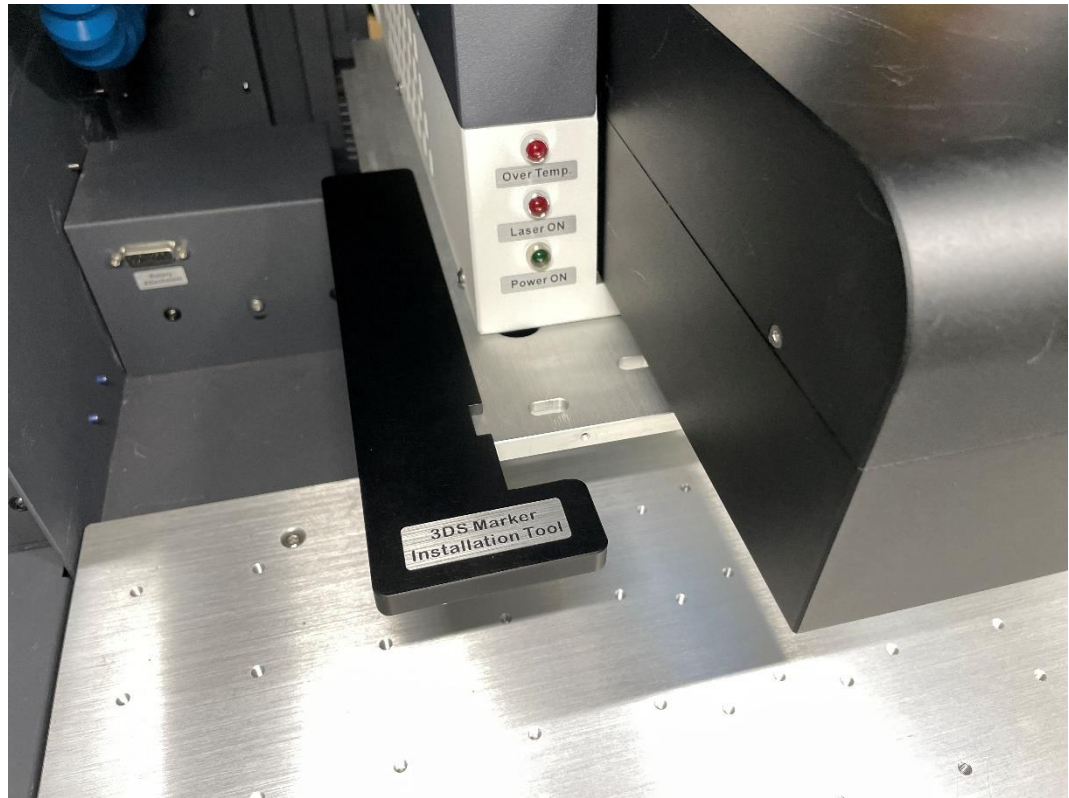

Step 10. Align laser marker to the installation tool to ensure the screws can be fixed with ease



Step 11. Press on “Z-axis Up” button to raise the z-axis to the highest position



Step 12. Tighten 4 screws from the bottom of z-axis to fix the laser maker on the LFC D





Step 13. Please perform the following steps to connect cables.

For CIIS / IFIIS

- 1) Connect the laser marker power cable and SCSI cable to the control unit according to your model.



- 2) Connect the laser marker power cable and SCSI cable to the laser marker according to your model.




- 3) Connect the power cord between the control unit and LFC Desktop Workstation.



- 4) Connect the I/O cable between the control unit and LFC Desktop Workstation.



- 5) For IFII/IFIIS series, please connect the LFC port cable between the control unit and LFC Desktop Workstation.

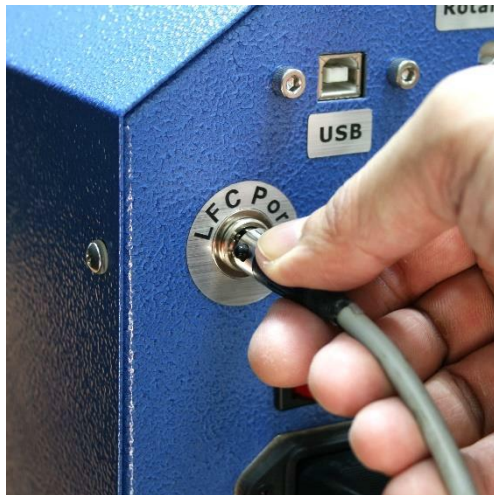

- 6) Connect the USB cable between the control unit and computer / Laptop.



- 7) Plug the G-Mark software keypro to the computer / laptop's USB port.




For 3DS

- 1) Connect the power cord between the 3DS and LFC Desktop Workstation.




- 2) Connect the I-series I/O Connector cable between the 3DS and LFC D.

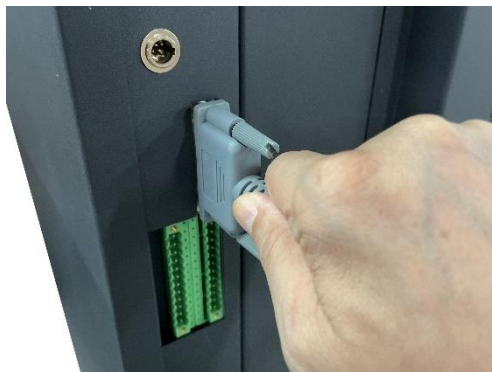


- 3) Connect the power cord of LFC Desktop Workstation.



Step 14. Assemble the back cover on the LFC Desktop Workstation.

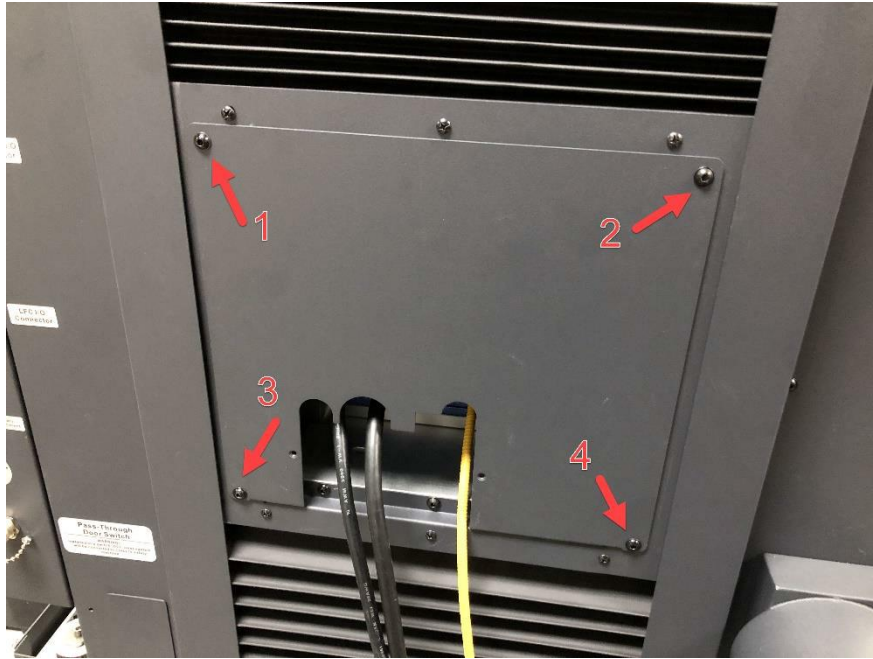

Step 15. Assemble the cable cover.

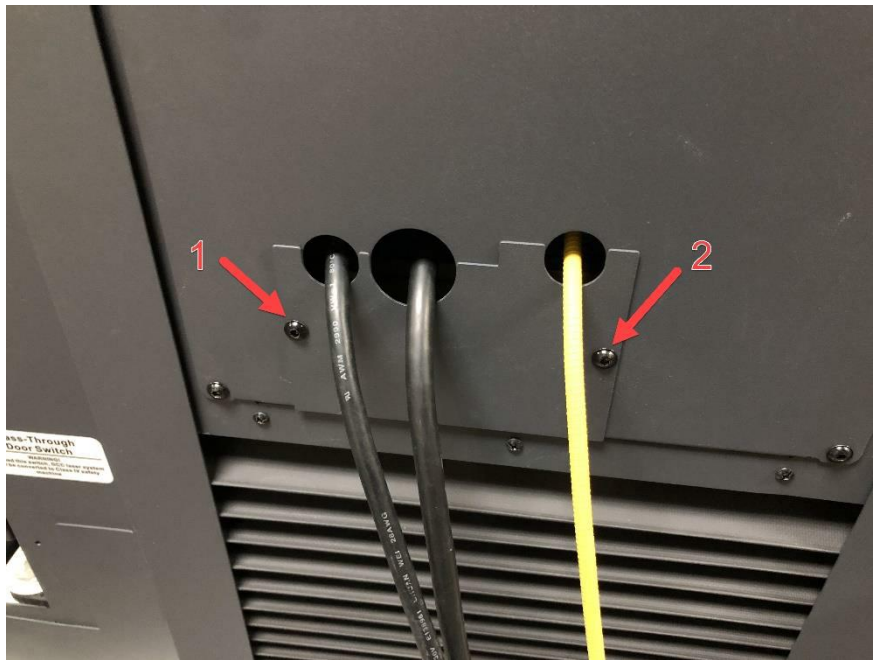

Step 16. Installation is completed.

Chapter **5**

Software Setup

Recommended Computer Configuration

Software Installation for Windows System

Software Installation for MAC System

Setting the User Level

5.1 Recommended Computer Configuration

The LFC Series Workstation and G-Mark software are designed to work best using a Windows based system with the following minimum requirements.

Computer Configuration

- CPU Intel Pentium, 1GHz or above
- DRAM 1GB RAM or above
- CDROM One CD-ROM disk drive
- HDD 500 MB of free hard drive space
- SVGA Super VGA display (1204 x 768 min. resolution)

Recommended Operating System for G-Mark Marking Software


- Windows XP SP3
- Windows 2000
- VISTA 32 bit
- Windows 7 32 bit

5.2 Software Installation for Windows System


- Step 1.** Take out the G-Mark installation CD from the accessories kit and insert to CD-ROM drive of PC.
- Step 2.** Wait few seconds for the CD Manager to begin the Setup automatically
- Step 3.** Click on “for LFC Workstation” from the menu of the G-Mark installation CD according to your operating system




Step 4. Set the destination directory and click "Next>"

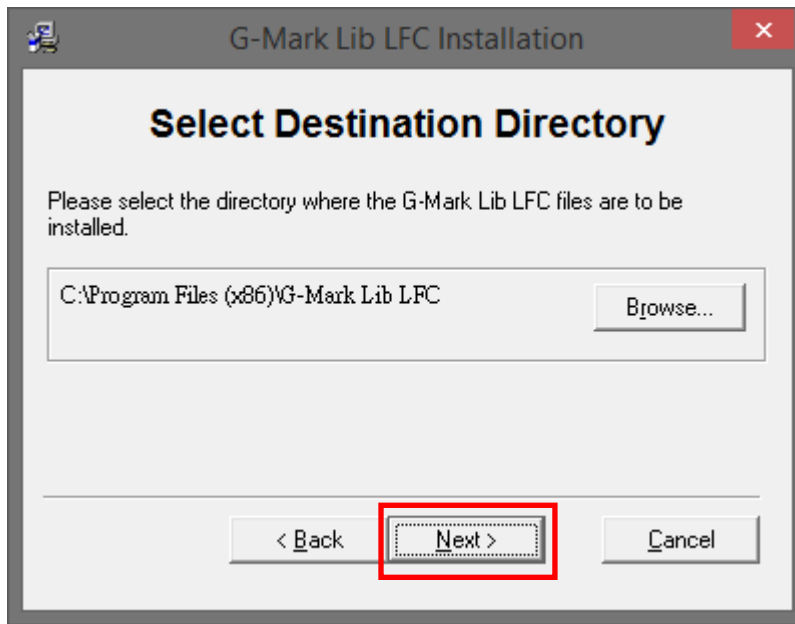


Step 5. Select "Next>"

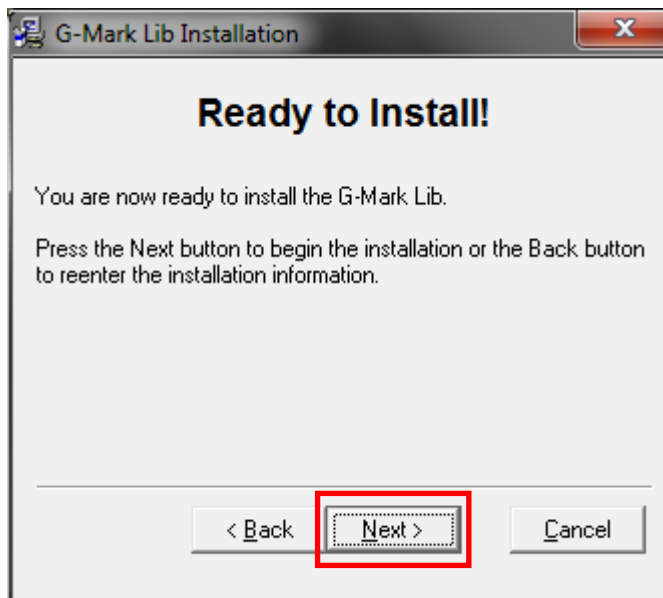


Step 6. Installing

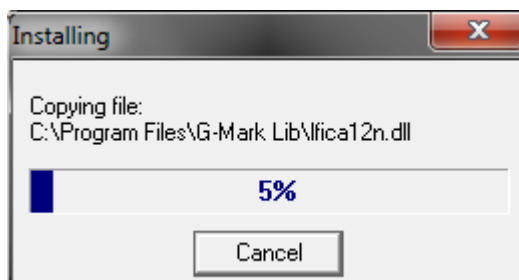


Step 7. At 95% completion of the installation, the ModelManger window will show up.

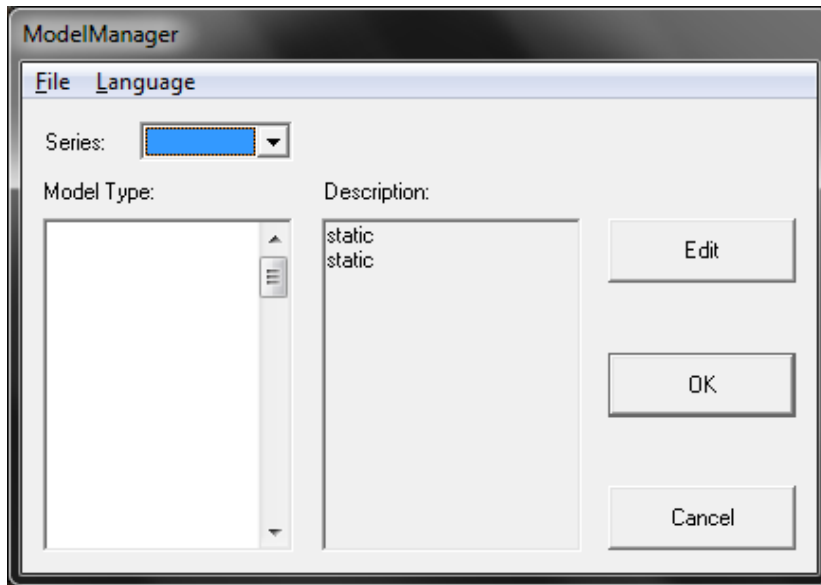


Step 8. Select the laser marker series & model type.

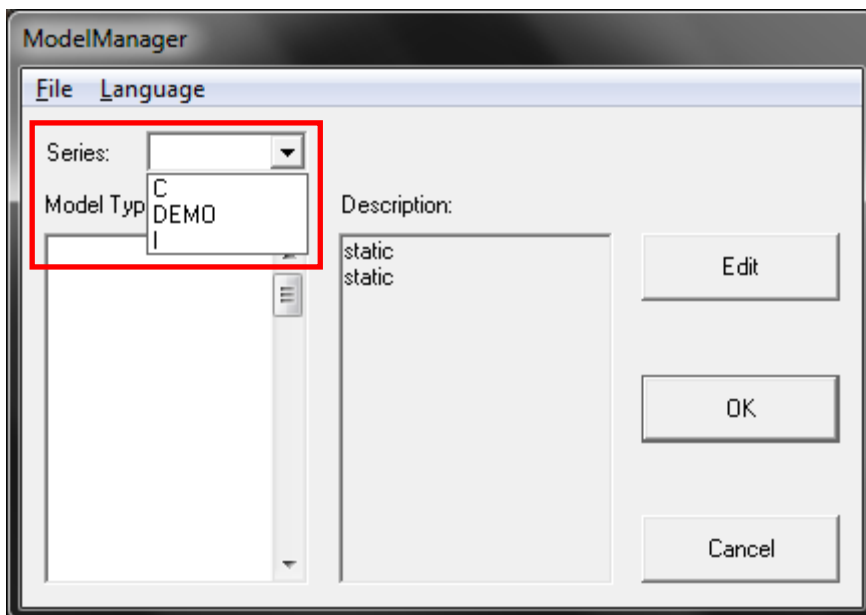


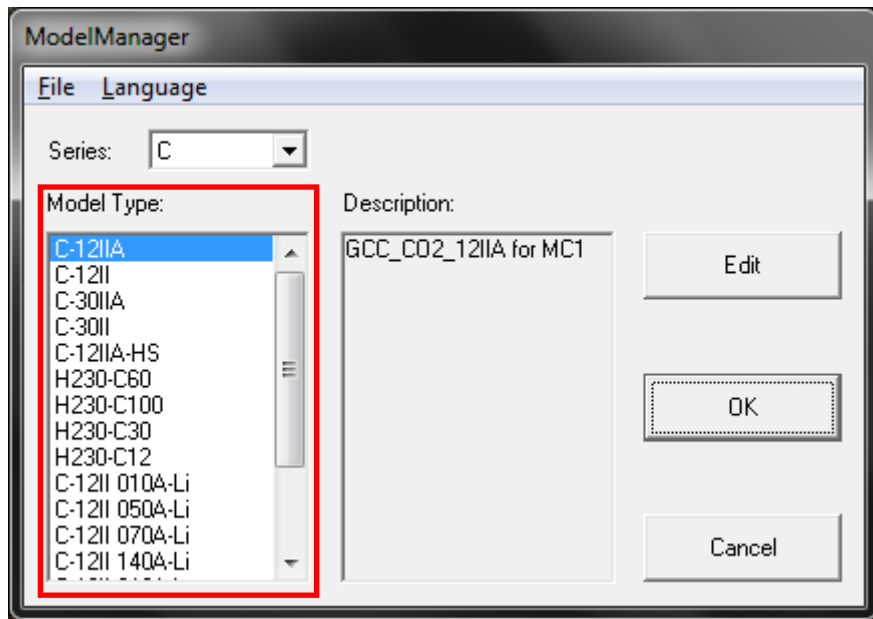


Step 9. Click “OK”

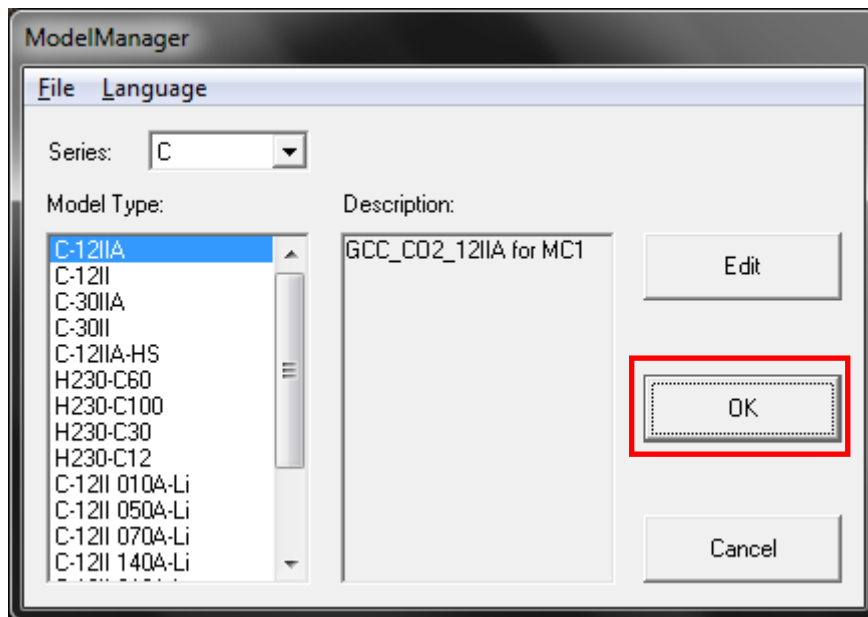

Step 10. Click “Finish” to complete the installation

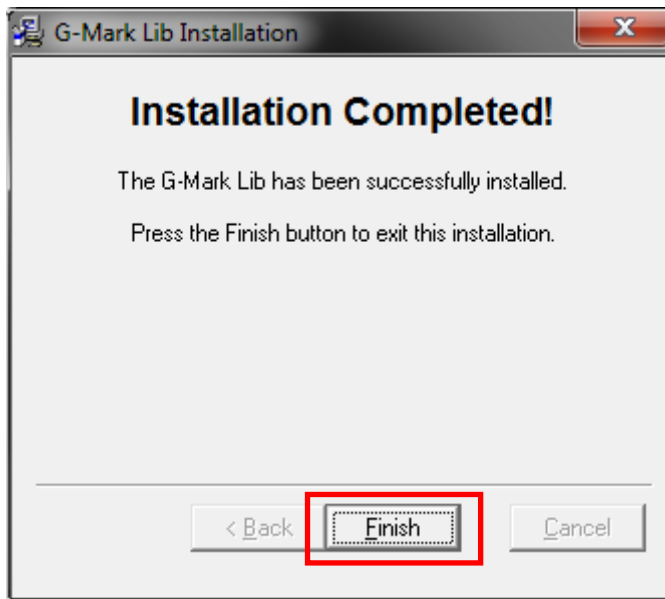

Step 11. Once the installation is completed, you will find “Laser marking controller” at the lower right hand corner on your computer screen, this indicates the computer is able to communicate with StellarMark laser marking system.

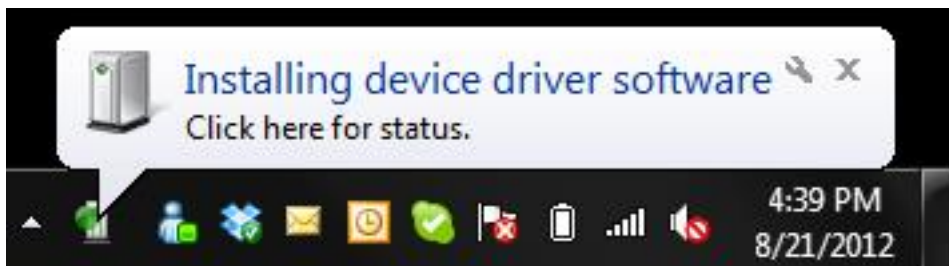

Step 12. Import or Open a new G-Mark graphic file to start the graphic design and setup the laser parameters for output.

5.3 Software Installation for MAC System

MAC users can use GCC StellarMark machines by purchasing the Parallels Desktop software which allows you to install Windows OS in MAC computers and run Windows based software under MAC computer and output with G-Mark.

Step 1. Purchase Parallels Desktops on its official website.



Parallels Desktop 8 for Mac
The #1 choice of customers worldwide to run Windows on Mac

Parallels Desktop 8 for Mac lets you seamlessly run Windows and Mac applications side-by-side, without rebooting.


Enjoy the latest Mountain Lion and Lion features in Windows apps, and remotely access your Windows and Mac programs from your iPad or iPhone with the Parallels Mobile app, available for purchase in the App Store.

In addition to Windows 7, other OSes can also be run in Parallels Desktop 8 for Mac, including Windows 8, Windows Vista, Windows XP, Windows 98, Linux, and Google Chrome OS.


Buy \$79.99 Watch Video Try Free

Upgrade now for \$49.99


Step 2. Install Parallels Desktops under Mac OS environment.

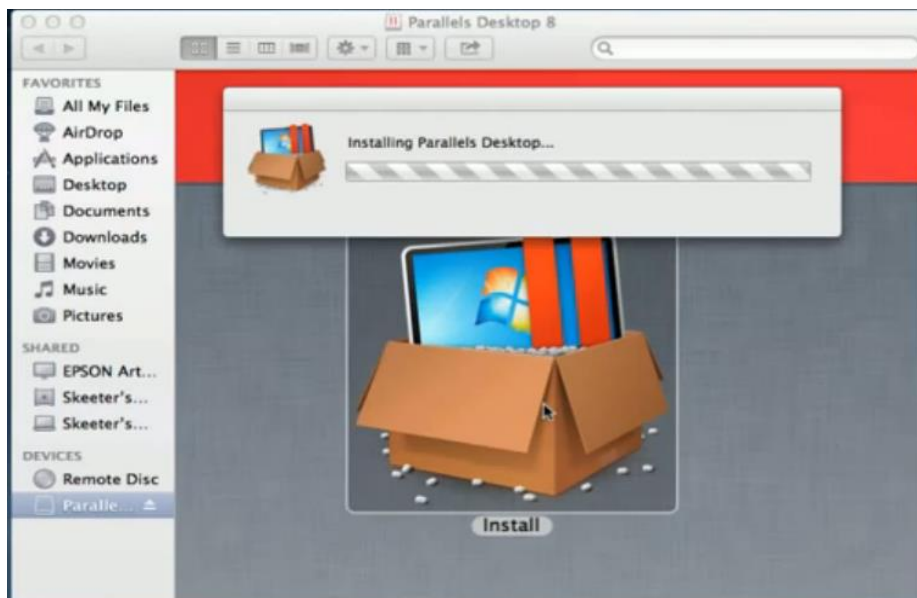

Step 3. Read Software License Agreement and press “Accept” to continue installation

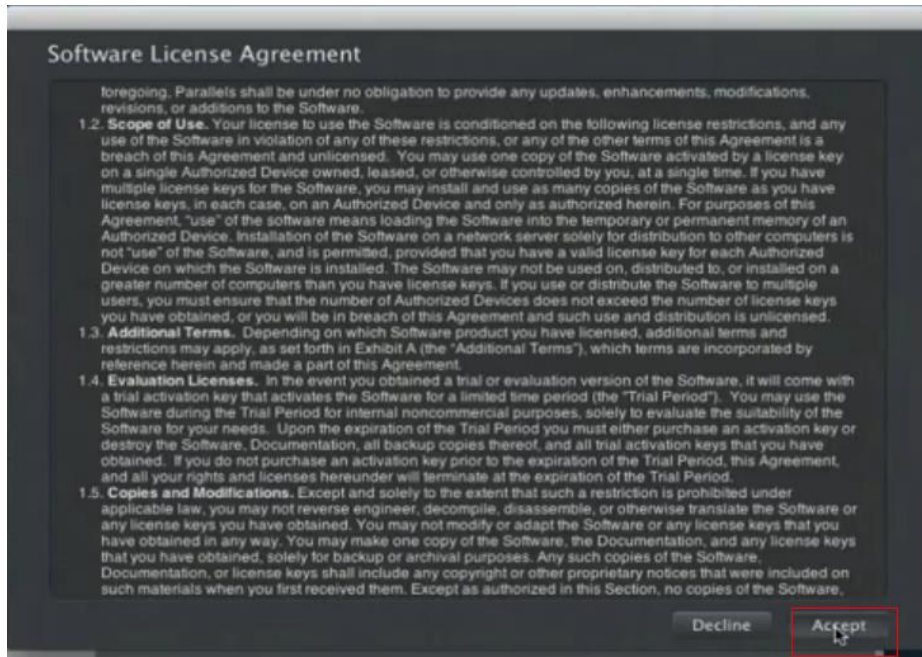


Step 4. Enter your Mac OS X User Name and Password then press “OK”

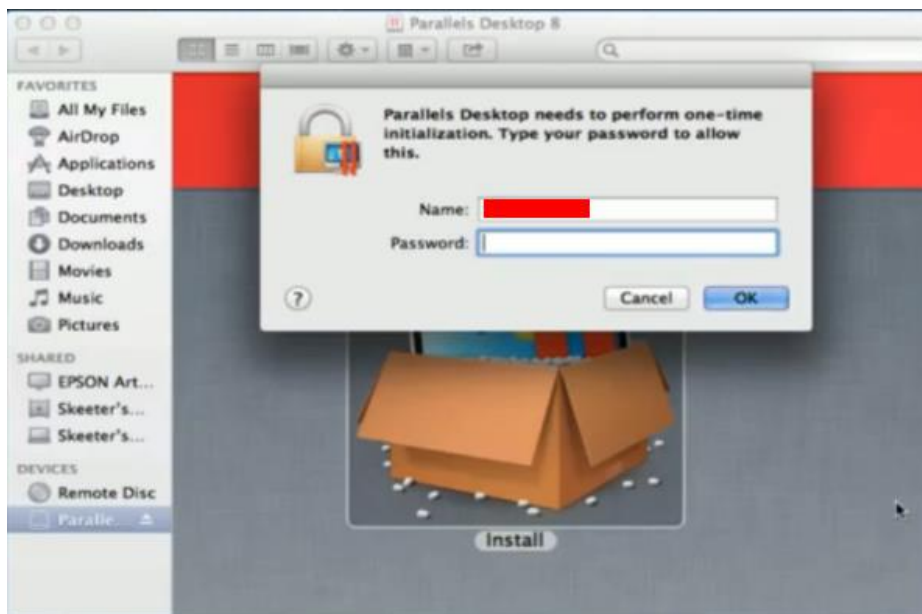


Step 5. Press “Active”




Step 6. Press “OK” when activation is complete.

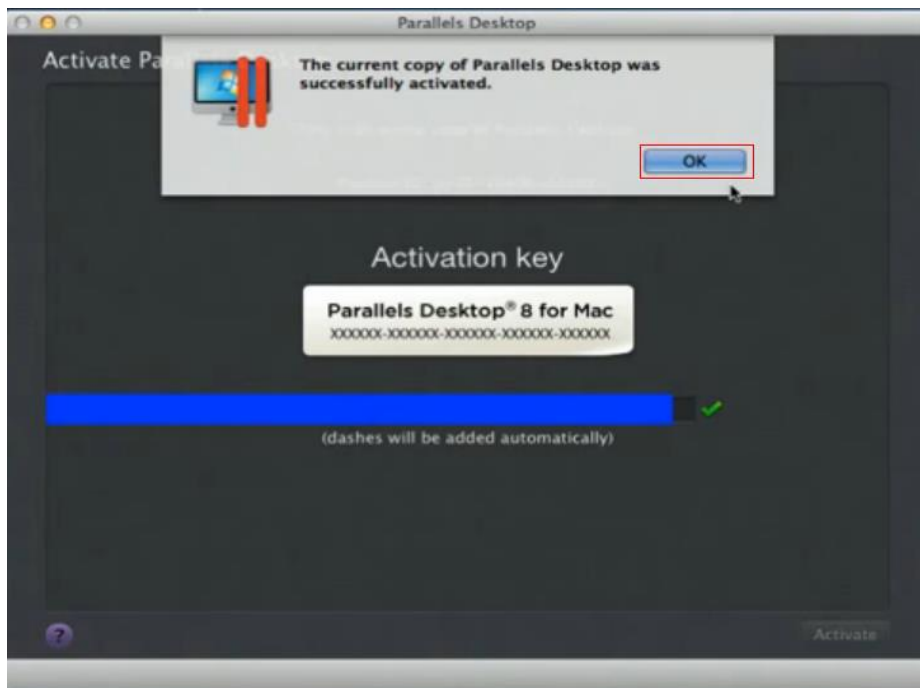


Step 7. Register Parallels Desktop

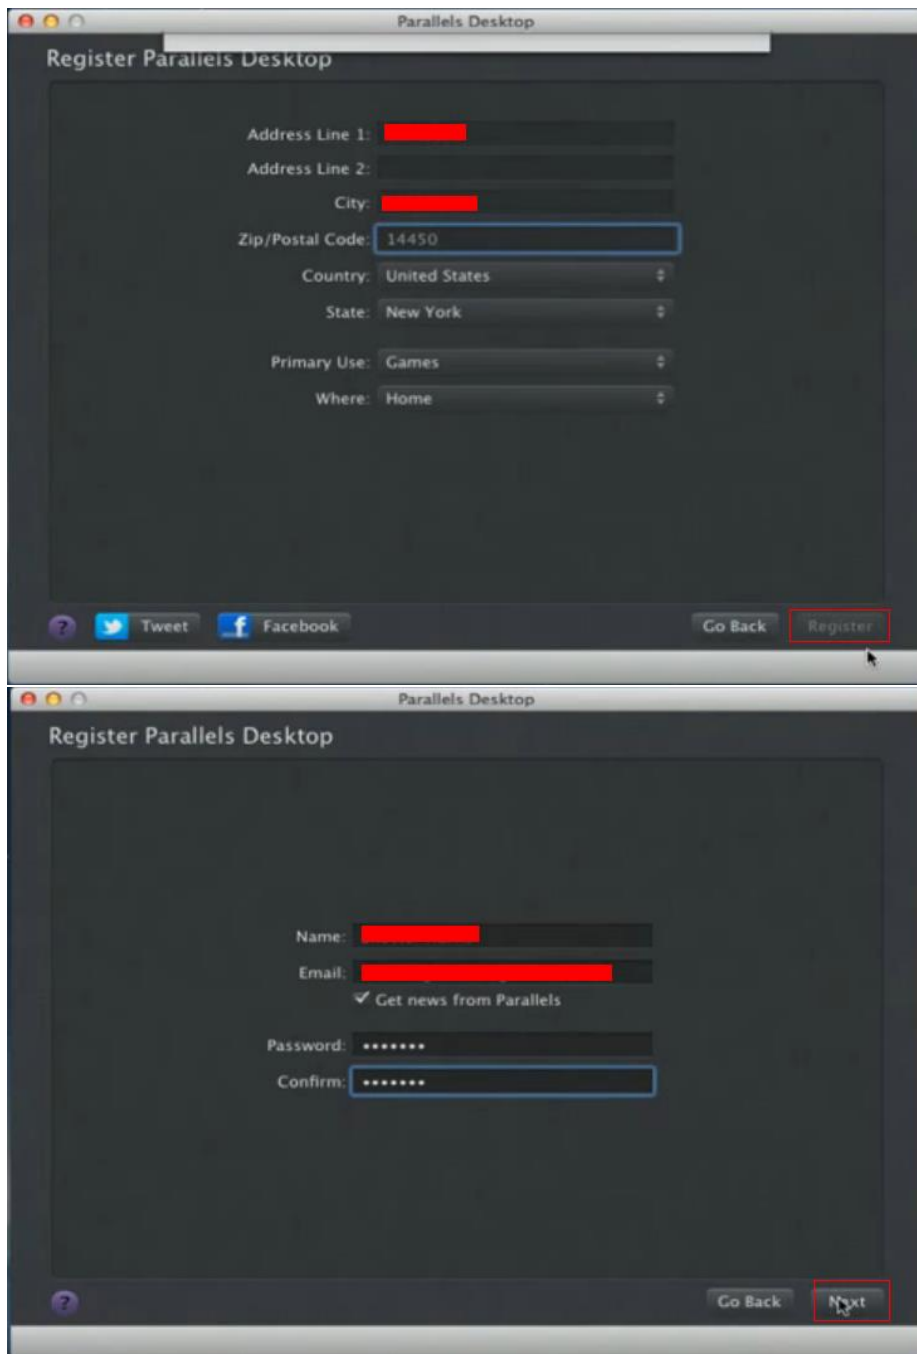

Step 8. Press “Register” and “OK” to complete the installation of Parallels Desktop.

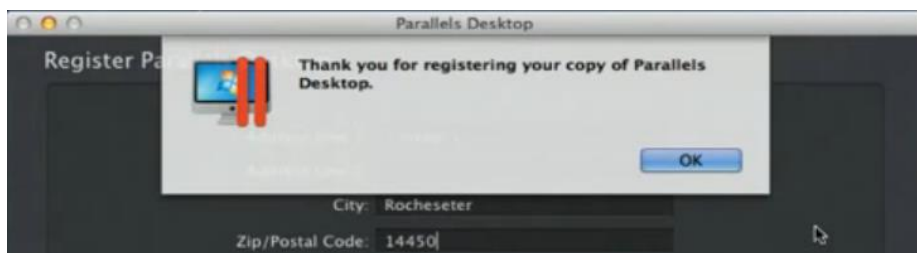

Step 9. Open **Parallels Desktop** (in the **Applications** folder) then choose **File** → **New**

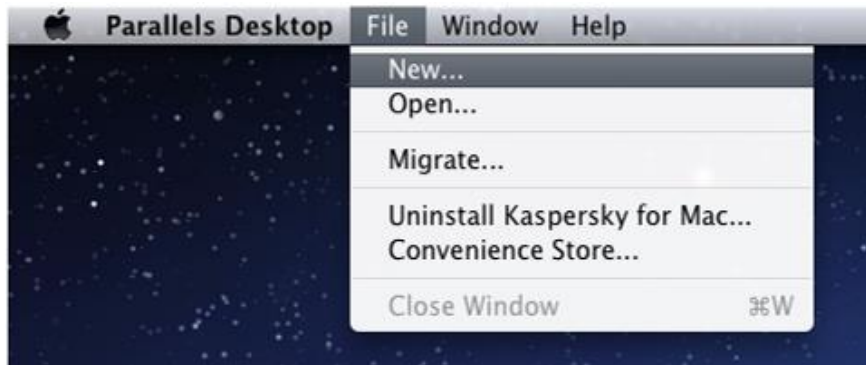


Step 10. Press “Install Windows from DVD or image file” then press “continue” to install windows OS



Step 11. Select CD-ROM drive with the Windows installation CD




Step 12. Enter the Windows OS product key

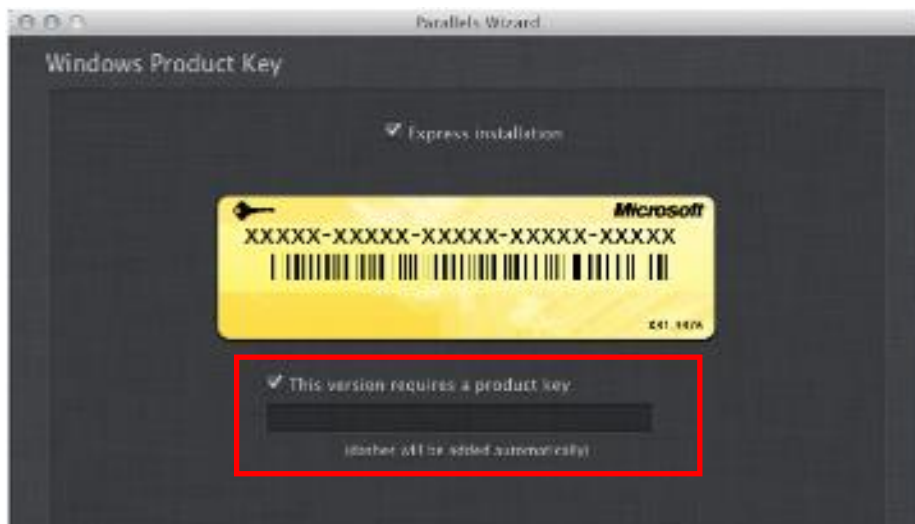


Step 13. Select how you would like to run your Windows program.



Step 14. After the prior setting is complete the windows OS installation procedure will start automatically.

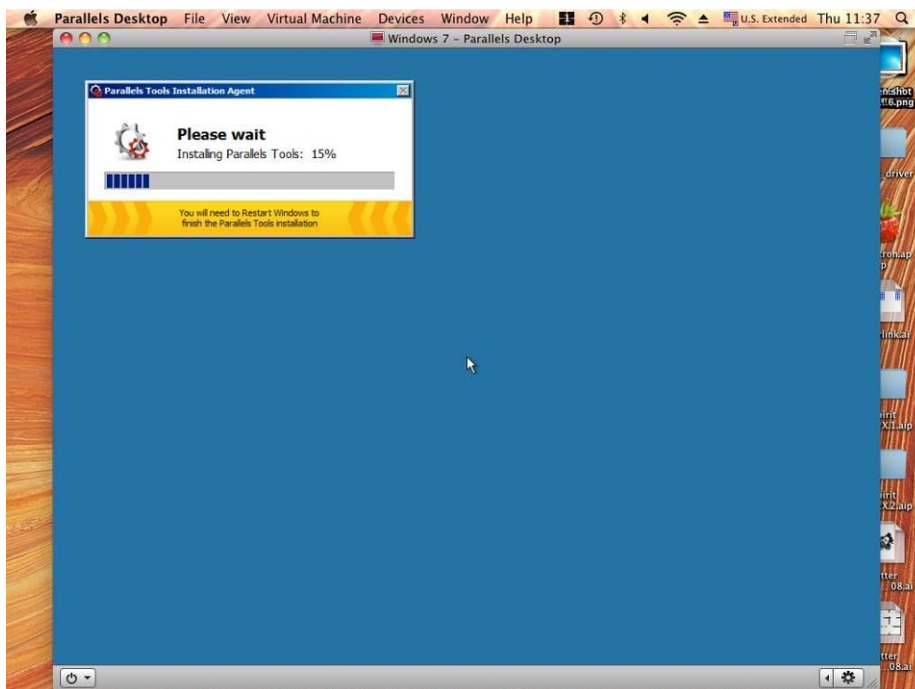

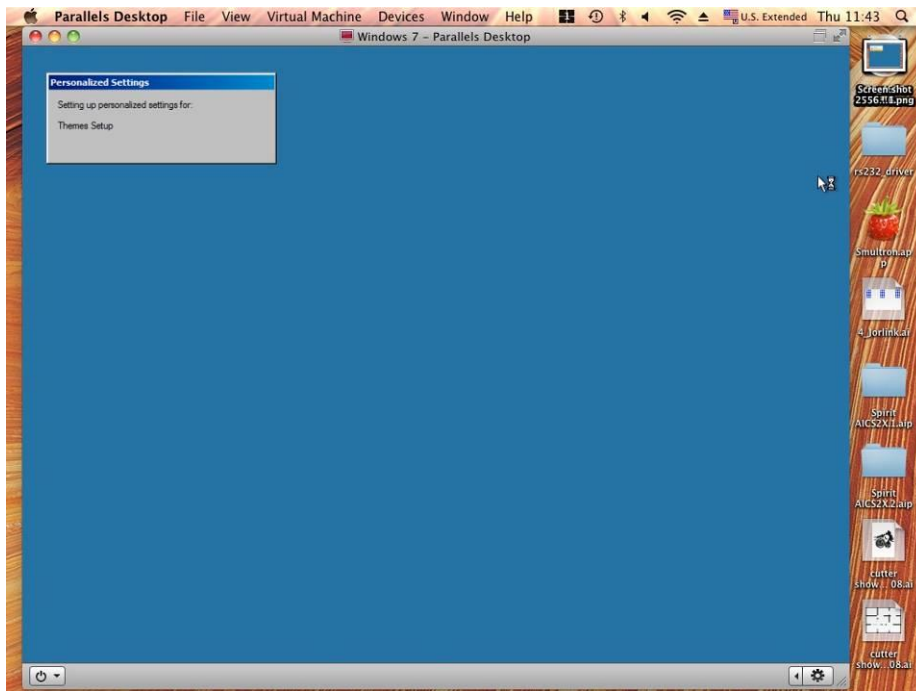


Step 15. Windows OS installation is complete then you can refer to “5.2 Software Installation for windows system” to install G-Mark / G-Mark Library.

NOTE

Once the G-Mark software installation is completed, you can start to open a new file to edit or import an existing file to G-Mark for laser processing. For G-Mark software operation manual, you can refer to “G-Mark software user manual” in the StellarMark CD from accessory box.

5.4 Setting User Level

There are three user levels of G-Mark, operator, programmer and administrator. Director has authority to enable/disable the software functions for each level.

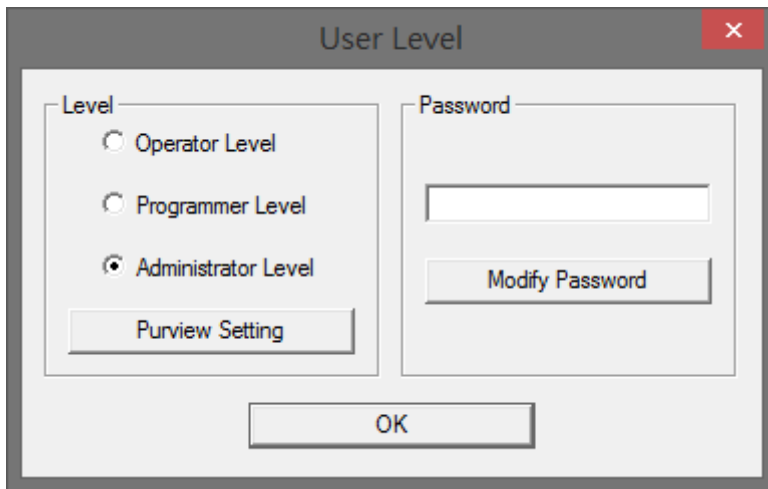

Find the different definitions for each user levels:

Operator Level

Operator only can read and output files.

Programmer Level


Programmer can edit objects and use some limited functions.

Administrator


Administrator can use all G-Mark functions and has authority to change the system setting. Such as change password or authorize software function for each user level.

5.3.1 Switch User Level


Step 1. Select “Execute” → “User Level” from menu bar

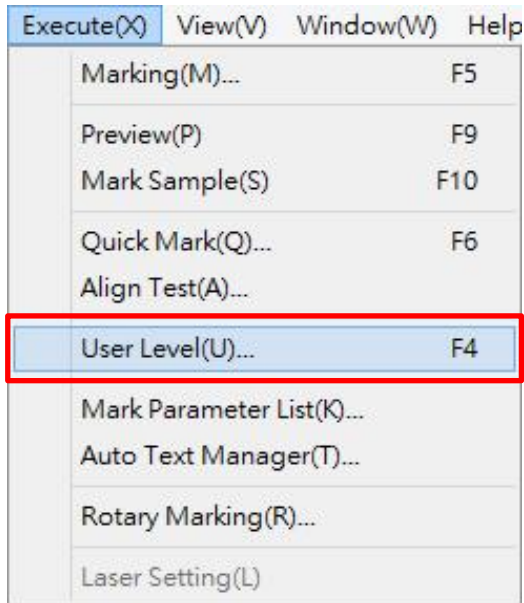

Step 2. Select user level and input password

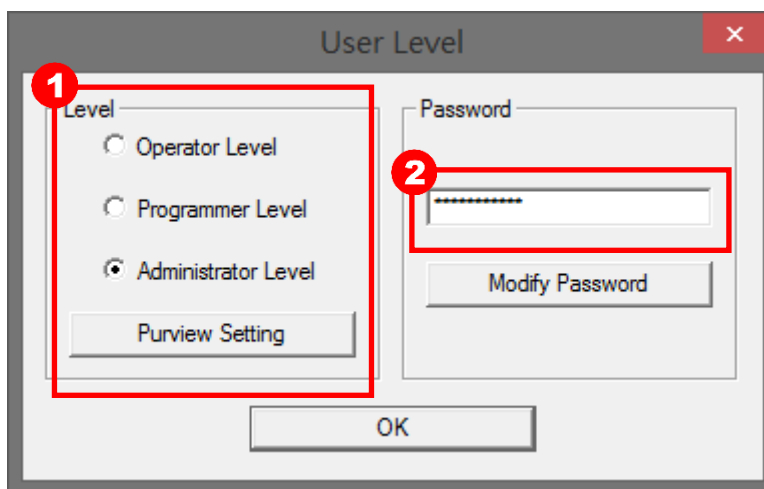

Step 3. Click on “OK” to switch user level

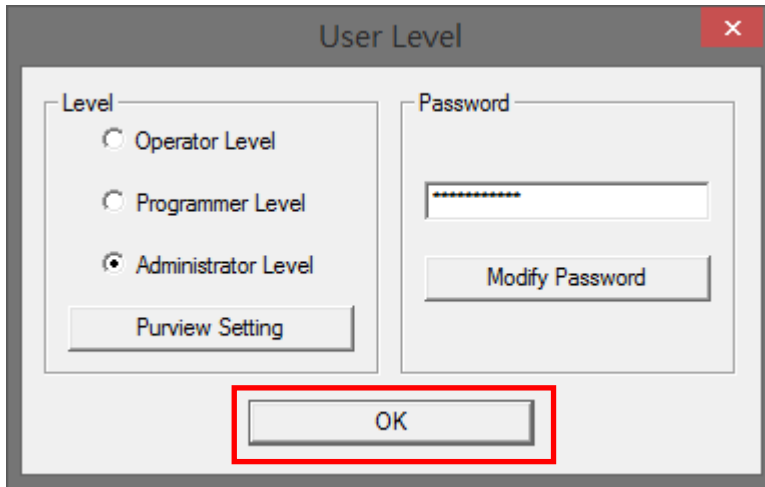


NOTE

- Password is protected in Programmer & Administrator user levels.
- Default password for Programmer & administrator levels is “stellarmark”.


5.3.2 Modify Password

The following steps illustrate how to modify user level password


Step 1. Select “Execute” → “User Level” from menu bar

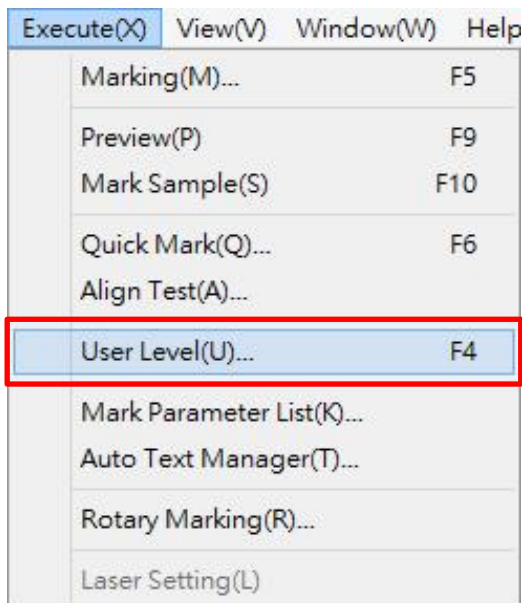


Step 2. Select “Administrator Level” and input password.

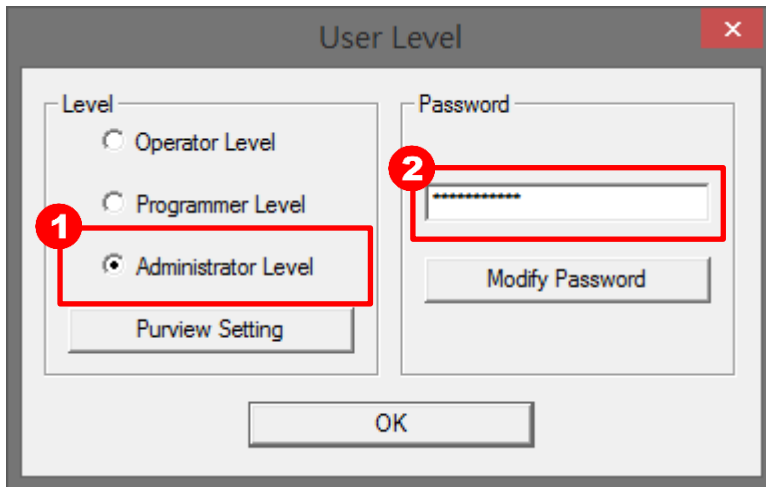


Step 3. Click on “Modify Password” and the modify password window will show up.

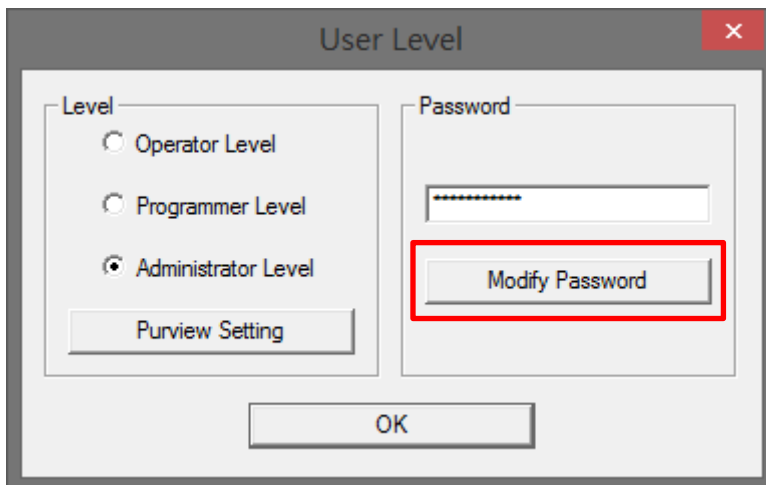

Step 4. Input the new password for programmer level or administrator level.

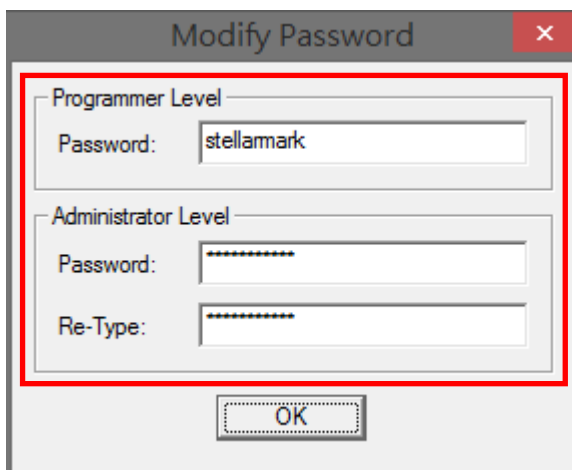

Step 5. Click on “OK” after the password modification is complete.

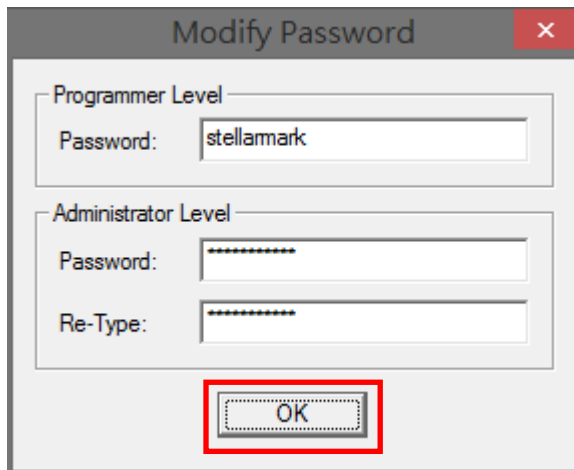

Warning


- If you forget your password or don't know it, you need to reinstall G-Mark to restore the default password. Therefore please remember your password.

5.3.3 Purview Setting


Purview setting only for administrator level, administrator can enable/disable software function for programmer and operator level.

The following steps illustrate how to setting the purview


Step 1. Select “Execute” → “User Level” from menu bar

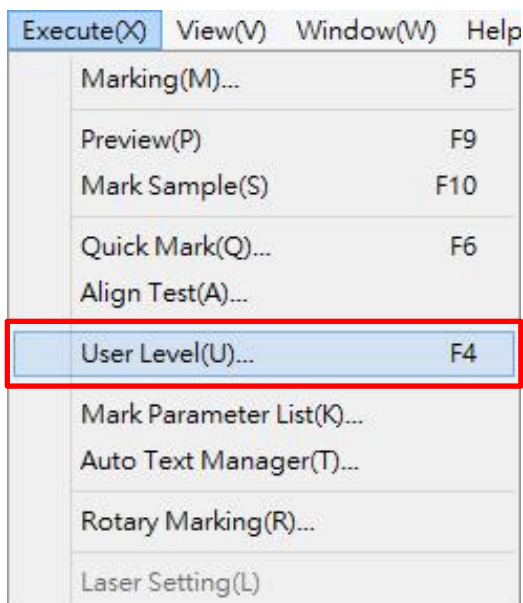


Step 2. Select “Administrator Level” and input password

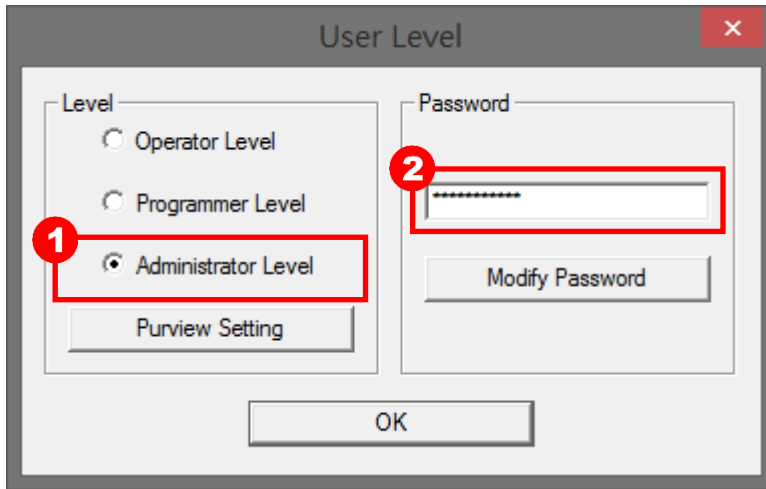


Step 3. Click on “Purview Setting” button and the Purview Setting window will pop up.

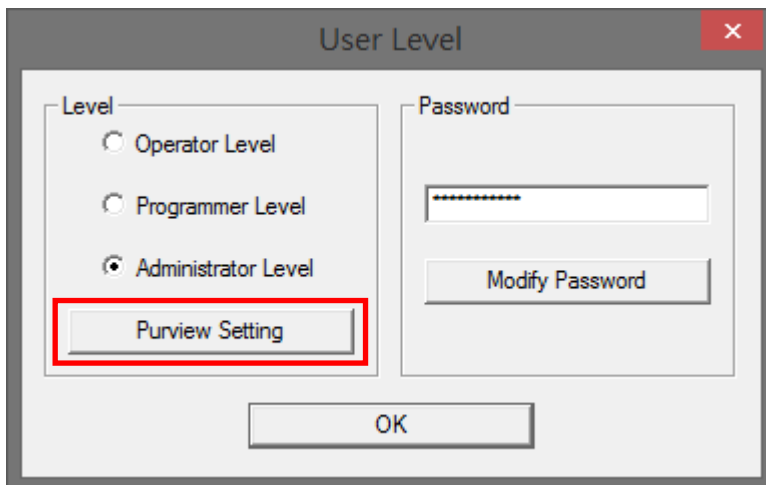


Step 4. Click “Category” list to set all the software function

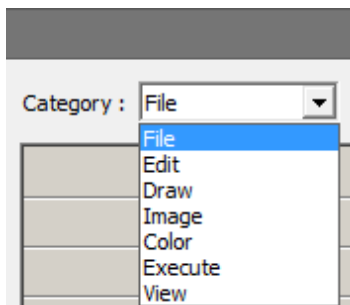

Step 5. All the software function can be authorized or unauthorized in the purview setting; select checkboxes allow you to activate a function for different user level and vice versa.

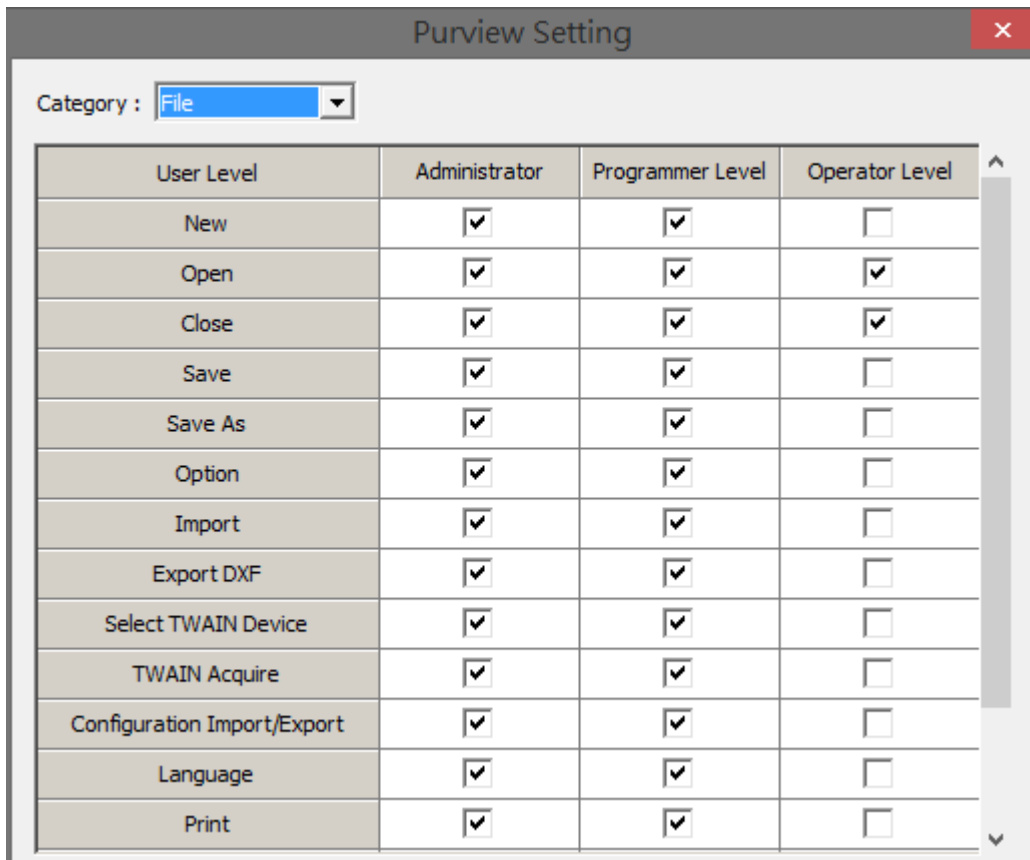

Step 6. Click on “Exit” button after the setup is complete.

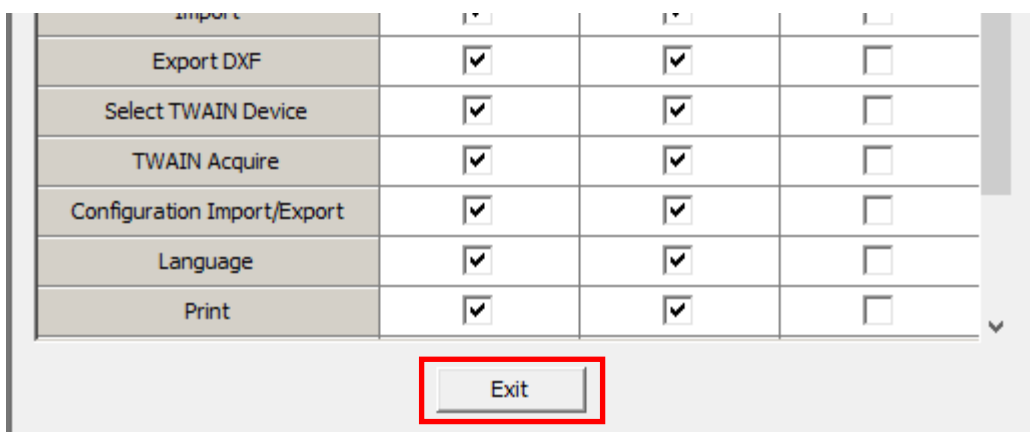

Chapter **6**

Operating the LFC Desktop Workstation

Hardware Introduction

Service Mode Operation

OP Mode Operation

6.1 Hardware Introduction

6.1.1 Emergency Stop Button



Press the Emergency Stop button to stop the AC power of the LFC desktop workstation for emergency. To reset this button, rotate clockwise.

NOTE

Please turn off the mater power of machine and reset emergency stop button then re-start the machine and G-Mark software after pressing the emergency stop button.

6.1.2 Key Switch



It will allow LFC desktop workstation to switch between Operator Mode and Service (repair) Mode.



WARNING


Service Mode only for administrator, always remove key when setup or service completed.

6.1.3 Start Button




Allow to execute the laser firing job. It can also be used to control the opening and closing of the door.

6.1.4 LED Light Switch

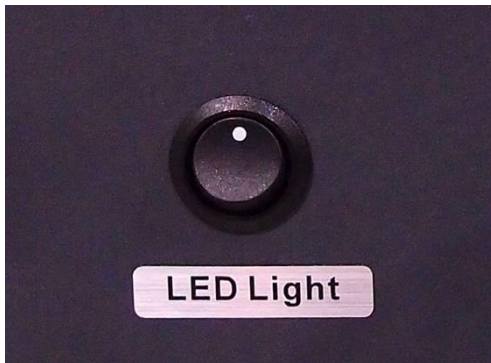

Switch the LED light ON or OFF.

6.1.5 Fiber Laser ON Button

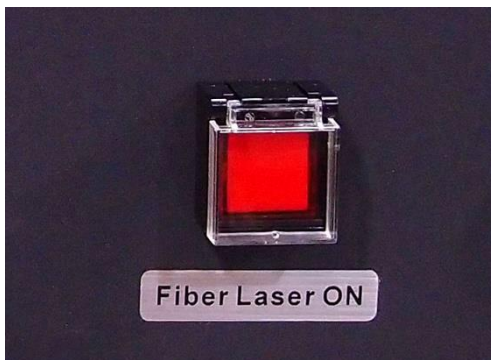

The fiber laser ON button only for StellarMark IF series, always turn ON to allow fiber laser firing.

6.1.6 Main Power ON/OFF Switch



Switch the AC Power ON/OFF of the LFC desktop workstation.

6.2 LFC Desktop Workstation Service Mode Operation

Step 1. Turn on the machine.



Step 2. Turn the key switch to service mode, and then the door will open automatically if door is closed.




Step 3. Put the marking object on the Z-axis table

Step 4. Put down the pyramid focus tool, and then move the Z-axis table up or down until the object touches the bottom screw of pyramid ruler.



Step 5. Open / import the marking file from G-Mark marking software.

Step 6. After editing, click “Marking” button, and then the “Marking” window will pop up.

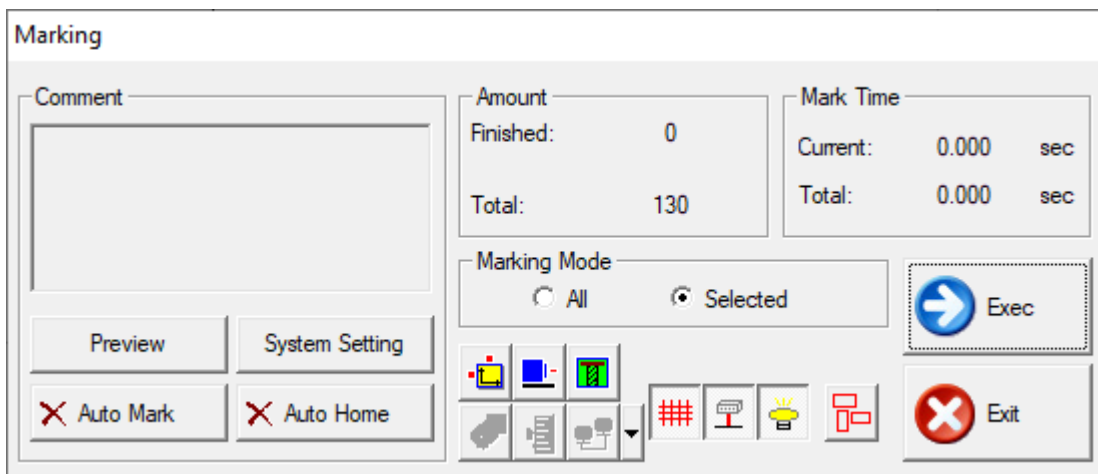

Step 7. Click “Exec” button from G-Mark marking software to starting the job.

NOTE

The auto door will always open in the service mode, please wear goggles to operate the machine.

Step 8. Job complete.

6.3 LFC Desktop Workstation OP Mode Operation

Step 1. Turn on the machine.




Step 2. Turn the key switch to OP mode, and then the door will open automatically if door is closed.



NOTE

Please switch the user level to “Operator level” on G-Mark marking software after turn the key switch to OP mode to avoid any abnormal. Please refer to the chapter 5.4 for more details setting.

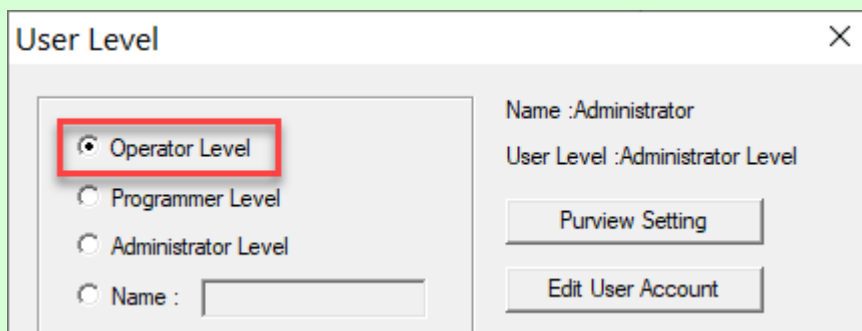


Step 3. Put the marking object on the Z-axis table

Step 4. Put down the pyramid focus tool, and then move the Z-axis table up or down until the object touches the bottom screw of pyramid ruler.



Step 5. Open / import the marking file from G-Mark marking software.

Step 6. After editing, click “Marking” button, and then the “Marking” window will pop up.

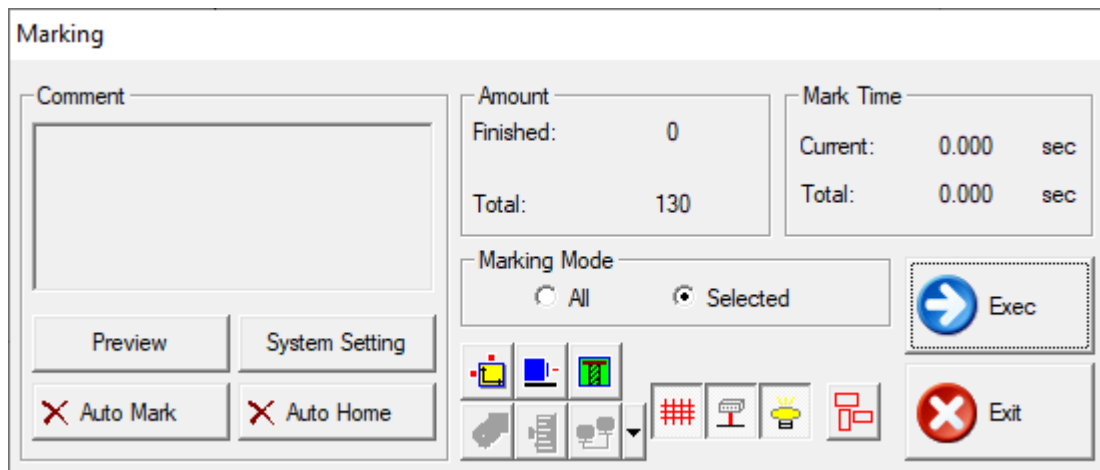

Step 7. Click “Exec” button from G-Mark marking software to starting the job.

NOTE

The auto door will always open in the service mode, please ware goggle to operate the machine.



Step 8. When the job starts, the door will close automatically, and then laser firing.

Step 9. Job complete.

Chapter **7**

External Control







I/O Pin Assignments

Laser Working Flow Chart


Laser Reaction Timing Diagram

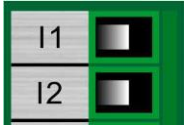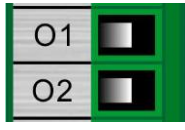7.1 I/O Pin Assignments

The I/O terminal connector is located on the bottom rear of LFC workstation, and the definition corresponding with the input and output signals on the G-Mark software as follows.


I/O		TYPE	DESCRIPTION
P1~P2		INPUT	There are 2 input signals (External device → LFC) available to communicate with external devices.
P3~P4		OUTPUT	There are 2 output signals (LFC → External device) available to communicate with external devices.
P5		INPUT	When Start- pin and Ground pin are at short status, laser marker will trigger the fire.
P6		INPUT	When Stop- pin and Ground pin are at short status, laser marker will stop working.
P7		INPUT	This is terminal used to connect external emergency stop.
P8		GND	Ground

(1) Input pins

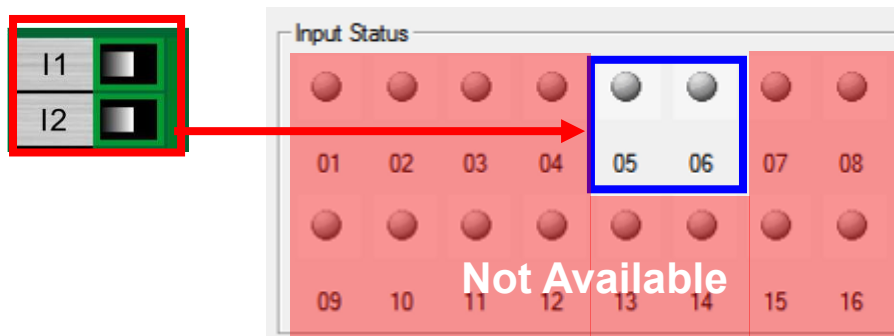

The pin 1~4 & pin 7~16 from Input status are not available to communicate with laser marker.


(2) Output pins

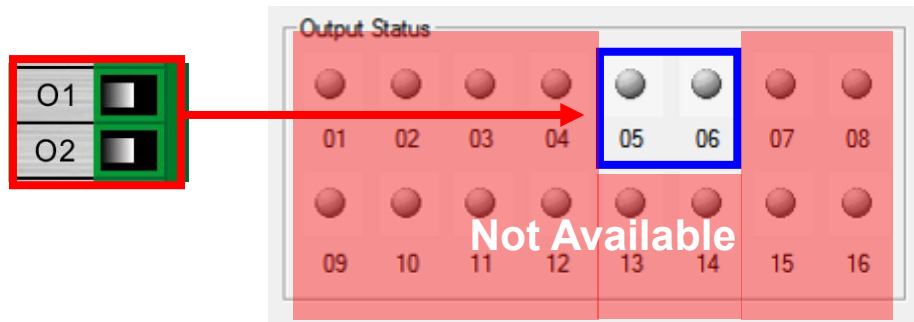


The pin 1~4 & pin 7~16 from Output status are not available to communicate with laser marker.

NOTE

High / Low definitions in G-Mark software

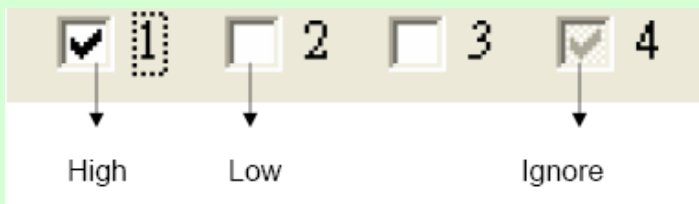

7.2 Laser Working Flow Chart

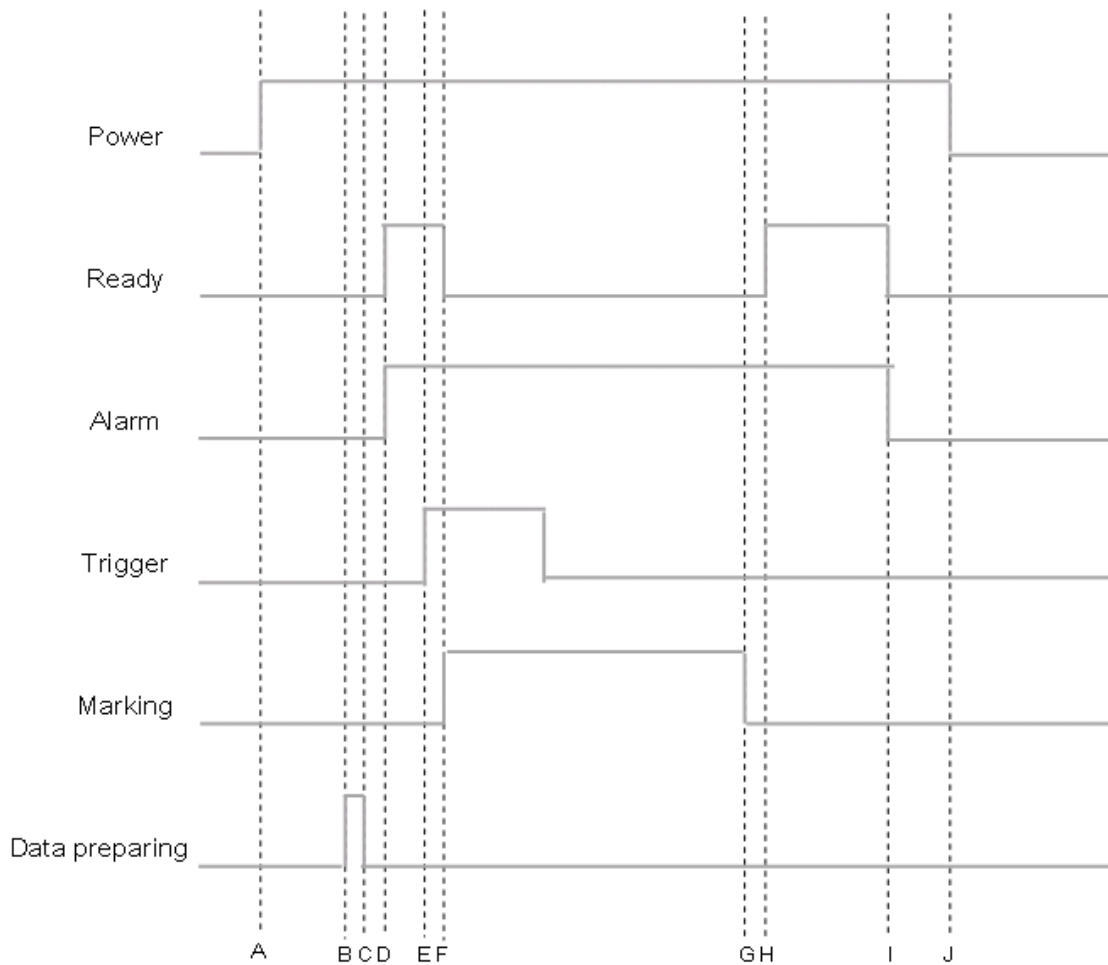


Definitions:

A	Power on
B	Time consuming between the “reading file” to the next step of “Ready to fire” depends on the size of working object.
C~D	After the file reading is completed, it will take less than $< 1\mu$ sec. for the external device to receive a “Ready” signal from the laser marker
E	It will take between 0.1m sec. ~ 50m sec. for laser to trigger firing after receive the command of “Start”
F	Ready signal is OFF when laser is firing
G	Job is completed
G~H	it will take about less than $< 1\mu$ sec. for the external device to receive a “Ready” signal from the laser marker
I	G-Mark marking software is closed
J	Power off

7.3 Laser Reaction Timing Diagram

◆ Start → Laser Firing Delaying Time


It takes about 0.1m sec X 50m sec to fire laser after receive the command of “Start”.

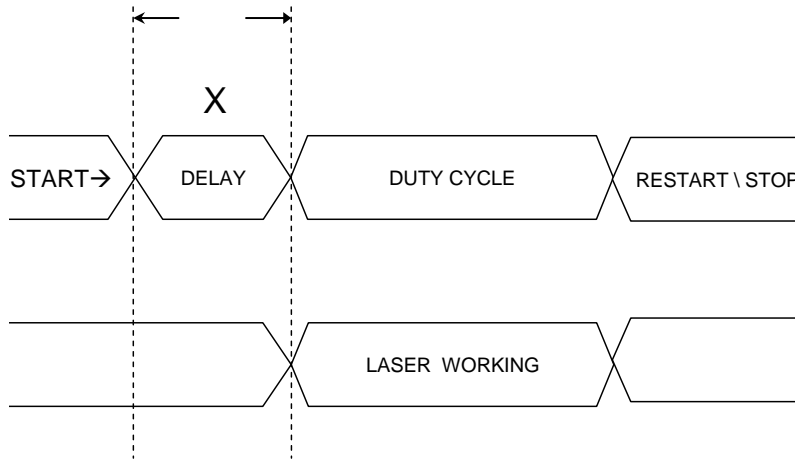

$$0.1 \text{ m sec} < X < 50 \text{ m sec}$$


◆ Laser Signal Output → External Device Delaying Time

It takes about $X < 1 \mu \text{ sec}$ for the external device to receive an output signal from the laser marker.

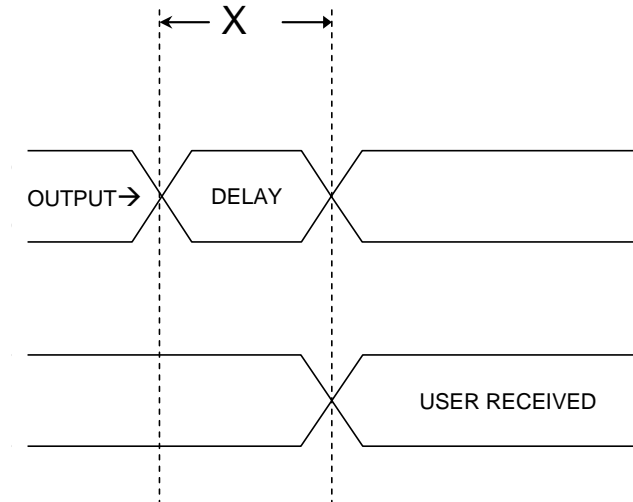

$$X < 1 \mu \text{ sec}$$

- ◆ External Device Output Signal → Laser Firing Delaying Time
It takes about $10 \mu \text{ sec} < X < 20 \mu \text{ sec}$ for the laser marker to receive an input signal from the external device

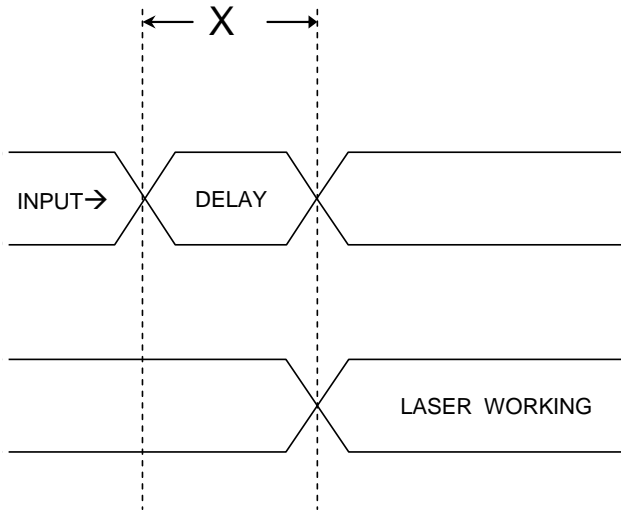

$$10 \mu \text{ sec} < X < 20 \mu \text{ sec}$$

Chapter **8**

Basic Maintenance

Regular Spot Check

Cleaning the Scan Lens

Keep the LFC Series Workstation clean and well maintained will ensure quality output, consistent reliability, and extended product life. Smoke, dust or residue built-up inside the laser system can cause reduction in the laser power, reduced product life cycle, and other potential problems which can be prevented in advance.

This section will cover how to perform regular maintenance for the scan lens of LFC Series Workstation.

The frequency of the cleaning schedule will depend on number of variables such as the types of material you work with, the immediate work environment, the frequency of use, the quality of the exhaust system, etc.



WARNING

- Always turn off and unplug the laser workstation and laser marker before cleaning!
- Electrical shock may occur if do not turn off and unplug the laser workstation and laser marker before cleaning.
- Damage may occur to the system if you do not turn off and unplug the laser workstation and laser marker before cleaning.

8.1 Regular Spot Check

Before each use, inspect the machine, power cables, connector cables, and the working environment. Look for frays in cables, proper connections, and any abnormalities that could have an effect on marking performance and/or user safety. Be sure the LFC Series Workstation is properly secured and mounted.

If a problem ever arises with the G-Mark software or the StellarMark laser marker, be sure to notify GCC local representative as soon as possible.

8.2 Cleaning the Scan Lens

Oil from hands and the residue built up on the scan lenses can distort the laser beam passing through, resulting in poor quality markings and may cause cracks on lens by the uneven heat conduction.

To clean the scan lens, simply remove the scan lens and inspect it for light and heavy residue marks.

To clean light residue marks, apply some lens cleaner on each side of the lens. Use a new, lint free cloth to remove the lens cleaner. Make sure that the cloth only travels in one direction to prevent scratching the scan lens. Let the lens dry before reattaching it to the StellarMark™. Be sure to clean only one side at a time.

To clean a heavy residue mark, apply some lens cleaner on each side of the lens. Use a cotton swab to remove the caked on residue mark. Be careful not to scratch the lens. Use acetone if the lens cleaner will not remove the mark. After the mark is removed, follow the steps used to clean light residue marks in order to finish the cleaning.



WARNING

Acetone is an **EXTREMELY FLAMMABLE LIQUID AND VAPOUR**.

The vapour is heavier than air and may spread long distances making distant ignition and flashback possible.

NOTE

Never touch the scan lens with your bare hand. The oils from your hand will distort the laser beam passing through the lens. Use finger cots or rubber gloves when cleaning.

Chapter **9**

Appendix

LFC-D Workstation Specification

Model		LFC-D
Available Laser System		CIIA12, 30
		CIIP12, 30
		IFII 20JFL, 30JFL, 60JFL, 20RMZ, 30RMZ, 50RMZ, 20SHS
		IFIIS 20JFL, 30JFL, 60JFL
Marking Fields	CO2	70 x 70mm, 140 x 140mm, 200 x 200mm, 300 x 300mm
	Fiber	70 x 70mm, 110 x 110mm, 180 x 180mm
Front Door		Automatic Door
Max. Loading		50 kg
Z-axis Travel		540 mm
Safety Class		Class 2 (EN60825-1)
Software		G-Mark
Operating System		Win 2000 / XP / Vista / 7 / 8 / 10
Interface		USB x 1, VGA x 1
Power Supply		AC Auto Switching 115 / 230V, 50-60Hz / Single Phase
Power Consumption		1240W
Operating Temperature		15C~35C
Operating Humidity		10 ~ 80% Non-condensing
Dimension		94(L) x 102(W) x 147(H)
N.W.		100 kg
G.W.		180 kg
Optional Items		Rotary Attachment
		MultiFOCUS
		Air Extraction System